


Quantum
Environmental Consultants, Inc.

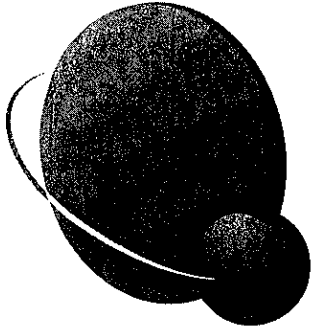

2004 OCT 29 AM 10:34
REAL ESTATE DIVISION
RECEIVED

***PHASE I ENVIRONMENTAL
SITE ASSESSMENT***

*City of Houston
Public Works and Engineering
Contract No. 55553
Task No. 03-02*

*Vacant Tract – 0.239 Acres
Northeast Corner of Navigation Blvd. and
Terminal St.
Houston, Texas 77011
Harris County
Parcel – S71-050
DWG. 8606*

Quantum Project No.: H40112

October 25, 2004

Quantum Environmental Consultants, Inc.

TEXAS LOUISIANA

888-509-4013

PHASE I ENVIRONMENTAL SITE ASSESSMENT

City of Houston

**Northeast Corner of Navigation Blvd. and Terminal St.
Houston, Texas 77011
Harris County**

Quantum Project No.: H40112


October 25, 2004

Prepared For:


**City Of Houston
611 Walker
Houston, Texas 77002
Attn.: Mr. Michael Ho, P.E.**

Prepared by:

**Quantum Environmental Consultants, Inc.
11246 South Post Oak, Ste. 104
Houston, Texas 77035**

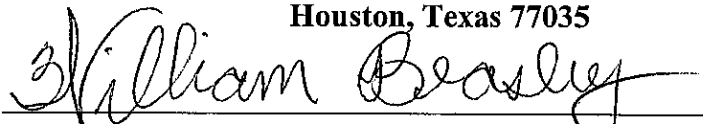

William P. Beasley, Jr., Project Manager

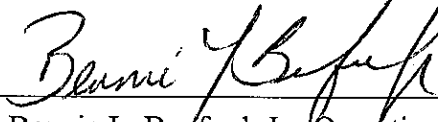

Bennie L. Benford, Jr., Operation Manager

TABLE OF CONTENTS

1.0 EXECUTIVE SUMMARY	1
2.0 INTRODUCTION.....	2
2.1 PURPOSE.....	2
2.2 DETAILED SCOPE OF SERVICES	2
2.3 SPECIAL TERMS AND CONDITIONS	3
2.4 LIMITATIONS AND EXCEPTIONS OF ASSESSMENT	3
3.0 SITE DESCRIPTION.....	4
3.1 LOCATION AND LEGAL DESCRIPTION	4
3.2 SITE AND VICINITY CHARACTERISTICS	4
3.3 CURRENT USES OF THE PROPERTY.....	4
3.4 DESCRIPTION OF STRUCTURES, ROADS, AND OTHER IMPROVEMENTS ON THE SITE.....	4
3.5 CURRENT USES OF ADJOINING PROPERTIES	5
4.0 USER PROVIDED INFORMATION	6
4.1 TITLE RECORDS	6
4.2 ENVIRONMENTAL LIENS OR ACTIVITY AND USE LIMITATIONS	6
4.3 OWNER, PROPERTY MANAGER AND OCCUPANT INFORMATION	6
5.0 RECORDS REVIEW	7
5.1 STANDARD ENVIRONMENTAL RECORD SOURCES, FEDERAL AND STATE.....	7
5.1.1 Federal National Priority List (NPL) Sites	7
5.1.2 Federal Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Sites	7
5.1.3 Federal CERCLIS No Further Remedial Action Planned (NFRAP) Sites	7
5.1.4 Federal Resource Conservation and Recovery Act (RCRA) CORRACTS Facility List.....	8
5.1.5 Federal RCRA non-CORRACTS Transportation, Storage, and Disposal (TSD) Sites List	8
5.1.6 Federal RCRA Generators List.....	8
5.1.7 Federal Emergency Response Notification System (ERNS) Sites	9
5.1.8 State CERCLIS Sites	9
5.1.9 State Landfill and/or Solid Waste Disposal Sites	9
5.1.10 State Registered Petroleum Storage Tank (PST) Sites	9
5.1.11 State Leaking Petroleum Storage Tank (LPST) Sites.....	10
5.1.12 Voluntary Cleanup Program (VCP) Sites	10
5.1.13 Orphan Sites.....	11
5.1.14 Oil Field or Exploration Sites	11

5.2	PHYSICAL SETTING SOURCE.....	11
5.3	HISTORICAL USE INFORMATION ON THE PROPERTY	12
5.3.1	Aerial Photographs.....	12
5.3.2	Historical Topographic Maps	13
5.3.3	Flood Insurance Rate Map	13
5.3.4	Sandborn Map.....	13
5.3.5	City Directory	14
6.0	SITE RECONNAISSANCE.....	15
6.1	GENERAL SITE SETTING.....	15
6.2	PHYSICAL SETTING ANALYSIS, IF MIGRATING HAZARDOUS SUBSTANCES ARE AN ISSUE	15
6.3	STORAGE TANKS.....	15
6.4	INDICATIONS OF PCBS.....	15
6.5	EXTERIOR OBSERVATIONS	15
6.6	INTERIOR OBSERVATIONS	15
6.7	HAZARDOUS SUBSTANCES AND PETROLEUM PRODUCTS IN CONNECTION WITH IDENTIFIED USES	16
6.8	HAZARDOUS SUBSTANCE AND PETROLEUM PRODUCTS CONTAINERS AND UNIDENTIFIED SUBSTANCE CONTAINERS	16
6.9	ANY OTHER CONDITIONS OF CONCERN.....	16
6.9.1	Potential Asbestos Containing Material.....	16
6.9.2	Lead.....	16
6.9.3	Noise Survey.....	16
6.9.4	Radon	18
7.0	INTERVIEWS	18
7.1	INTERVIEW WITH OWNER	18
7.2	INTERVIEW WITH ADJACENT PROPERTIES.....	18
7.3	INTERVIEW WITH LOCAL GOVERNMENT OFFICIALS	18
8.0	FINDINGS, CONCLUSIONS AND RECOMMENDATIONS.....	19
9.0	REFERENCES.....	21

LIST OF APPENDICES

<u>Appendix</u>	<u>Page</u>
A Personnel Qualifications	A-1
B Photographic	B-1
C Support Documentation	C-1
D Electronic File Search Report	D-1
E Additional Information	E-1

LIST OF FIGURES

Figure

Figure 1 – Site Map.....	Appendix C
Figure 2 – Site Layout Map	Appendix C
Figure 3 – Soil Survey Map	Appendix C
Figure 4 – Flood Insurance Rate Map	Appendix C
Figure 5 – Topographic Map	Appendix C
Figure 6 – Aerial Photograph - 2002	Appendix C
Figure 7 – Aerial Photograph – 1996.....	Appendix C
Figure 8 – Aerial Photograph – 1989.....	Appendix C
Figure 9 – Aerial Photograph – 1979.....	Appendix C
Figure 10 – Aerial Photograph – 1962.....	Appendix C
Figure 11– Aerial Photograph – 1953.....	Appendix C
Figure 12 – Aerial Photograph – 1944.....	Appendix C

LIST OF TABLES

Table

Table 1 – Registered ERNS Sites	Table
Table 2 – Registered LUST Sites	Table
Table 3 – Registered IHW Sites	Table
Table 4 - Registered RCRA-COR Sites	Table
Table 5 - Registered RCRA-GN PST Sites	Table
Table 6 - Registered States Sites	Table
Table 7 - Registered PST Sites	Table
Table 8 - Registered City Directories	Table

1.0 EXECUTIVE SUMMARY

Quantum Environmental Consultants, Inc. (Quantum) of Houston, Texas, performed a Phase I Environmental Site Assessment (ESA I) on the vacant tract of land located at the northeast corner (NEC) of Navigation Blvd. and Terminal Street, Houston, Texas, 77011 (herein referred to as the subject property). Bennie L. Benford, Jr., Environmental Specialist, performed this ESA I for Quantum. The purpose of this ESA I is to identify *recognized environmental conditions*, which could negatively impact the value of the subject property and result in significant liability to the property owner/purchaser. This report has been prepared for the exclusive use by the City of Houston. Other parties may not rely on the contents of this report without the expressed written consent of the City of Houston and Quantum.

This ESA I was prepared in conformance with the scope and limitations of ASTM Practice E 1527-00 and City of Houston's ECRE Standard Practices (dated 03/23/98). This ESA I was prepared for the City of Houston based on findings at the subject property, located at the NEC of Navigation Blvd. and Terminal Street, Houston, Texas 77011. Any exceptions or deletions from this practice are described in Section 2.0 of this report.

CONCLUSION & RECOMMENDATIONS

Research conducted for this assessment of the vacant tract of land located at the NEC of Navigation Blvd. and Terminal Street, Houston, Texas, 77011 indicate environmental conditions at nearby sites that had the potential for impact to the subject property. However, based on their distance, direction, and the reported activities, these sites are not considered likely to have adversely impacted the subject property.

Therefore, it is not recommended, at this time, that the subject property undergo further investigation.

2.0 INTRODUCTION

Mr. Michael Ho, P.E., of the City of Houston, authorized Quantum to perform a Phase I Environmental Site Assessment (ESA I) on the property located at the NEC of Navigation and Terminal Street, Houston, Texas 77011. Bennie L. Benford, Jr., Environmental Professional, conducted the ESA I on September 24, 2004. Personnel qualifications are provided in Appendix A.

2.1 PURPOSE

The purpose of this Phase I Environmental Site Assessment (ESA I) was to identify *recognized environmental conditions* that could negatively impact the value of the subject property and result in significant liability to the property owner/purchaser.

2.2 DETAILED SCOPE OF SERVICES

The Scope of Services for the completion of this Phase I ESA were as follows:

- Review available records of State and Federal regulatory authorities, permits, citations, violations, etc. relating to the subject property and adjacent properties per ASTM standards and the City of Houston ECRE Standard Practices (dated 03/23/98).
- Perform a visual inspection of the subject property and surrounding areas to determine if activities on the subject property or the surrounding land uses have or may have any potential impact on the subject property.
- Review soils information available through the United States Department of Agriculture Soil Conservation Service.
- Review site history as revealed through available aerial photographs or other available sources for the subject and surrounding properties.
- Request specific information from the local power company regarding any Polychlorinated Bi-Phenyls (PCBs) content of transformers on site, as required. (40 CFR 761 - Polychlorinated Bi-Phenyls (PCBs) Manufacturing, Processing, Distribution in Commerce, and Use Prohibitions).
- Conduct interviews with Local Government Officials including local Fire Departments, Local Health Agency, etc.

- Review other site conditions or compliance problems (not including building codes) that would require future environmental remediation and compliance expenditures.

2.3 SPECIAL TERMS AND CONDITIONS

In performing the Phase I Environmental Site Assessment (ESA I), guidelines from the ASTM Standards on Environmental Site Assessments for Commercial Real Estate E 1527-00 were generally followed except where City of Houston requirements for conducting an ESA I superseded or exempted the ASTM guidelines.

2.4 LIMITATIONS AND EXCEPTIONS OF ASSESSMENT

This ESA I was performed by Quantum in accordance with generally accepted practices of the profession in performing similar studies in the same general area and during the same general time frame. Quantum observed the same degree of care and skill generally exercised by the profession under similar circumstances. Quantum's observations and findings cannot be considered as scientific certainties. The conclusions are based on our professional judgment regarding the significance of the limited information available during the course of this study. Specifically, Quantum does not and cannot represent that the subject property contains no recognized environmental conditions, and/or other latent conditions beyond that observed by Quantum in the course of this ESA I.

3.0 SITE DESCRIPTION

3.1 LOCATION AND LEGAL DESCRIPTION

The subject property is a vacant tract of land located at the NEC of Navigation Blvd. and Terminal Street, Houston, Texas, 77011, and is currently owned by the City of Houston. A legal description for the subject property is provided in Attachment E.

A site location map and a site layout map of the subject property are included in Attachment A. Photographs taken during the site reconnaissance are included in Attachment B.

3.2 SITE AND VICINITY CHARACTERISTICS

The subject property is 0.239-acres of vacant property. According to the United States Geological Survey (USGS) Park Place, Texas Quadrangle Map (1998), the subject property is situated at an elevation of approximately 25-30 feet above mean sea level. A copy of the USGS map is provided in Appendix C.

The subject property is a rectangular tract of land, which is currently not developed. To the west is Terminal St., beyond which is a vacant lot then, railroad tracks. To the south is Navigation Blvd., beyond which is an overpass bridge. To the east is a vacant residential property. To the north are residential properties.

3.3 CURRENT USES OF THE PROPERTY

The subject property is approximately 0.239-acres of vacant property. No monitoring or water wells were located on the subject property. No septic tanks were located on the subject property.

3.4 DESCRIPTION OF STRUCTURES, ROADS, AND OTHER IMPROVEMENTS ON THE SITE

The entrance to the subject property is via Navigation Blvd. The subject property is approximately 0.239-acres of vacant property. Minimal debris was scattered on the subject property. A large tree and grass encompassed the subject property. No roads were identified across the subject property. No structures currently exist on the subject property.

3.5 CURRENT USES OF ADJOINING PROPERTIES

The current uses of the adjoining properties, which may or may not have resulted in an impact to the subject property, were identified by review of historical sources and interviews, when possible.

The subject property is approximately 0.239-acres of vacant property. To the west is Terminal Street, beyond which is a vacant lot then, railroad tracks. To the south is Navigation Blvd., beyond which is an overpass bridge. To the east is a vacant residential property. To the north are residential properties.

4.0 USER PROVIDED INFORMATION

4.1 TITLE RECORDS

The deed record states that the City of Houston purchased the subject property in 1966 from the Eddy Refining Company. A copy of the legal description is provided in Appendix 7.

4.2 ENVIRONMENTAL LIENS OR ACTIVITY AND USE LIMITATIONS

No information was available from the user regarding environmental liens or other use limitations relating to the subject property.

4.3 OWNER, PROPERTY MANAGER, AND OCCUPANT INFORMATION

No further information regarding the property owner or occupant was available.

5.0 RECORDS REVIEW

Quantum has ordered environmental lists published by the United States Environmental Protection Agency (EPA), and the Texas Commission on Environmental Quality (TCEQ), to determine if there are any known sites producing, storing, and/or disposing of toxic or hazardous materials that may impact the subject property. This information is provided below. A copy of the record search is provided in Appendix C.

5.1 STANDARD ENVIRONMENTAL RECORD SOURCES, FEDERAL AND STATE

5.1.1 Federal National Priority List (NPL) Sites

The NPL issued by the EPA, lists uncontrolled hazardous waste sites that require additional investigation to determine if they pose risks to the environment or to human health. Sites are added to the NPL based mainly on their Hazard Ranking System (HRS) scores. The HRS is a numeric system structured to evaluate the relative risks to the environment and/or human health posed by the particular type(s) of hazardous waste contamination. No NPL sites were identified within a one-mile radius of the subject property.

5.1.2 Federal Comprehensive Environmental Response Compensation and Liability Information System (CERCLIS) Sites

The CERCLIS database is a comprehensive listing of known or suspected uncontrolled or abandoned hazardous waste sites. These sites have either been investigated or are currently under investigation by the Federal EPA for the release, or threatened release of hazardous substances. Once a site is placed in CERCLIS, it may be subjected to several levels of review and evaluation and ultimately placed on the National Priorities List (NPL). As of February 1995, CERCLIS sites designated "No Further Remedial Action Planned" (NFRAP) have been removed from the CERCLIS database. No CERCLIS sites were identified within a one-mile radius of the subject property.

5.1.3 Federal CERCLIS No Further Remedial Action Planned (NFRAP) Sites

The No Further Remedial Action Planned Report (NFRAP) contains information pertaining to sites, which have been removed from the Federal EPA's CERCLIS database. NFRAP Sites may be sites where, following an initial investigation, no contamination was found, contamination was removed quickly without need for the site to be placed on the NPL, or the

contamination was not serious enough to require Federal Superfund action or NPL consideration. The subject property was not listed as a NFRAP site.

5.1.4 Federal Resource Conservation and Recovery Act (RCRA) CORRACTS Facility List

The RCRIS Corrective Action Sites (CORRACTS) database includes RCRIS sites with reported corrective action, which is published by the EPA. One CORRACTS site was identified within a one-half mile radius of the subject property. Based on the reported activities and the distance of this site from the subject property, the site is not considered likely to have adversely impacted the subject property. A summary of the site is provided in the Table Section.

5.1.5 Federal RCRA non-CORRACTS Transportation, Storage and Disposal (TSD) Sites List

Published by EPA, this list identifies facilities in which the treatment, storage, and/or disposal of hazardous waste take place, as defined and regulated by RCRA. Information pertaining to the status of facilities tracked by the RAATS is included in the RCRIS-TSD report. No RCRA-TSD facilities were identified within a one-mile radius of the subject property.

5.1.6 Federal RCRA Generators List

The Resource Conservation and Recovery Information System (RCRIS) large-quantity generators report contains information pertaining to facilities, which either generate more than 1,000 kg of hazardous waste per month, or meet other applicable requirements of RCRA. Information pertaining to the status of facilities tracked by the RCRA Administrative Action Tracking System (RAATS) is included in the RCRIS large quantity generator report. No large-quantity generator sites were identified within a one-quarter mile radius of the subject property. Neither the subject property nor any adjoining properties were identified as a RCRIS large-quantity generator sites.

The Resource Conservation and Recovery Information System (RCRIS) small quantity Generator list contains sites, which generate between 100 kg and 1000 kg of hazardous waste per month. Seven RCRIS-SQG sites were identified within a one-quarter mile radius of the subject property. Six of the sites are reported to have no past or present violations, according to the records search. The Reedhycalog LP located at 6501 Navigation Blvd., Houston, Texas 77011 had previous violations but no current violations.

Based on the historical information obtained from the RCRIS database, these sites are not expected to adversely impact the subject property. There are no RCRIS-SQG sites identified within 500 feet of the subject property. A summary of these sites is provided in the Table Section.

5.1.7 Federal Emergency Response Notification System (ERNS) Sites

The ERNS is a national database which contains information from spill reports regarding reported releases of hazardous substances, including petroleum, made to Federal authorities including the EPA, the United States Coast Guard, the National Response Center, and the Department of Transportation. The ERNS reporting system contains preliminary information on specific releases, including the spill location, the substance released, and the responsible party. Two ERNS sites were identified within a one-quarter mile radius of the subject property. Based on the distance and location from the subject property, these sites are not considered likely to have the potential to adversely impact the subject property. A summary of these sites is provided in the Table Section.

5.1.8 State CERCLIS Sites

The Texas State Superfund Quarterly Status Report contains information on abandoned or inactive hazardous waste sites in the State of Texas that do not qualify for federal Superfund action and cannot be resolved under the hazardous waste program or an agreed administrative order. Potential State Superfund sites receive a Hazard Ranking Score and a remedial investigation/feasibility study. If these studies suggest that the facility poses an imminent and substantial endangerment to the environment or public health and safety, the proposed site is formally listed on the State Superfund Report. The Texas State Superfund is equivalent to the state CERCLIS. No State Superfund sites were identified within a one-mile radius of the subject property.

5.1.9 State Landfill and/or Solid Waste Disposal Sites

The TCEQ Solid Waste Management Facilities Directory is a comprehensive listing of all reported active and inactive permitted solid waste facilities and landfill sites operating within the State of Texas. No Solid Waste facilities were identified within a one-mile radius of the subject property.

5.1.10 State Registered Petroleum Storage Tank (PST) Sites

The TCEQ PST report is a comprehensive listing of all registered aboveground and underground storage tanks located within the State of Texas. Seven registered Underground Storage Tank (UST) sites were identified within a one-quarter-mile radius of the subject property. All seven sites have had their tanks removed from the ground or permanently filled in place. Based on the reported activities of these sites, the sites are not considered likely to have adversely impacted the subject property. There are no UST sites identified within 500 feet of the subject property. A summary of these sites is provided in the Table Section.

5.1.11 State Leaking Petroleum Storage Tank (LPST) Sites

The TCEQ Leaking Petroleum Storage Tank (LPST) report contains information pertaining to reported leaking underground storage tanks, spills, and tank overfills located within the State of Texas. Fourteen Leaking Petroleum Storage Tank (LPST) sites were identified within a one-half-mile radius of the subject property. Nine of the fourteen sites have been issued closure by the TCEQ, indicating no further action is warranted. Four of the sites have had the tanks removed from the ground but continue to have monitoring activities. One site, the Exxon#61140 located at 619 Wayside, currently has tanks in use along with monitoring activities. Based on the reported activities of the sites, these sites are not considered likely to have adversely impacted the subject property. There are no LPST sites identified within 500 feet of the subject property. A summary of these sites is provided in the Table Section.

5.1.12 Voluntary Cleanup Program (VCP) Sites

The Texas Voluntary Cleanup Program (VCP) Sites database includes information on sites enrolled in the Texas Voluntary Cleanup Program. Five VCP sites were identified within a one-half-mile radius of the subject property. Based on the distance and location from the subject property, these facilities are not expected to adversely impact the subject property. A summary of these sites is provided in the Table Section.

5.1.13 Orphan Sites

Orphan sites (sometimes referred to as unplotable sites) were reported in the electronic file search. These are sites, which are selected by zip code, county, or another search criteria, but for which there is not enough information in the database to plot the site on the map. Unplotable sites can sometimes be verified during the site visit, but are not always apparent. Unplotable sites

may have the potential to impact the subject property. Based on a review of this information, twelve Texas Industrial Hazardous Waste Notice of Registration sites were identified which are believed to have the potential to impact the subject property. A summary of these sites is provided in the Table Section.

5.1.14 Oil Fields or Exploration Sites

Oil Fields or Exploration Sites database includes information on active or abandoned sites enrolled in the Railroad Commission of Texas. No oil field or exploration sites were identified within a one-half mile radius of the subject property.

5.2 PHYSICAL SETTING SOURCE

The United States Geological Survey (USGS) provides topographic information for the site and vicinity. Based on the USGS Park Place, Texas Quadrangle map, the subject property is situated at an elevation of approximately 25-30 feet above mean sea level. The Federal Emergency Management Agency (FEMA), Harris County, Texas identifies the panel as No. 48201C0885K, April 20, 2000 which is outside the 500-year flood zone. A copy of the topographic map is provided in Appendix C.

Soils

The "Soil Survey of Harris County, Texas" published by the United States Department of Agriculture, Soil Conservation Service, in cooperation with Texas Agricultural Experiment Station and Texas State Soil and Water Conservation Board, was reviewed for soil. Based on this soil survey, soils underlying the subject property include the Aldine-Urban Land complex (An). Aldine-Urban Land complex is a nearly level to gently sloping complex in metropolitan areas and in rural areas where the population is increasing. This mapping unit is of minor extent. Areas are irregular in shape and generally range from 30 to 250 acres in size. One area, however, covers 1,200 acres. Boundaries commonly coincide with the outer limits of subdivision and built up areas. The slope is mainly 0 to 2 percent but ranges to 3 percent. In a few places along drainageways the slope is 5 percent. Native pine and hardwoods are common in most areas.

The Aldine soil makes up 25 to 75 percent of this complex, Urban land 10 to 75 percent, and other soils 5 to 20 percent. The areas are so intricately mixed that it was not feasible to separate them at mapping scale for this survey.

The surface layer of the Aldine soil is friable, medium acid, dark grayish brown very

fine sandy loam about 5 inches thick. The layer below that is friable, medium acid, grayish brown very fine sandy loam about 5 inches thick. It tongues into a layer of friable, very strongly acid, gray clay that has mottles of yellowish brown and red. Below that, extending to a depth of 60 inches, is a layer of firm, slightly acid, light gray clay loam that has less mottles with depth.

Urban land consists of soils that have been altered or obscured by buildings and other urban structures, making their classification impractical. Typical structures are single- multiple-unit dwellings, garages, sidewalks, patios, driveways, streets, schools, churches, shopping centers, office buildings, paved parking lots, and industrial parks. Included with Urban land in mapping are small areas of the Aldine soil that have been altered by cutting, filling, and grading. In places, 6 to 24 inches of fill material has been added to improve drainage.

Included with this unit in mapping are a few areas of Atasco, Bissonnet, Aris, Hockley, Segno, Vamont, and Ozan soils. These soils are unaltered in places.

5.3 HISTORICAL USE INFORMATION ON THE PROPERTY/ADJOINING PROPERTIES

Historical aerial photographs were obtained from the Bank Information, Inc. for multiple decades dating from the near present to as far back as 1944. Aerial photographs were obtained for the years 2002, 1996, 1989, 1979, 1962, 1953 and 1944. The historical aerial photographs are presented as Appendix C.

5.3.1 Aerial Photographs

The 1944 aerial photograph identified the subject property to be vacant and undeveloped with no existing structures. The adjoining properties use are identified as residential properties to the north, Terminal Street to the west, a vacant property to the east and Navigation Blvd. to the south, beyond which was vacant and residential properties.

The 1953 aerial photograph identified the subject property similar to the 1944 photograph. The adjoining properties use was identified to be residential and vacant properties.

The 1962 aerial photograph identified the subject property to be vacant and undeveloped, similar to the 1953 photograph. The adjoining properties use was identified to be more residential to the north with a newly constructed Overpass Bridge to the south.

The 1979 aerial photograph identified the subject property similar to the 1962 photograph. The adjoining properties use continued to be residential to the north and more commercial development to the south, beyond Overpass Bridge.

The 1989 aerial photograph identified the subject property to have some vegetation. The adjoining properties use was identified the same as in the 1979 photograph.

The 1996 aerial photograph identified the subject property to have some vegetation. The adjoining properties use was identified the same as in the 1989 photograph.

The 2002 aerial photograph identified the subject property to be as it is today. Copies of these aerial photographs are provided in Appendix C.

5.3.2 Historical Topographic Maps

A historical topographic map dated 1998 was reviewed for the subject property. Based on a review of this map, no structures appeared on the subject property. A copy of the map is provided in Appendix C.

5.3.3 Federal Emergency Management Agency (FEMA) Flood Insurance Rate Map

The Federal Emergency Management Agency (FEMA), Harris County, Texas Flood Insurance Rate Map No. 48201C0885K, April 20, 2000 shows that the subject property lies in Zone X. Zone X is defined to be inside the 500-year flood plain. A copy of the map is provided in Appendix C.

5.3.4 Sanborn Maps

Historical Sanborn maps dated 1969, 1950, 1947 and 1925 were reviewed for the subject property. In 1925 to 1950, the subject property appeared to be vacant and undeveloped. However in 1969, a single standing structure appeared on the east corner of the subject property. According to the site reconnaissance dated September 24, 2004, the subject property is a vacant tract of land.

The adjoining properties appeared to be vacant and residential with public streets to the south and west of the subject property in 1925 to 1950. In 1969, a small building appeared on the east corner of the subject property. Copies

of the Sanborn maps are provided in Appendix E.

5.3.5 City Directory Search

Quantum reviewed city directories, dated every ten years, back to the year 1920, to identify any residential or commercial properties noted as dwelling or operating on the subject property. The subject property was observed mainly as a vacant tract from 1925 to 1950. Later in 1969, a single building was observed on the east corner of the subject property.

Additionally, the city directories search was enhanced to encompass the adjoining and surrounding properties. A review of the adjoining and surrounding properties found vacant and residential tracts of land from 1925 to 1969. A copy of the city directories is provided in Appendix 7.

6.0 SITE RECONNAISSANCE

6.1 GENERAL SITE SETTING

Drainage

Surface water drainage at the subject property is via storm drainage on Navigation Blvd.

6.2 PHYSICAL SETTING ANALYSIS, IF MIGRATING HAZARDOUS SUBSTANCES ARE AN ISSUE

Migration of hazardous substances from offsite sources onto the subject property does not appear to be an issue.

6.3 STORAGE TANKS

No underground or aboveground storage tanks were identified on the subject property from the site reconnaissance.

6.4 INDICATIONS OF PCBS

No transformers were identified on the subject property. No other potential polychlorinated biphenyl (PCB) containing equipment was identified on the subject property.

6.5 EXTERIOR OBSERVATIONS

The subject property is a vacant 0.239-acre tract of land. No stained soil or discolored vegetation was identified on the subject property. No water, gas, oil field or monitoring wells were identified on the subject property. Photographs of the subject property are provided in Appendix B.

6.6 INTERIOR OBSERVATIONS

The subject property is a vacant 0.239-acre tract of land. The subject property does not appear to have been developed since 1925.

6.7 HAZARDOUS SUBSTANCES AND PETROLEUM PRODUCTS IN CONNECTION WITH IDENTIFIED USES

There are no known uses of hazardous substances or petroleum products associated with the current use of the subject property.

6.8 HAZARDOUS SUBSTANCE AND PETROLEUM PRODUCTS CONTAINERS AND UNIDENTIFIED SUBSTANCE CONTAINERS

The subject property is a vacant 0.239-acre tract of land. The subject property does not appear to have been developed. No hazardous substance and petroleum containers were identified on the subject property.

6.9 ANY OTHER CONDITIONS OF CONCERN

6.9.1 Potential Asbestos Containing Material

Asbestos sampling was not included in the scope of services for this Phase I ESA.

6.9.2 Lead

Lead Sources

Lead has the potential to affect virtually every system of the body. While it is harmful to individuals of all ages, lead exposure can be especially damaging to children, fetuses and women of childbearing age. The most common sources of lead include water pipes that used a lead-based solder, lead-based paints and soils that have been impacted by chipping/flaking/peeling lead-based paint. The scope of this project did not include the analysis of potential lead hazards.

6.9.3 Noise Survey

The subject property is not located near, or adjacent to industrial zones, or civil or military airfields. Therefore, no noise survey was conducted for this ESA I.

6.9.4 Radon

The Environmental Protection Agency's Science Advisory Board has determined that radon levels of four picocuries per liter (pCi/L) and greater creates a health risk. The average outdoor radon level is 0.4 pCi/L. No radon level was conducted for this ESA I.

7.0 INTERVIEWS

7.1 INTERVIEW WITH OWNER

No interview was conducted with the owner.

7.2 INTERVIEW WITH ADJACENT PROPERTIES

J.B. Smith, located to the south of the subject property, is a piping manufacturing facility. Quantum spoke with Mr. Wesley F. Cowan (Environmental Health & Safety Coordinator) who stated that the facility is listed with TCEQ and the gradient is to the southwest.

Abogado, Attorney at Law, located to the east of the subject property, is an attorney at law. Quantum spoke with Ms. Vanessa (Assistant Attorney) who stated that no environmental issues existed onsite or on surrounding properties.

Ms. Rosalba Heredia, located to the north the subject property, is the residential property owner. Quantum spoke with Mr. Mark (Assistant Manager) who stated that no environmental issues existed onsite or on surrounding properties.

7.3 INTERVIEW WITH LOCAL GOVERNMENT OFFICIALS

A written request to the City of Houston Fire Department was submitted on September 20, 2004 for information relating to records of historical operations and/or records of hazardous materials in connection with subject property. No recorded information was identified from the Fire Department.

8.0 FINDINGS, CONCLUSIONS AND RECOMMENDATIONS

Quantum has performed a Phase I Environmental Site Assessment (ESA I) in conformance with the scope and limitations of ASTM Practice E 1527-00 and ECRE Standards of the subject property a vacant tract of land located at the NEC of Navigation Blvd. and Terminal Street, Houston, Texas, 77011.

Based on the site investigation and the information contained in this report, the following detailed conclusions of the subject property have been reached:

- *Seven registered Underground Storage Tank (UST) sites were identified within a one-quarter-mile radius of the subject property. All seven sites have had their tanks removed from the ground or permanently filled in place. Based on the reported activities of the sites, these sites are not considered likely to have adversely impacted the subject property. There are no UST sites identified within 500 feet of the subject property.*
- *Fourteen Leaking Petroleum Storage Tank (LPST) sites were identified within a one half- mile radius of the subject property. Nine of the fourteen sites have been issued closure by the TCEQ, indicating no further action is warranted. Four of the sites have had the tanks removed from the ground but continue to have monitoring activities. One site, the Exxon#61140 located at 619 Wayside, currently has tanks in use along with monitoring activities. Based on the reported activities of the sites, these sites are not considered likely to have adversely impacted the subject property. There are no LPST sites identified within 500 feet of the subject property.*
- *Twelve Texas Industrial Hazardous Waste Notice of Registration sites were identified within a one-quarter mile radius of the subject property. The TCEQ enters all information submitted by industrial and hazardous waste transporters, receivers (including recyclers), generators and one time shipments into a database that tracks industrial and hazardous waste generation and management activities in the state of Texas. Based on the reported activities of the sites, these sites are not considered likely to have adversely impacted the subject property.*
- *Seven RCRIS-SQG sites were identified within a one-quarter mile radius of the subject property. Six of the sites are reported to have no past or present violations, according to the records search. The Reedhycalog LP located at 6501 Navigation Blvd., Houston, Texas 77011 had previous violations but no current violations. Based on the historical information obtained from the RCRIS database, these sites are not expected to adversely impact the subject property. There are no RCRIS-SQG sites identified within 500 feet of the subject property.*

- *One CORRACTS site was identified within a one-half mile radius of the subject property. The RCRIS Corrective Action Sites (CORRACTS) database includes RCRIS sites with reported corrective action, which is published by the EPA. Based on the reported activities and the distance of this site, the site is not considered likely to have adversely impacted the subject property.*
- *The Emergency Response Notification System (ERNS) List is a national database containing information from spill reports made to Federal authorities including the EPA, the United States Coast Guard, the National Response Center, and the Department of Transportation regarding reported releases of oil and hazardous substances. Two ERNS sites were identified within a one-quarter mile radius of the subject property. Based on the distance and location from the subject property, these sites are not considered likely to have the potential to adversely impact the subject property.*
- *The Texas Voluntary Cleanup Program (VCP) Sites database includes information on sites enrolled in the Texas Voluntary Cleanup Program. Five VCP sites were identified within a one-half mile radius of the subject property. Based on the distance and location from the subject property, these sites are not expected to adversely impact the subject property.*

CONCLUSION

Research conducted for this assessment of the vacant tract of land located at the NEC of Navigation Blvd. and Terminal Street, Houston, Texas, 77011 indicate environmental conditions at nearby sites that had the potential for impact to the subject property. However, based on their distance, direction, and the reported activities, these sites are not considered likely to have adversely impacted the subject property.

RECOMMENDATIONS

Therefore, it is not recommended that the subject property undergo further investigation.

9.0 REFERENCES

- "The Bank Information Solutions, Inc." Environmental FirstSearch Report, September 2004
Houston, Texas, Yahoo Location Map, 2004.
- "The Aerial Photography Print Service", Aerial Photograph, 2002.
- "The Aerial Photography Print Service", Aerial Photograph, 1996.
- "The Aerial Photography Print Service", Aerial Photograph, 1989.
- "The Aerial Photography Print Service", Aerial Photograph, 1979
- "The Aerial Photography Print Service", Aerial Photograph, 1962
- "The Aerial Photography Print Service", Aerial Photograph, 1953
- "The Aerial Photography Print Service", Aerial Photograph, 1944
- "The Bank Information", Sanborn Maps, 1925
- "The Bank Information", Sanborn Maps, 1947
- "The Bank Information", Sanborn Maps, 1950
- "The Bank Information", Sanborn Maps, 1969
- United States Department of Agriculture, Soil Conservation Service, Soil Survey of Harris County, Texas.
- United States Department of the Interior, Geological Survey, Park Place, Harris County, Texas, 7.5 Minute Quadrangle Topographic Map, 1998.
- United States Federal Emergency Management Agency. Flood Insurance Rate Map 480201C0885K, April 2000.

TABLES

TABLE 1 REGISTERED ERMS SITES WITHIN 0.5-MILE OF SUBJECT PROPERTY			
FACILITY NAME AND ADDRESS	DISTANCE/ DIRECTION FROM SUBJECT PROPERTY	SUBSTANCE RELEASED	MEDIA IMPACTED/ STATUS
Martex Shipping Greensport Terminal Industrial Houston, TX	Non GC	Not Reported	Closed
SMQI Services Jacinto Port Bell Haven Terminal Houston, TX	Non GC	Not Reported	Closed

TABLE 2 REGISTERED LUST SITES WITHIN 0.5-MILE OF SUBJECT PROPERTY			
FACILITY NAME AND ADDRESS	DISTANCE/ DIRECTION FROM SUBJECT PROPERTY	SUBSTANCE RELEASED	MEDIA IMPACTED/ STATUS
Reed Tool Co. Facility Area 1 6501 Navigation Blvd. Houston, TX 77011	0.03 Miles/ NW	Not Reported	GW Impacted Monitoring
Chevron 1215 Wayside Houston, TX 77011	0.26 Miles/SE	Not Reported	GW Impacted Case Closed
Baker Packers Oil Tool Co. 6023 Navigation Houston, TX 77001	0.34 Miles/ NW	Not Reported	Soil Contamination Case Closed
Mustang Equipment 6006 Navigation Houston, TX 77012	0.36 Miles/NW	Not Reported	Soil Contamination Case Closed
Gulf Reduction Corp 6020 Esperson Houston, TX 77011	0.36 Miles/SW	Not Reported	GW Impacted Monitoring
Wayside Texaco 707 North Wayside Houston, TX 77011	0.38 Miles/SE	Not Reported	Vapor Impacted Monitoring
Blas Kote Inc. 6125 Industrial Way Houston, TX 77011	0.40 Miles/NW	Not Reported	No GW Impacted Case Closed
General Stevedores Inc. 6125B Industrial Way Houston, TX 77011	0.40 Miles/NW	Not Reported	No GW Impacted Case Closed
Exxon #61140 6901 Navigation Houston, TX 77011	0.41 Miles/SE	Not Reported	Soil Contamination Case Closed
Exxon #61140 6901 Navigation Houston, TX 77011	0.41 Miles/SE	Not Reported	GW Impacted Site Assessment
Chevron #60108012 619 Wayside Houston, TX 77011	0.42 Miles/SE	Not Reported	GW Impacted Case Closed
Fire Station 20 6902 Navigation Houston, TX 77011	0.42 Miles/SE	Not Reported	GW Impacted Monitoring
Magnolia Park Service Center 104 N. Greenwood Houston, TX 77011	0.42 Miles/SW	Not Reported	GW Impacted Case Closed
TransEnergy Construction Services 6203 Industrial Way Houston, TX 77011	0.43 Miles/NW	Not Reported	Assessment Incomplete Case Closed

TABLE 3 REGISTERED OTHER SITES WITHIN 0.5-MILE OF SUBJECT PROPERTY			
FACILITY NAME AND ADDRESS	DISTANCE/ DIRECTION FROM SUBJECT PROPERTY	SUBSTANCE RELEASED	MEDIA IMPACTED/ STATUS
J. B. Smith MFG 6618 Navigation Blvd. Houston, TX 77011	0.02 Miles/S	Not Reported	Active
Diesel Pump & Injector 6632 Navigation Blvd Houston, TX 77011	0.02 Miles/SE	Not Reported	Inactive
Reedhycalog 6501 Navigation Blvd Houston, TX 77011	0.05 Miles/NW	Not Reported	Active
Central Park Sheet Metal 6647 Navigation Blvd. Houston, TX 77011	0.09 Miles/SE	Not Reported	Inactive
Seminole Tubular Products Co. 619 Wayside Houston, TX 77261	0.17 Miles/NW	Not Reported	Active
Omsco Company 6418 Eperson St. Houston, TX 77261	0.17 Miles/SW	Not Reported	Active
National Supply Co. 6229 Navigation Blvd. Houston, TX 77011	0.19 Miles/NW	Not Reported	Inactive
Electro Coatings Navigation Plant 6220 Navigation Blvd. Houston, TX 77011	0.20 Miles/NW	Not Reported	Active
Cummins Recon Tool 6230 Navigation Houston, TX 77011	0.22 Miles/NW	Not Reported	Inactive
ICO Inc. 630 McFarland Houston, TX 77011	0.23 Miles/NW	Not Reported	Inactive
The Dale Company 6216 Navigation Houston, TX 77011	0.25 Miles/NW	Not Reported	Inactive

TABLE 4 REGISTERED RCRA-COR SITES WITHIN 0.5-MILE OF SUBJECT PROPERTY			
FACILITY NAME AND ADDRESS	DISTANCE/ DIRECTION FROM SUBJECT PROPERTY	SUBSTANCE RELEASED	MEDIA IMPACTED/ STATUS
Parkans International LLC 5521 Armour Dr. Houston, TX 77020	0.97 Miles/NW	Not Reported	Corrective Action

TABLE 5 REGISTERED RCRA-N SITES WITHIN 0.5-MILE OF SUBJECT PROPERTY			
FACILITY NAME AND ADDRESS	DISTANCE/ DIRECTION FROM SUBJECT PROPERTY	SUBSTANCE RELEASED	MEDIA IMPACTED/ STATUS
JB Smith Mfg. Co. Inc. 6618 Navigation Blvd. Houston, TX 77011	0.02 Miles / S	Not Reported	Unknown/ No Violations
Diesel Pump & Injector Svc. 6632 Navigation Blvd. Houston, TX 77011	0.02 Miles / SE	Not Reported	Unknown/ No Violations
Reedhycalog LP 6501 Navigation Blvd Houston, TX 77011	0.05 Miles/NW	Not Reported	Unknown/ No Violations
Omsco Industries 6418 Eperson St. Houston, TX 77261	0.17 Miles/SW	Not Reported	Unknown/ No Violations
New Tech Rock Bit 6230 Navigation Houston, TX 77011	0.22 Miles/NW	Not Reported	Unknown/ No Violations
The Dale Co 6216 Navigation Houston, TX 77011	0.25 Miles/NW	Not Reported	Unknown/ No Violations

TABLE 6 REGISTERED STATE SITES WITHIN 0.5 MILE OF SUBJECT PROPERTY			
FACILITY NAME AND ADDRESS	DISTANCE / DIRECTION FROM SUBJECT PROPERTY	SUBSTANCE RELEASED	MEDIA IMPACTED/ STATUS
Foster Products Corporation 6107 Industrial Way Houston, Texas	0.40 Miles / NW	Not Reported	Investigation
Unoccupied Industrial Site (Fontenot) 6125 Industrial Way Houston, Texas	0.40 Miles / NW	Not Reported	Investigation
Metal Prep 501 North Greenwood Street Houston, Texas	0.61 Miles / NW	Not Reported	Investigation
Americanos USA 7004 Harrisburg Blvd. Houston, Texas	0.82 Miles / SE	Not Reported	Completed
Pentron Incorporated 323 Avenue J Houston, Texas	0.83 Miles / NW	Not Reported	Completed

TABLE 7 REGISTERED UST SITES WITHIN 0.5 MILE OF SUBJECT PROPERTY		
FACILITY NAME AND ADDRESS	DISTANCE / DIRECTION FROM SUBJECT PROPERTY	NUMBER OF TANKS SUBSTANCE(S) AND STATUS
JB Smith MFG Co. 6618 Navigation Houston, Texas 77011	0.02 Miles /SE	No. of tanks - 2 Perm. Filled in Place
Reed Tool Company 6501 Navigation Houston, Texas 77011	0.03 Miles/NW	No. of tanks - 16 Removed from ground
Plowden Supply Co. 6300 Navigation Houston, Texas 77011	0.14 Miles/NW	No. of tanks - 1 Removed from ground
Omsco Industries Inc. 6418 Esperson St. Houston, Texas 77011	0.14 Miles/SW	No. of tanks - 2 Removed from ground
Hughes Drilling Equipment 6247 Navigation Houston, Texas 77001	0.19 Miles/NW	No. of tanks - 2 Perm. Filled in Place
National Supply Co.- Div. Of Armco 6501 Navigation Blvd Houston, Texas 77011	0.21 Miles/NW	No. of tanks - 2 Removed from ground
Houston Keg Sales 6739 Navigation Houston, Texas 77011	0.21 Miles/SE	No. of tanks - 6 Perm. Filled in Place

**TABLE 8
COLE/CITY DIRECTORIES SEARCH SUMMARY**

VACANT PROPERTY - NAVIGATION @ TERMINAL STREET, HOUSTON, TEXAS 77011

YEAR	ADDRESS	LISTING
1920	NF	
1930	6614 Navigation	Vacant
1930	6615 Navigation	Templet
1930	6624 Navigation	Kordowits
1930	6626 Navigation	Slovaceks
1930	6634 Navigation	Rush DD
1930	6647 Navigation	Dorris, JV
1930	6656 Navigation	Engler, AJ
1944-45	6505 Navigation	Vacant
1944-45	6611 Navigation	Vacant
1944-45	6615 Navigation	Raby, Evelina
1944-45	6637 Navigation	Vacant
1944-45	6628 Navigation	Caesar, Juilus
1944-45	6639 Navigation	Mandola, SD
1950	6615 Navigation	Evalina Raby
1950	6618 Navigation	Texas Armature Wks
1950	6626 Navigation	Ashlock, Mary
1950	6628 Navigation	Barley, Jack
1950	6630 Navigation	Jones, Chaes
1950	6632 Navigation	Kirby Motor Co.
1950	6637 Navigation	Vacant
1950	6643 Navigation	Mahaftey Radio
1950	6645 Navigation	Hydrau Equip
1960	6501 Navigation	Reed Roller Bit Co.
1960	6505 Navigation	Tx Steel Fab
1960	6618 Navigation	Tx Armature Wks
1960	6626 Navigation	Ashlock, Nursery
1960	6628 Navigation	Jimensolve
1960	6635 Navigation	Butcher Carter
1960	6637 Navigation	Vacant
1960	6643 Navigation	Mahaftey Radio
1970	6515 Navigation	NP
1970	6618 Navigation	JB Smith
1970	6626 Navigation	NP
1970	6628 Navigation	NP
1970	6630 Navigation	Martha A Gunter
1970	6632 Navigation	Diesel Pump & Inject
1970	6635 Navigation	Butcher, Carter
1970	6647 Navigation	Ecentra Park Mt
1970	6657 Navigation	Bill Kellow Rftn
1970	6501 Navigation	Diamon Metal Div
1970	6506 Navigation	Dale Company

Note: NP-No Publication NF - No Found

APPENDIX A PERSONNEL QUALIFICATIONS



BENNIE LEE BENFORD, JR., CAPM

Environmental Engineer/Project Manager

EDUCATION

B.S., Civil Engineering Technology; Chemistry
Texas Southern University, 1991

PROFESSIONAL REGISTRATION

- LPST Corrective Action Project Manager (TX #CAPM00784, 1996)

PROFESSIONAL SUMMARY

Mr. Benford has over 14 years of experience in retail marketing petroleum industry and hazardous waste management; remediation of soil and water treatment; groundwater compliance; Phase I and II; LPST reimbursement preparation and negotiations and RCRA soil and water investigations.

PROFESSIONAL EXPERIENCE

- **Project Engineer and Field Manager** for more than 200 PST assessment projects in Texas and Louisiana. Managed and/or supervised more than 300 underground storage tank closure projects. Coordinated and managed numerous soil and groundwater remediation systems. Supervised field operations associated with soil incineration, dual phase extraction, emergency response and well installation projects. Managed numerous remediation system O&M projects ensuring optimal remedial efficiencies. Performed in excess of 1500 sites monitoring, gauging, and sampling events. Performed several aerial assessments for industrial and real estate transactions. Trained more than 30 field technicians, geologists, and engineers in strict field protocol and QA/QC parameters with regard to regulatory and institutional guidelines.
- **Project Manager** for various projects including RCRA facility investigations, soil and Groundwater investigations, UST closures, Phase I & II Assessments, Risk Assessments and regulatory negotiations.

TRAINING / CERTIFICATIONS

- HAZWOPER OSHA 1910.120 40-Hour Training with 8-Hour Management Training and Annual Refreshers
- Corrective Action Project Manager - TCEQ Certification - 1996
- Motorola - Quest for Quality Training - 1999
- UST Management and Compliance Assistance Seminar - 2000
- Applied Environmental Statistics, Darcy Environmental Group, Inc. - 1999 & 2000
- Texas Risk Reduction Program (TRRP), Groundwater Services - 2001
- MTBE Treatment Technology: Design/Implementation - 2001
- TPDES Multi-Section Storm Water Permit Training- 2002

PRESENTATIONS

- Benford, Jr., Bennie and Tina Luckman, "Phase II Environmental Site Assessments-Due Diligence." Presented to the SBA in Houston, Texas in May 2001.
- Benford, Jr., Bennie and Tim Craft, "Risk Based Assessment for LPST Sites." Presented in Quantum Seminar in Houston, Texas to Chevron, Shell and Texaco in May 1997.



William L. Beasley
QA/QC Project Manger

EDUCATION

B.A., Management Accounting
Texas Southern University, 1985

PROFESSIONAL REGISTRATION

- Registered NCA Certified Lab Technician

PROFESSIONAL SUMMARY

Mr. Beasley has approximately 6 years experience in environmental consulting and field investigations. Served as QA/QC Project Manager on Texas Department of Transportation projects, and Texas Natural Resource Conservation Commission projects. His project experience includes cost estimating, scheduling, field engineering and water/soil classification and disposal.

PROFESSIONAL EXPERIENCE

- **QA/QC Project Manager** performed numerous Phase I and II site assessments and sediment sampling investigations. Researched and made recommendations for aboveground fuel containment system, and supervised installation. Performed various projects including RCRA facility investigations, soil and groundwater investigations, emergency response, UST closures and Risk Assessments and regulatory negotiations.
- **Production Manager** in charge of production and produce all ice cream. In the three years of service, the gross sales have gone from 150,000 annually to 400,000 annually.

TRAINING / CERTIFICATIONS

- HAZWOPER OSHA 1910.120 24-Hour Training

APPENDIX B SITE PHOTOGRAPHS

**Vacant Tract
NEC of Navigation & Terminal Street
Houston, Texas 77011**

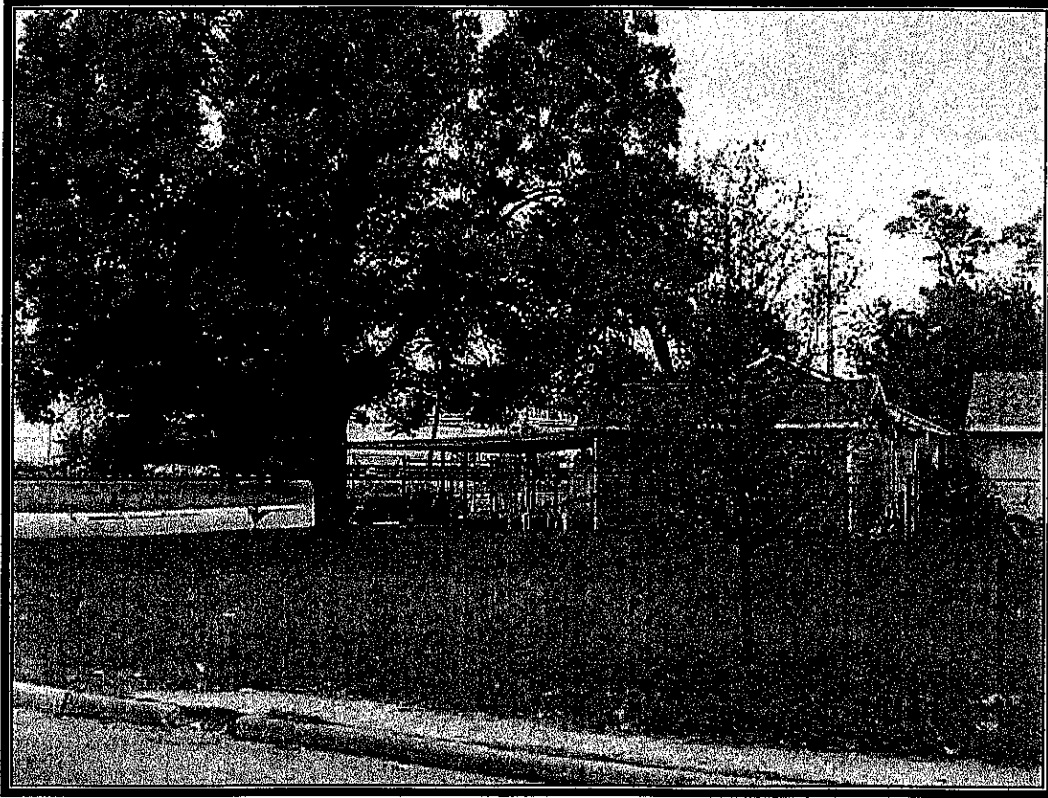


Photo 1 – View of the Subject Property (vacant lot) looking towards the northwest.

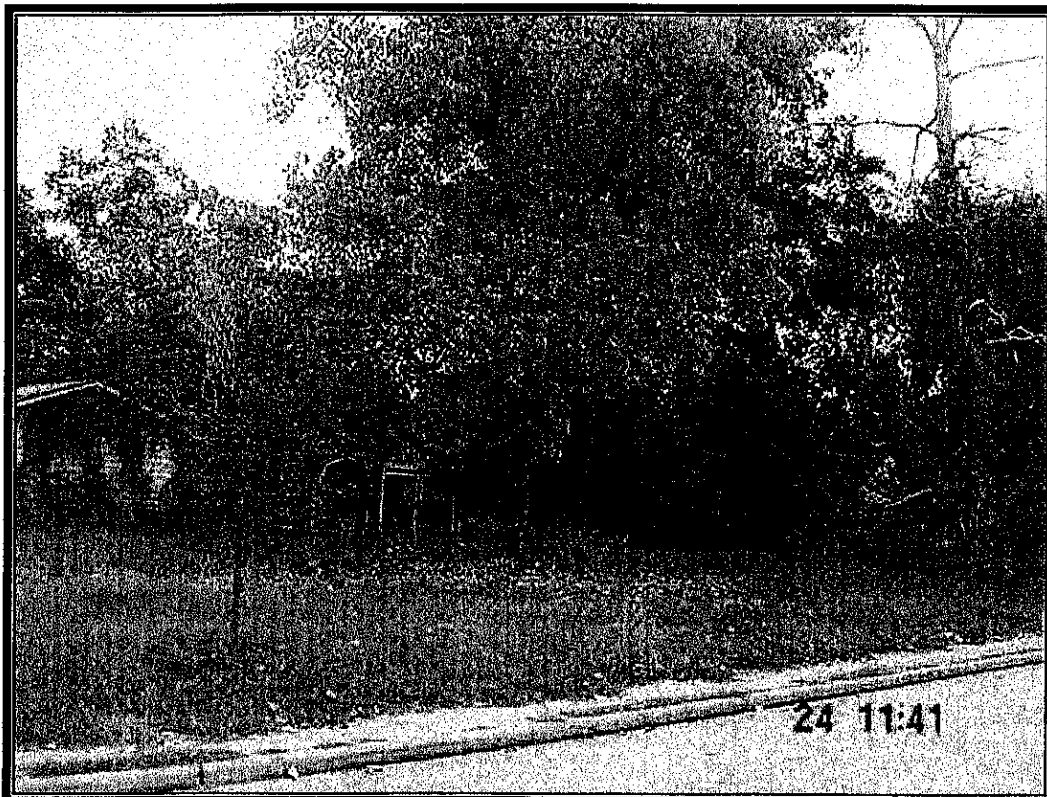


Photo 2 – View of the adjoining property located to the east of the Subject Property.

**Vacant Tract
NEC of Navigation & Terminal Street
Houston, Texas 77011**

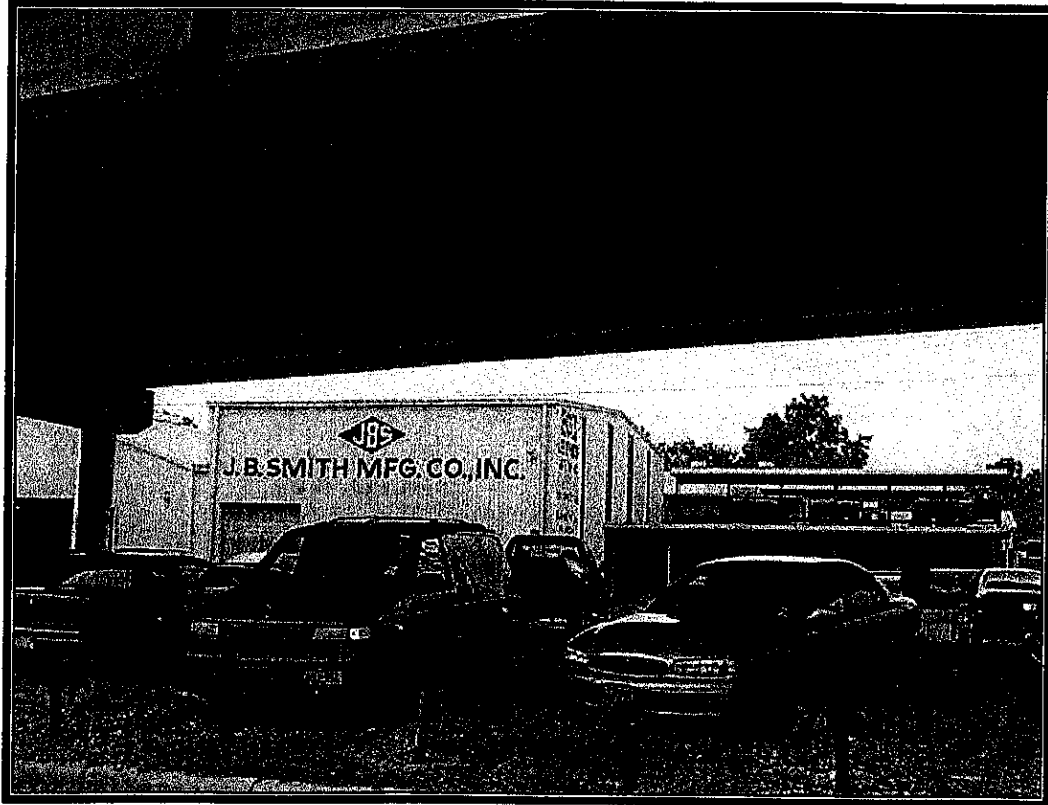


Photo 3 – View of parking beneath the Navigation overpass across the frontage road.

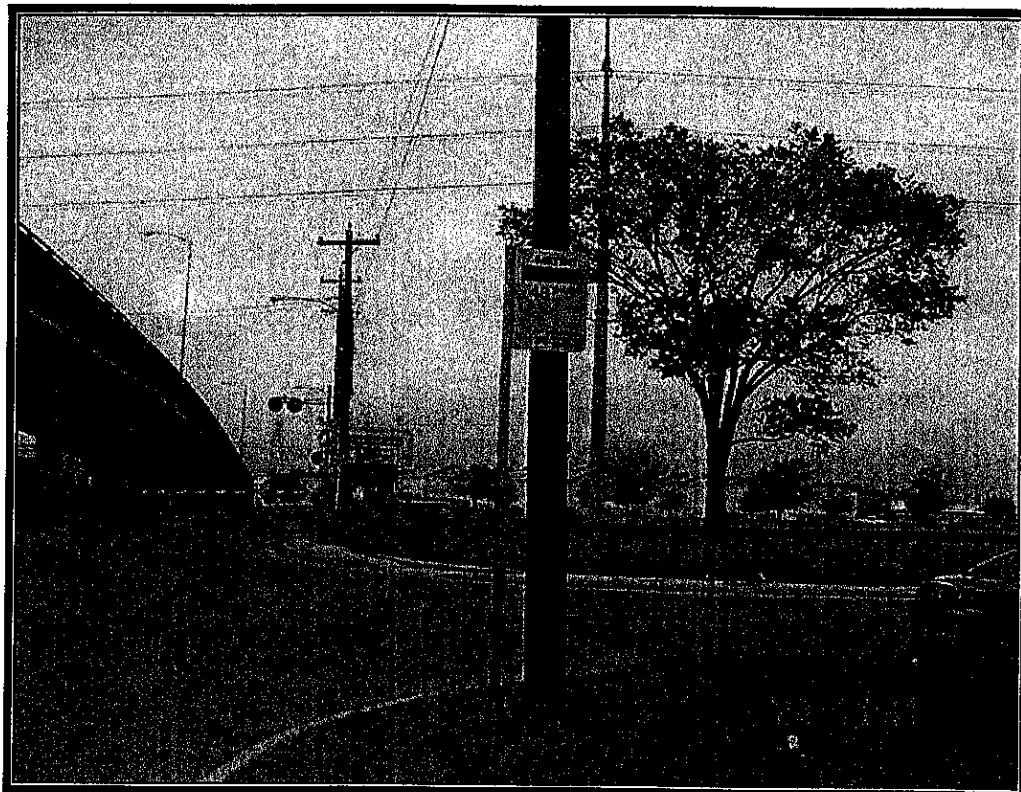


Photo 4 – View of Terminal Street beyond, which is W. Tidwell.

**Vacant Tract
NEC of Navigation & Terminal Street
Houston, Texas 77011**

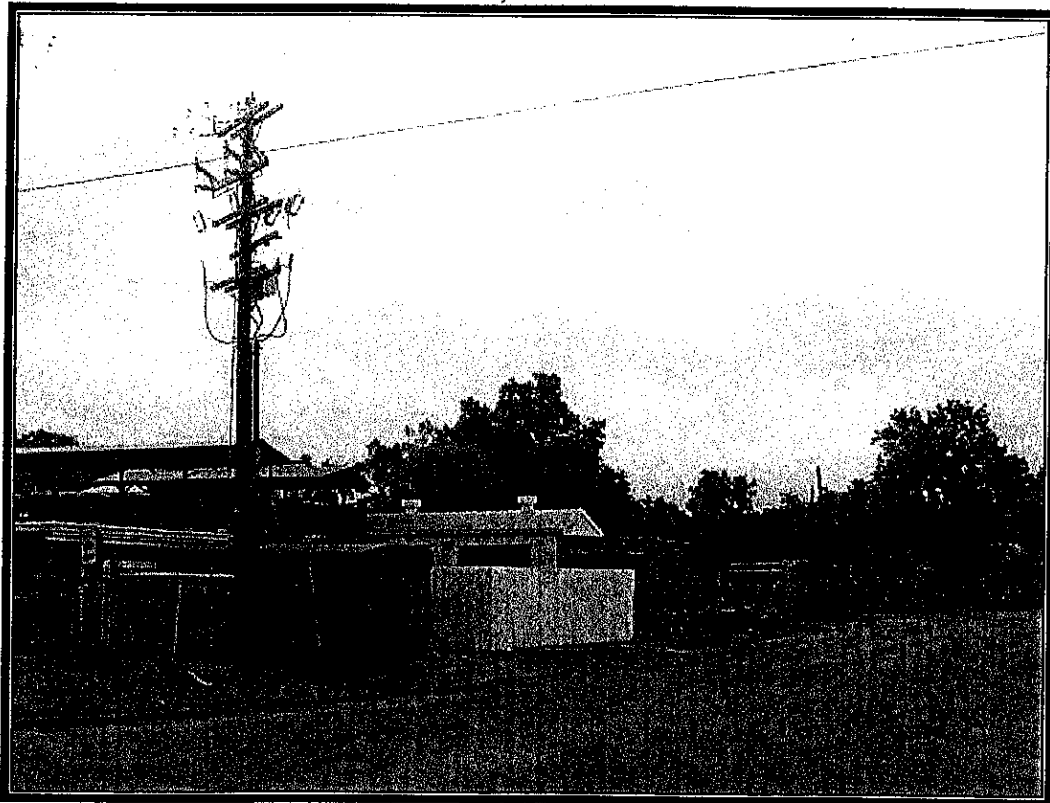


Photo 5 – View of the JB Smith piping yard, which had drums and miscellaneous material.


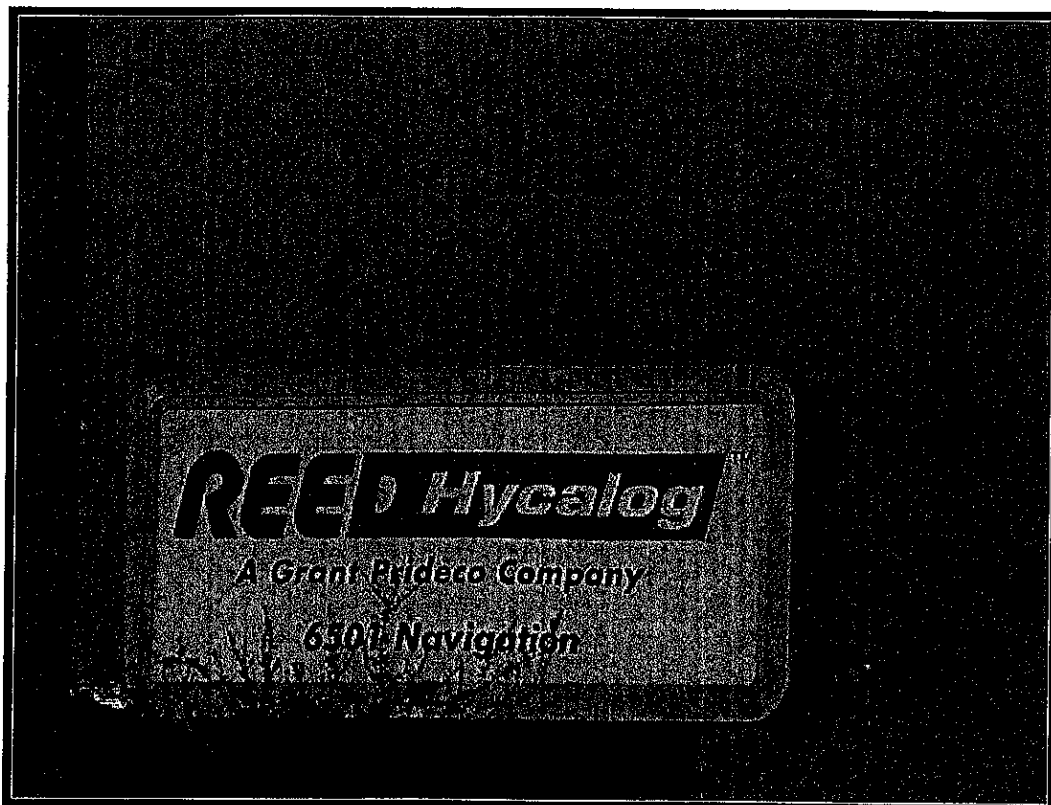


Photo 6 – View of Reedhycalog located 1000 feet to the west of the Subject Property.

APPENDIX C SUPPORT DOCUMENTATION





SOURCE:
 Yahoo
 SCALE: NTS

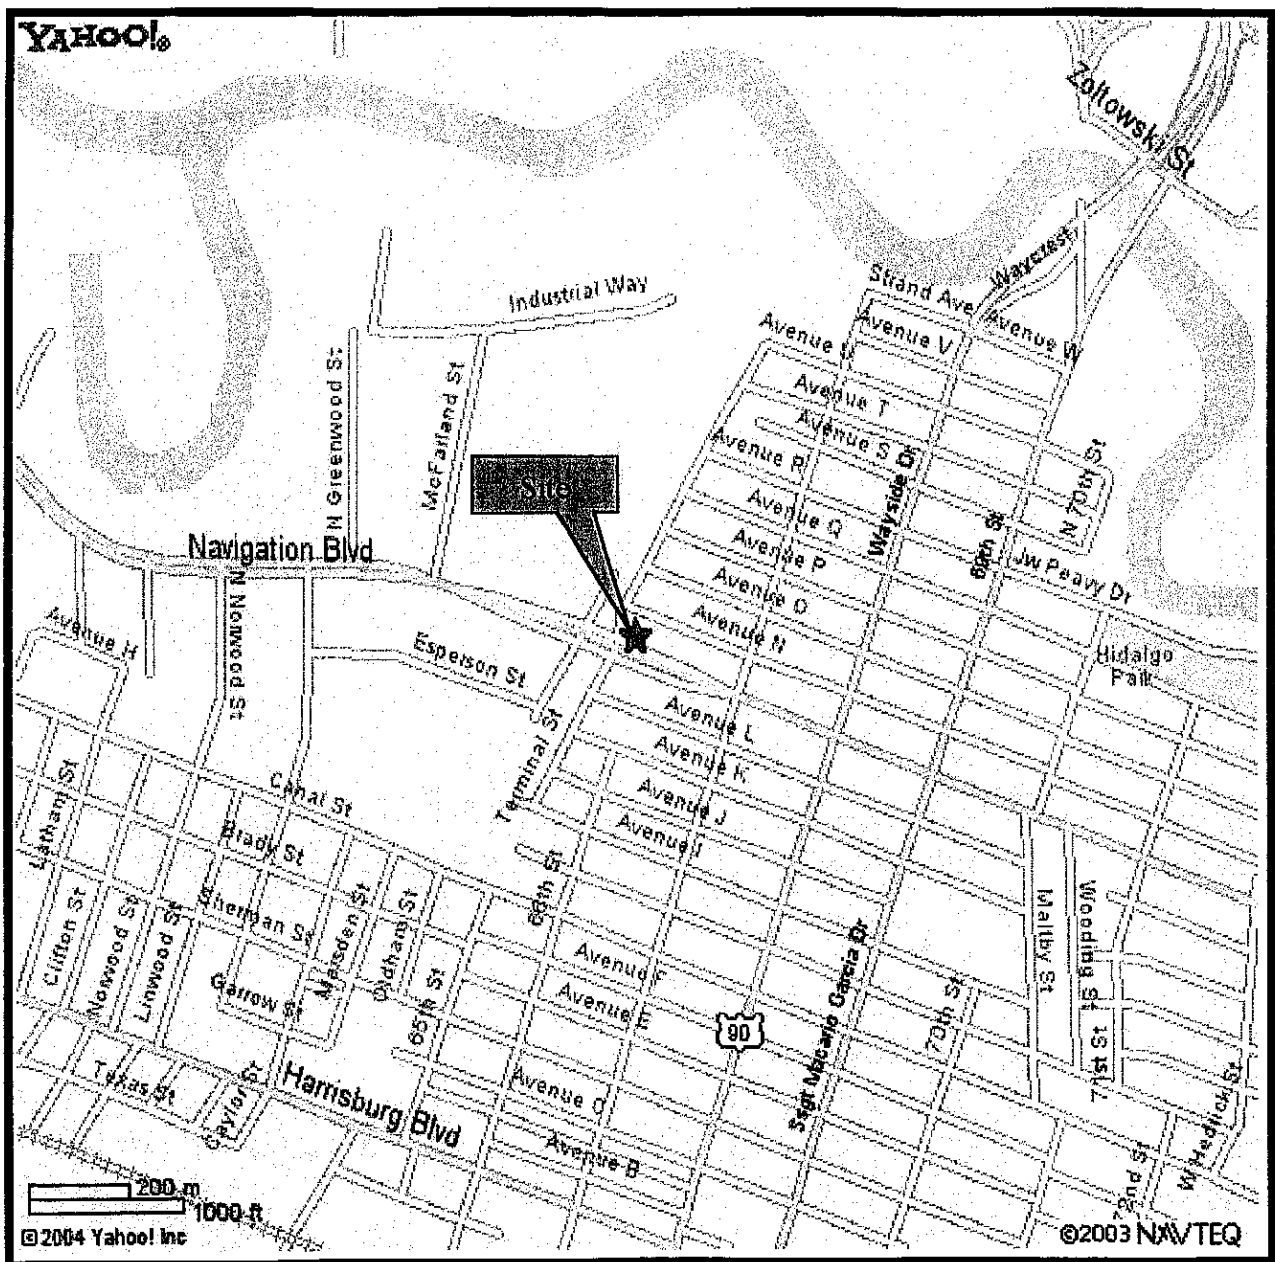

PROJECT: Vacant Tract Commercial Property NEC of Navigation & Terminal Houston, TX 77011		<i>Quantum</i>	
		FIGURE TITLE: SITE MAP	
PROJECT MANAGER: B. Benford	PROJECT NO.: H40112		
		DATE: 09/29/04	SCALE: AS SHOWN
		FIGURE NO.: 1	

No Scale

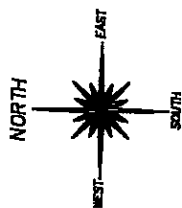


 **Quantum**
Environmental Consultants, Inc.

11246 South Post Oak
Houston, Texas 77036
(713) 961-8875


City of Houston
Figure II

Vacant Lot
0.239 Acres of and
NEC of Navigation & Terminal
Harris County
Houston, Texas 77011

DESIGNED BY: BB	DETAILED BY: BB	CHECKED BY: BB
DATE: 08/25/04		FILE:
PROJECT NO.: H40112		CONTRACT:

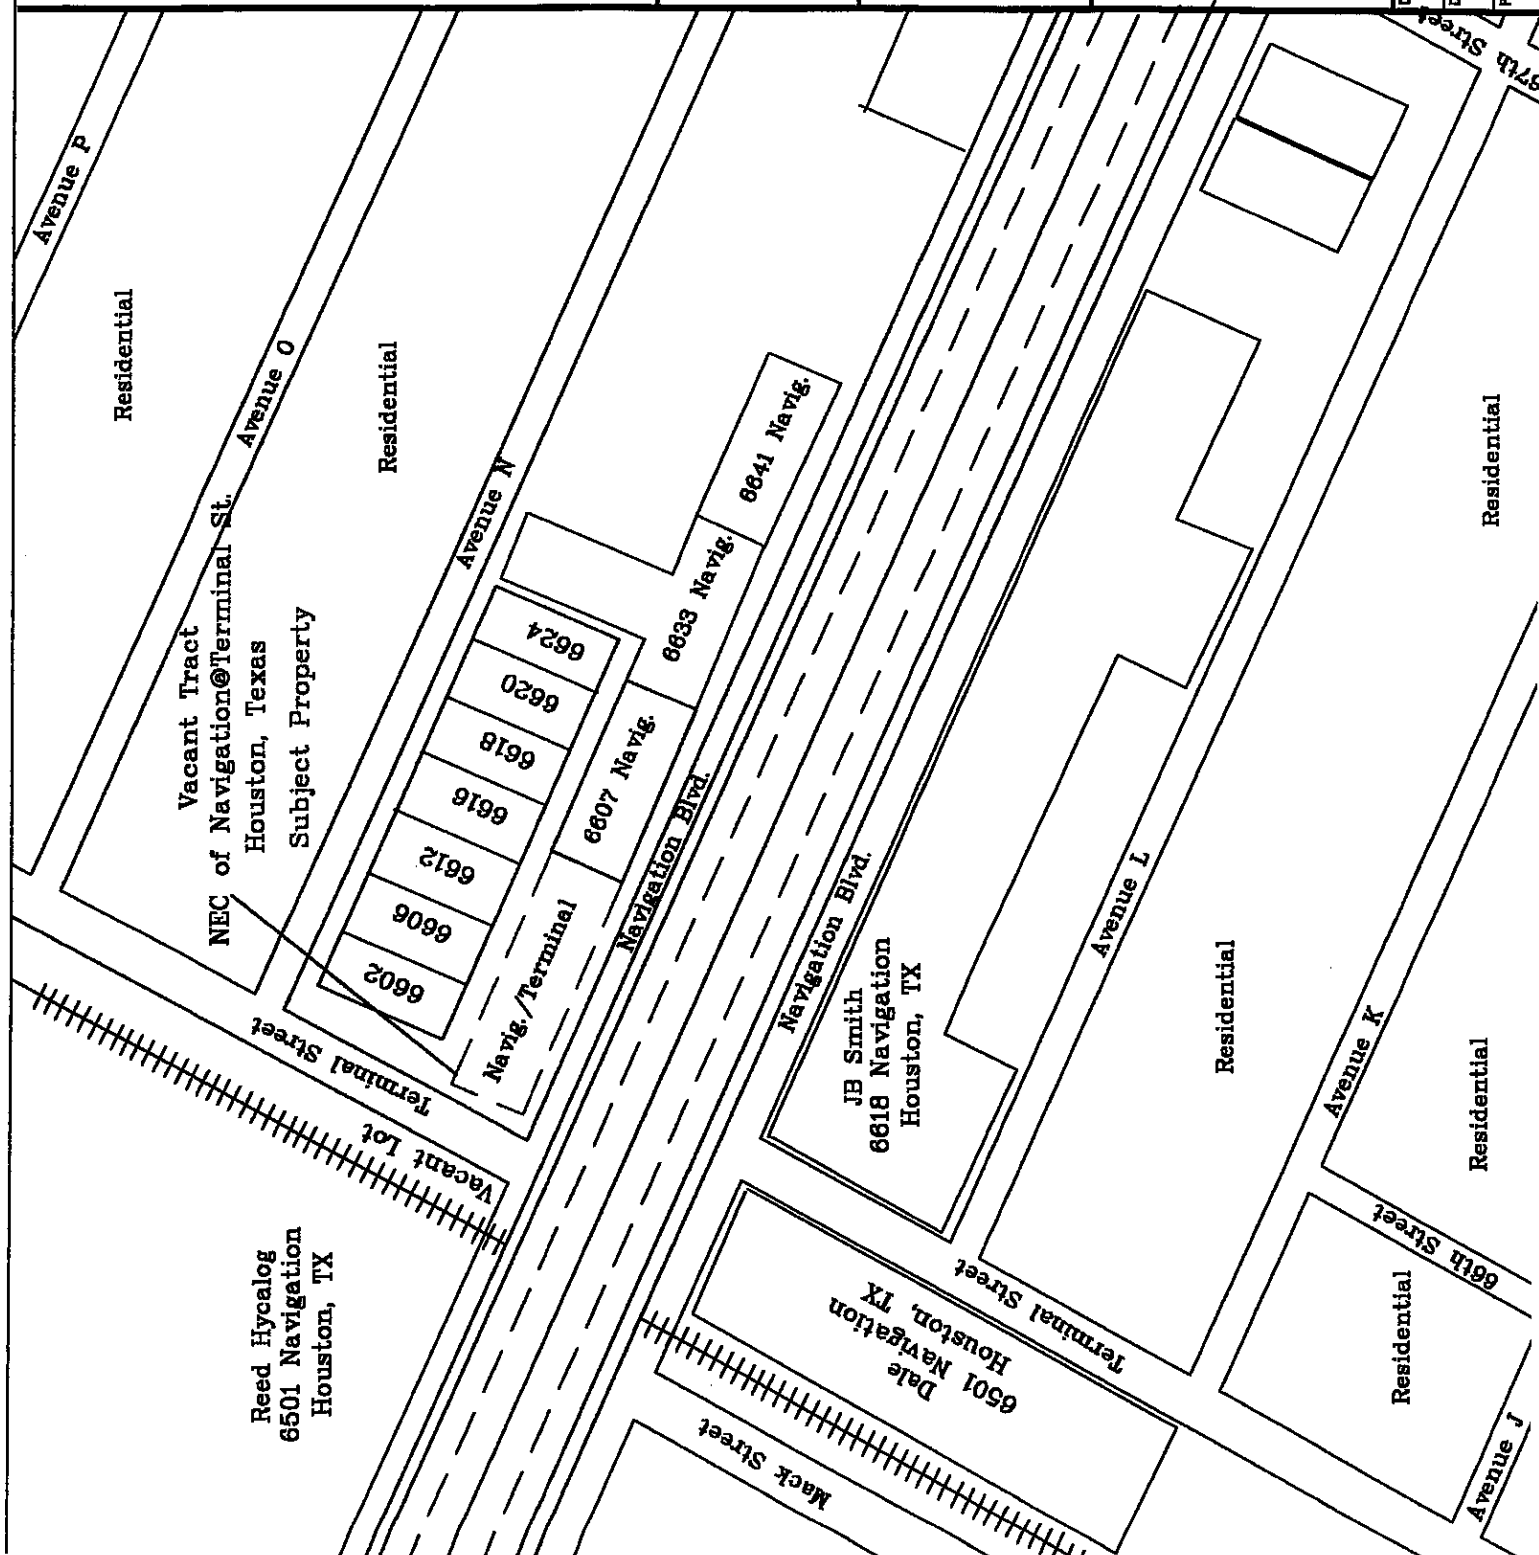


AS - SHEET NUMBER 104

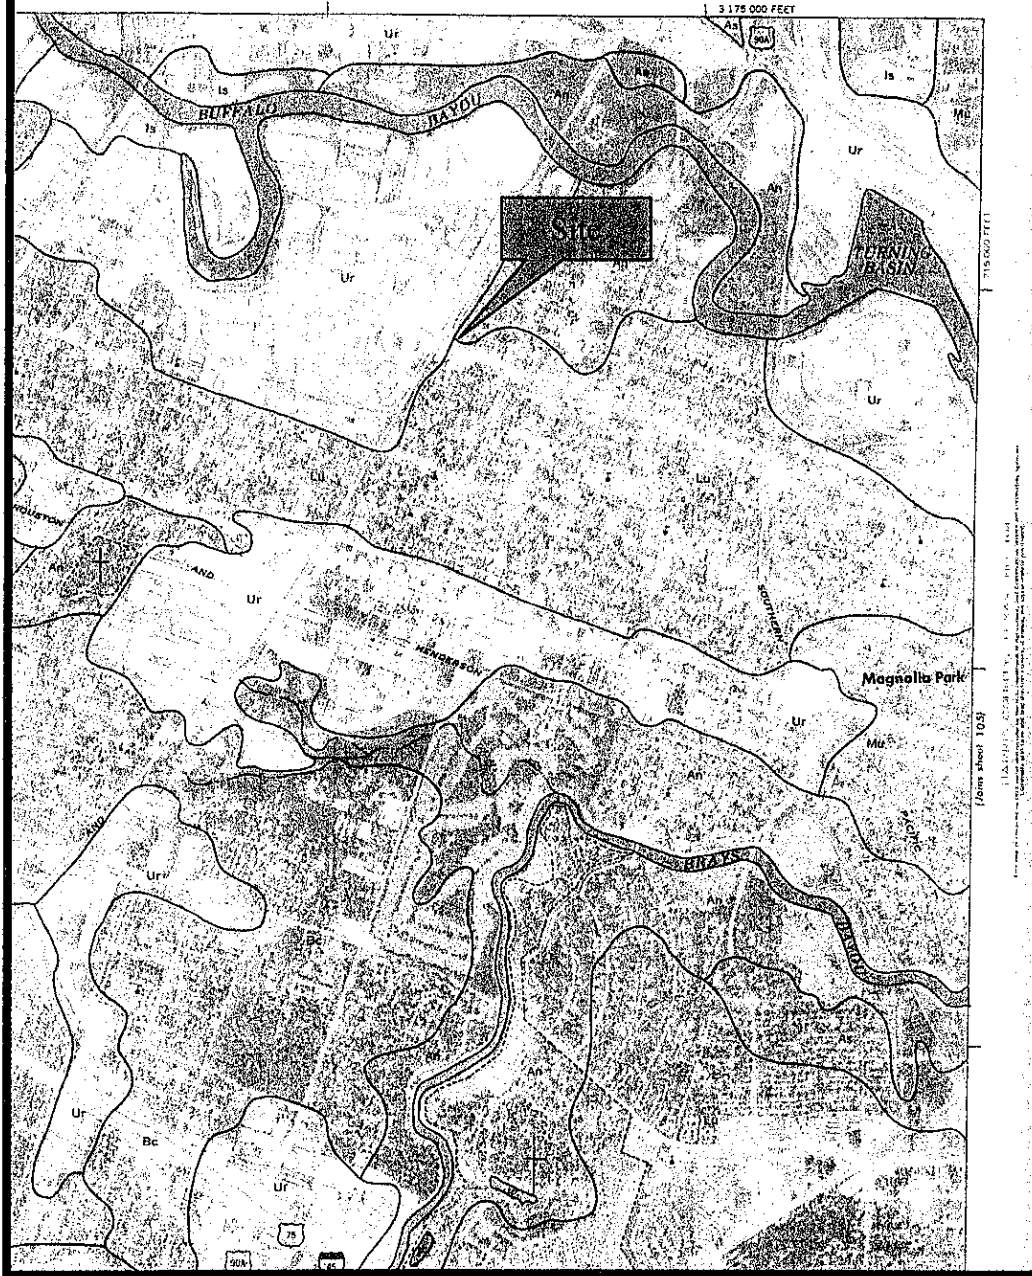

SOURCE:
United States Department of Agriculture
Harris County
Issued August 1976



PROJECT: Vacant Tract Commercial Property NEC of Navigation & Terminal Houston, TX 77011		<i>Quantum</i>	
PROJECT MANAGER: B. Benford		FIGURE TITLE: Soil Survey Map	
PROJECT NO.: H40112		DATE: 09/30/04	SCALE: AS SHOWN
		FIGURE NO.: 3	

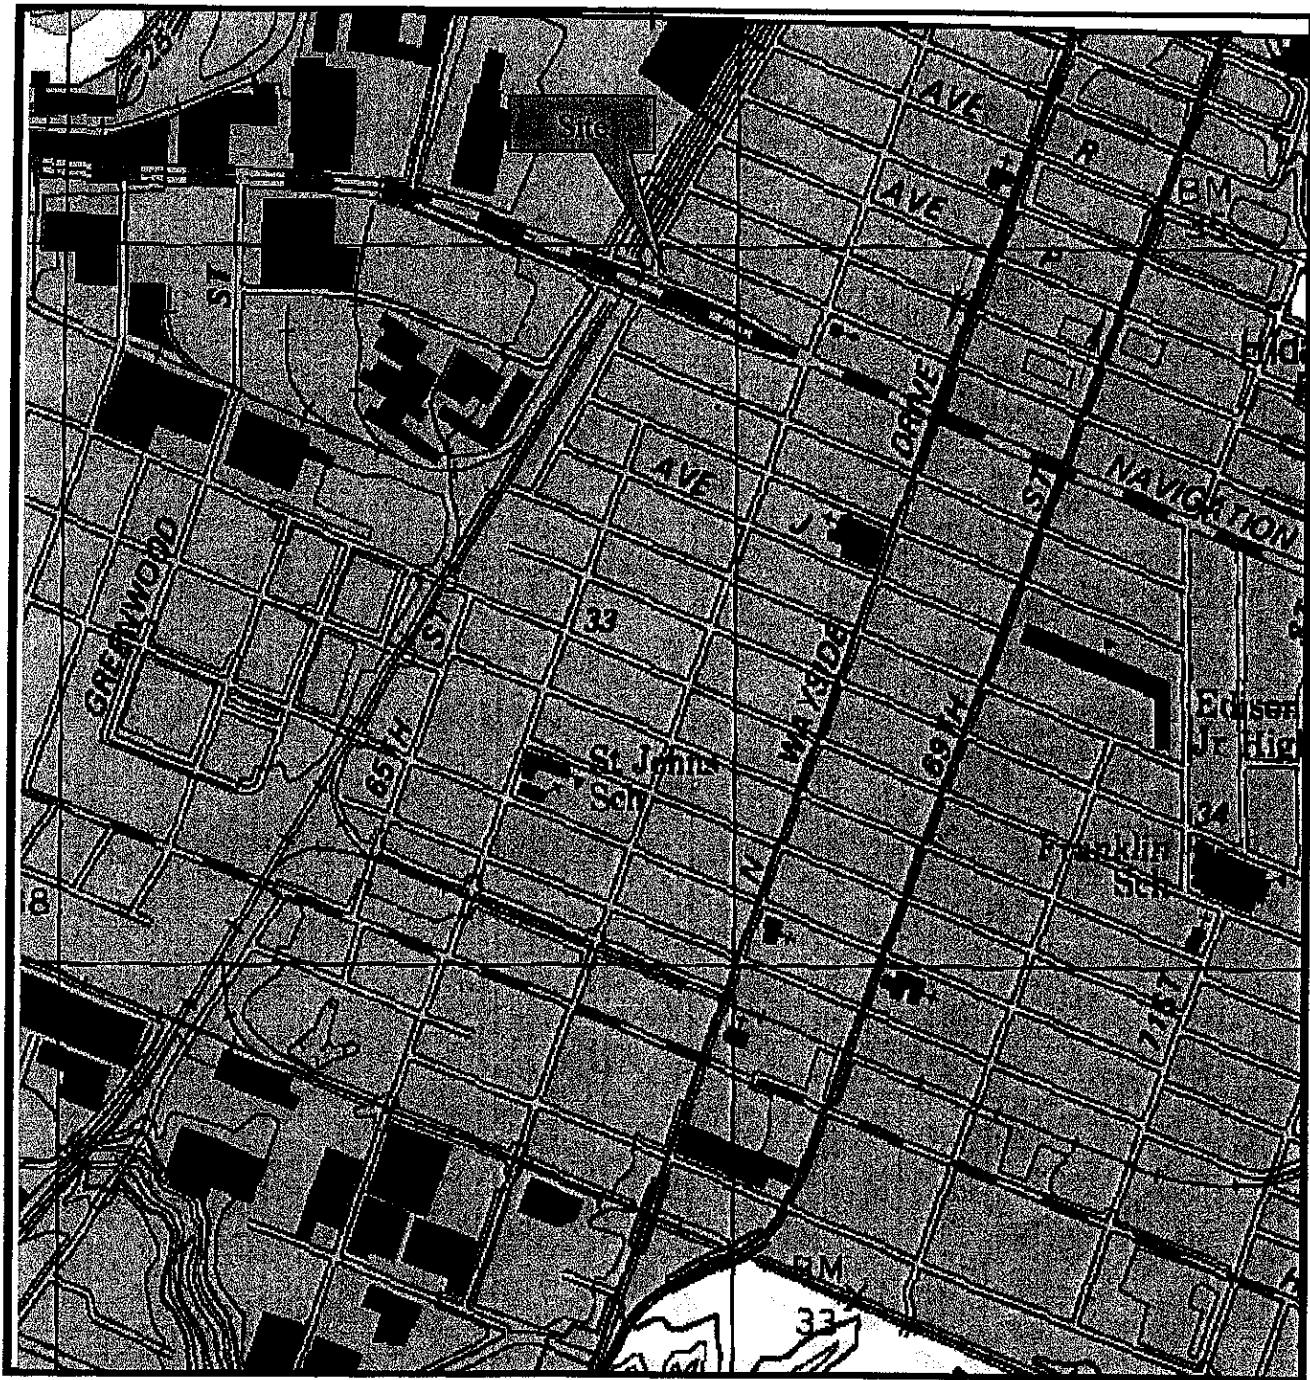

SOURCE: US Geological Survey
 Park Place, TX 1998
 Scale: 1:24 000



PROJECT:

Vacant Tract
 Commercial Property
 NEC of Navigation & Terminal
 Houston, TX 77011

PROJECT MANAGER:

B. Benford

PROJECT NO.:

H40112

Quantum


FIGURE TITLE:

USGS Topographic Map

DATE:
 09/30/04

SCALE:
 AS SHOWN

FIGURE NO.:
 4

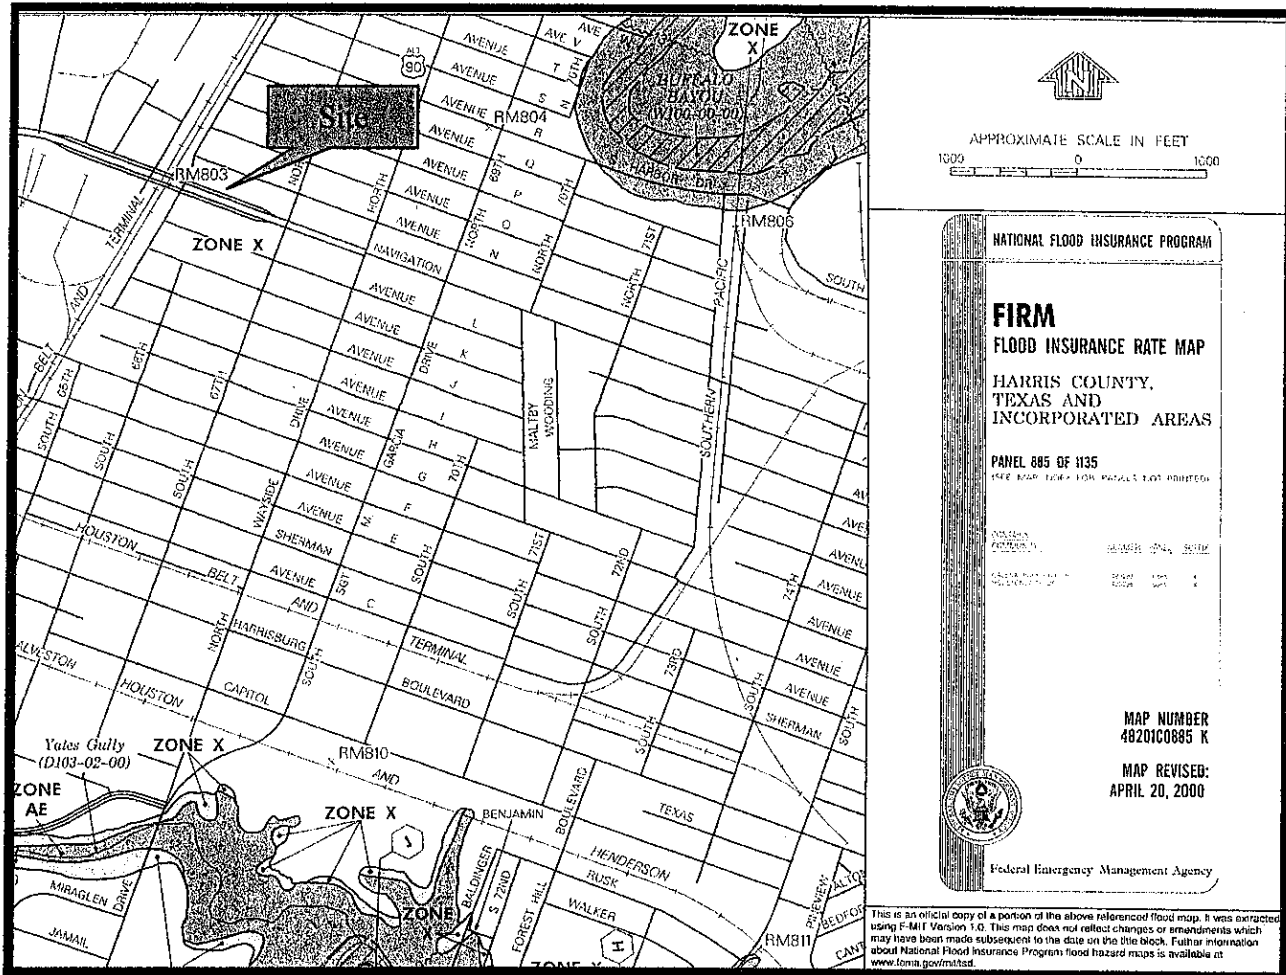

SOURCE:
FEMA - 48201C0885K
Scale: NTS




PROJECT: Vacant Tract Commercial Property NEC of Navigation & Terminal Houston, TX 77011			
PROJECT MANAGER: B. Benford	PROJECT NO.: H40112		
DATE: 09/30/04		SCALE: NTS	FIGURE NO.: 5

FIGURE TITLE:
Flood Insurance Rate Map



SOURCE:
USGS
Scale: 1" = 500'



PROJECT:

Vacant Tract
Commercial Property
NEC of Navigation & Terminal
Houston, TX 77011

PROJECT MANAGER:

B. Benford

PROJECT NO.:

H40112

Quantum

FIGURE TITLE:

AERIAL PHOTOGRAPH 2002

DATE:
09/30/04

SCALE:
AS SHOWN

FIGURE NO.:
6



SOURCE:
TXDOT
Scale: 1" = 500'



PROJECT:

Vacant Tract
Commercial Property
NEC of Navigation & Terminal
Houston, TX 77011

PROJECT MANAGER:

B. Benford

PROJECT NO.:

H40109

Quantum

FIGURE TITLE:

AERIAL PHOTOGRAPH 1996

DATE:
08/30/04

SCALE:
AS SHOWN

FIGURE NO.:
7



SOURCE:
TXDOT
Scale: 1" = 500'



PROJECT: Vacant Tract Commercial Property NEC of Navigation & Terminal Houston, TX 77011		<i>Quantum</i>	
PROJECT MANAGER: B. Benford		PROJECT NO.: H40112	
DATE: 09/30/04		SCALE: AS SHOWN	FIGURE NO.: 8
FIGURE TITLE: AERIAL PHOTOGRAPH 1989			



SOURCE:
ASCS
Scale: 1" = 500'



PROJECT:

Vacant Tract
Commercial Property
NEC of Navigation & Terminal
Houston, TX 77011

PROJECT MANAGER:

B. Benford

PROJECT NO.:

H40112

Quantum

FIGURE TITLE:

AERIAL PHOTOGRAPH 1979

DATE: 09/30/04

SCALE:
AS SHOWN

FIGURE NO.:
9



SOURCE:
ASCS
Scale: 1" = 500'



PROJECT:

Vacant Tract
Commercial Property
NEC of Navigation & Terminal
Houston, TX 77011

PROJECT MANAGER:

B. Benford

PROJECT NO.:

H40112

Quantum

FIGURE TITLE:

AERIAL PHOTOGRAPH 1962

DATE:
09/30/04

SCALE:
AS SHOWN

FIGURE NO.:
10



SOURCE:
TXDOT
Scale: 1" = 500'



PROJECT:

Shopping Center
Commercial Property
6056 Victory Drive
Houston, TX 77088

PROJECT MANAGER:

B. Benford

PROJECT NO.:

H40109

Quantum

FIGURE TITLE:

AERIAL PHOTOGRAPH 1953

DATE:
08/30/04

SCALE:
AS SHOWN

FIGURE NO.:
11



SOURCE:
Wallace
Scale: 1" = 500'



PROJECT:

Vacant Tract
Commercial Property
NEC of Navigation & Terminal
Houston, TX 77011

PROJECT MANAGER:

B. Benford

PROJECT NO.:

H40112

Quantum

FIGURE TITLE:

AERIAL PHOTOGRAPH 1944

DATE:
09/30/04

SCALE:
AS SHOWN

FIGURE NO.:
12

APPENDIX D REGULATORY ELECTRONIC FILE SEARCH REPORT



Banks Information Solutions, Inc.

Environmental FirstSearchTM Report

TARGET PROPERTY:

NAVIGATION , TERMINA

HOUSTON TX 77011

Job Number: H40112

PREPARED FOR:

QUANTUM ENVIRONMENTAL CONSULTANTS, INC.

11246 S. Post Oak Road, Ste. 104

Houston, TX 77035

09-16-04



Tel: (512) 478-0059

Fax: (512) 478-1433

Environmental FirstSearch Search Summary Report

Target Site: NAVIGATION, TERMINA

HOUSTON TX 77011

FirstSearch Summary

Database	Sel	Updated	Radius	Site	1/8	1/4	1/2	1/2>	ZIP	TOTALS
NPL	Y	06-15-04	1.00	0	0	0	0	0	0	0
CERCLIS	Y	06-23-04	0.50	0	0	0	0	-	0	0
NFRAP	Y	06-23-04	0.25	0	0	0	-	-	0	0
RCRA TSD	Y	07-12-04	0.50	0	0	0	0	-	0	0
RCRA COR	Y	07-12-04	1.00	0	0	0	0	1	0	1
RCRA GEN	Y	07-12-04	0.25	1	2	3	-	-	1	7
RCRA NLR	N	07-12-04	0.25	-	-	-	-	-	-	-
ERNS	Y	12-31-03	0.15	0	0	0	-	-	2	2
NPDES	N	07-17-04	0.25	-	-	-	-	-	-	-
FINDS	N	07-16-98	0.25	-	-	-	-	-	-	-
TRIS	N	06-23-04	0.25	-	-	-	-	-	-	-
State Sites	Y	03-29-04	1.00	0	0	0	2	3	0	5
Spills-1990	Y	NA	0.15	0	0	0	-	-	0	0
Spills-1980	N	NA	0.15	-	-	-	-	-	-	-
SWL	Y	09-16-02	0.50	0	0	0	0	-	0	0
Permits	N	NA	0.25	-	-	-	-	-	-	-
Other	Y	04-04-04	0.25	1	4	7	-	-	0	12
REG UST/AST	Y	04-09-04	0.25	0	2	5	-	-	0	7
Leaking UST	Y	04-09-04	0.50	0	1	0	13	-	0	14
State Wells	N	07-18-97	0.50	-	-	-	-	-	-	-
Aquifers	N	NA	0.50	-	-	-	-	-	-	-
ACEC	N	NA	0.50	-	-	-	-	-	-	-
Wetlands	N	11-20-00	0.50	-	-	-	-	-	-	-
Floodplains	N	09-01-98	0.50	-	-	-	-	-	-	-
Nuclear Permits	N	04-30-99	0.50	-	-	-	-	-	-	-
Historic/Landmark	N	09-01-02	0.50	-	-	-	-	-	-	-
Federal Land Use	N	10-07-03	0.50	-	-	-	-	-	-	-
Federal Wells	N	05-19-03	0.50	-	-	-	-	-	-	-
Releases(Air/Water)	N	12-31-03	0.25	-	-	-	-	-	-	-
HMIRS	N	03-31-03	0.25	-	-	-	-	-	-	-
NCDB	N	08-30-04	0.25	-	-	-	-	-	-	-
PADS	N	03-01-04	0.25	-	-	-	-	-	-	-
Federal Other	N	12-31-02	0.25	-	-	-	-	-	-	-
Misc	N	NA	0.25	-	-	-	-	-	-	-
Towers	N	08-16-01	0.25	-	-	-	-	-	-	-
Soils	N	03-18-97	0.25	-	-	-	-	-	-	-
Receptors	N	01-01-95	0.50	-	-	-	-	-	-	-
- TOTALS -				2	9	15	15	4	3	48

Notice of Disclaimer

Due to the limitations, constraints, inaccuracies and incompleteness of government information and computer mapping data currently available to Banks Information Solutions, Inc., certain conventions have been utilized in preparing the locations of all federal, state and local agency sites residing in Banks Information Solutions, Inc.'s databases. All EPA NPL and state landfill sites are depicted by a rectangle approximating their location and size. The boundaries of the rectangles represent the eastern and western most longitudes; the northern and southern most latitudes. As such, the mapped areas may exceed the actual areas and do not represent the actual boundaries of these properties. All other sites are depicted by a point representing their approximate address location and make no attempt to represent the actual areas of the associated property. Actual boundaries and locations of individual properties can be found in the files residing at the agency responsible for such information.

Waiver of Liability

Although Banks Information Solutions, Inc. uses its best efforts to research the actual location of each site, Banks Information Solutions, Inc. does not and can not warrant the accuracy of these sites with regard to exact location and size. All authorized users of Banks Information Solutions, Inc.'s services proceeding are signifying an understanding of Banks Information Solutions, Inc.'s searching and mapping conventions, and agree to waive any and all liability claims associated with search and map results showing incomplete and or inaccurate site locations.

**Environmental FirstSearch
Site Information Report**

Request Date: 09-16-04
Requestor Name: Bennie Benford
Standard: ASTM

Search Type: COORD
Job Number: H40112
Filtered Report

TARGET ADDRESS: NAVIGATION, TERMINA
HOUSTON TX 77011

Demographics

Sites: 48 Non-Geocoded: 3 Population: NA
Radon: NA

Site Location

	<u>Degrees (Decimal)</u>	<u>Degrees (Min/Sec)</u>		<u>UTMs</u>
Longitude:	-95.307333	-95:18:26	Easting:	276864.584
Latitude:	29.74661	29:44:48	Northing:	3292759.199
			Zone:	15

Comment

Comment:
CONFIRM

Additional Requests/Services

Adjacent ZIP Codes: 0 Mile(s)

Services:

ZIP Code	City Name	ST	Dist/Dir	Sel

	Requested?	Date
Sanborns	No	
Aerial Photographs	No	
Topographical Maps	No	
City Directories	No	
Title Search	No	
Municipal Reports	No	
Online Topos	No	

Environmental FirstSearch Sites Summary Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

TOTAL: 48

GEOCODED: 45

NON GEOCODED: 3

SELECTED: 0

ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Map
47	ERNS	MARTEX SHIPPING 337710/FIXED FACILITY	GREENSPORT TERMINAL INDUSTRIAL HOUSTON TX	NON GC	
48	ERNS	SMQI SERVICES 421157/MARINE- RELEASED FRO	JACINTO PORT BELL HAVEN TERMIN HOUSTON TX	NON GC	
43	LUST	REED TOOL CO FACILITY AREA 1 093534 <i>Removed - monitoring</i>	6501 NAVIGATION BLVD HOUSTON TX 77011	0.03 NW	30
34	LUST	CHEVRON 110785 <i>case closed</i>	1215 WAYSIDE HOUSTON TX 77088	0.26 SE	33
32	LUST	BAKER PACKERS OIL TOOL CO 092365 <i>case closed</i>	6023 NAVIGATION HOUSTON TX 77011	0.34 NW	32
42	LUST	MUSTANG EQUIPMENT 097720 <i>case closed</i>	6006 NAVIGATION HOUSTON TX 77012	0.36 NW	34
40	LUST	GULF REDUCTION CORP 107402 <i>removed - monitoring</i>	6020 ESPERSON HOUSTON TX 77011	0.36 SW	22
45	LUST	WAYSIDE TEXACO 109734 <i>removed - monitoring</i>	707 N WAYSIDE HOUSTON TX 77011	0.38 SE	31
33	LUST	BLAS KOTE INC 111481 <i>case closed</i>	6125 INDUSTRIAL WAY HOUSTON TX 77011	0.40 NW	3
39	LUST	GENERAL STEVEDORES INC 110213 <i>case closed</i>	6125B INDUSTRIAL WAY HOUSTON TX 77011	0.40 NW	4
36	LUST	EXXON 61140 091050 <i>case closed</i>	6901 NAVIGATION HOUSTON TX 77000	0.41 SE	20
37	LUST	EXXON 61140 111591 <i>gw impact - in use monitoring</i>	6901 NAVIGATION HOUSTON TX 77011	0.41 SE	20
35	LUST	CHEVRON 60108012 094139 <i>case closed</i>	619 WAYSIDE HOUSTON TX 77011	0.42 SE	19
38	LUST	FIRE STATION 20 108461 <i>removed monitoring</i>	6902 NAVIGATION HOUSTON TX 77011	0.42 SE	21
41	LUST	MAGNOLIA PARK SERVICE CENTER 106655 <i>case closed</i>	104 N GREENWOOD HOUSTON TX 77011	0.42 SW	26
44	LUST	TRANSENERGY CONSTRUCTION SERVICES 113244 <i>case closed</i>	6203 INDUSTRIAL WAY HOUSTON TX 77011	0.43 NW	15
19	OTHER	J B SMITH MFG IHW-33608/ACTIVE	6618 NAVIGATION BLVD Houston TX 77011	0.00 --	5
16	OTHER	DIESEL PUMP & INJECTOR IHW-51277/INACTIVE	6632 NAVIGATION BLVD Houston TX 77011	0.02 SE	2
22	OTHER	REEDHYCLOG IHW-31202/ACTIVE	6501 NAVIGATION BLVD Houston TX 77011	0.05 NW	8
13	OTHER	CENTRAL PARK SHEET METAL IHW-71651/INACTIVE	6647 NAVIGATION BLVD HOUSTON TX 77011	0.09 SE	13
14	OTHER	CENTRAL PARK SHEET METAL WORKS IHW-36363/INACTIVE	6647 NAVIGATION BLVD HOUSTON TX	0.09 SE	13

Environmental FirstSearch Sites Summary Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

TOTAL: 48

GEOCODED: 45

NON GEOCODED: 3

SELECTED: 0

ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Map ID
47	ERNS	MARTEX SHIPPING 337710/FIXED FACILITY	GREENSPORT TERMINAL INDUSTRIAL HOUSTON TX	NON GC	
48	ERNS	SMQI SERVICES 421157/MARINE- RELEASED FRO	JACINTO PORT BELL HAVEN TERMIN HOUSTON TX	NON GC	
43	LUST	REED TOOL CO FACILITY AREA 1 093534	6501 NAVIGATION BLVD HOUSTON TX 77011	0.03 NW	30
34	LUST	CHEVRON 110785	1215 WAYSIDE HOUSTON TX 77088	0.26 SE	33
32	LUST	BAKER PACKERS OIL TOOL CO 092365	6023 NAVIGATION HOUSTON TX 77011	0.34 NW	32
42	LUST	MUSTANG EQUIPMENT 097720	6006 NAVIGATION HOUSTON TX 77012	0.36 NW	34
40	LUST	GULF REDUCTION CORP 107402	6020 ESPERSON HOUSTON TX 77011	0.36 SW	22
45	LUST	WAYSIDE TEXACO 109734	707 N WAYSIDE HOUSTON TX 77011	0.38 SE	31
33	LUST	BLAS KOTE INC 111481	6125 INDUSTRIAL WAY HOUSTON TX 77011	0.40 NW	3
39	LUST	GENERAL STEVEDORES INC 110213	6125B INDUSTRIAL WAY HOUSTON TX 77011	0.40 NW	4
36	LUST	EXXON 61140 091050	6901 NAVIGATION HOUSTON TX 77000	0.41 SE	20
37	LUST	EXXON 61140 111591	6901 NAVIGATION HOUSTON TX 77011	0.41 SE	20
35	LUST	CHEVRON 60108012 094139	619 WAYSIDE HOUSTON TX 77011	0.42 SE	19
38	LUST	FIRE STATION 20 108461	6902 NAVIGATION HOUSTON TX 77011	0.42 SE	21
41	LUST	MAGNOLIA PARK SERVICE CENTER 106655	104 N GREENWOOD HOUSTON TX 77011	0.42 SW	26
44	LUST	TRANSENERGY CONSTRUCTION SERVICES 113244	6203 INDUSTRIAL WAY HOUSTON TX 77011	0.43 NW	15
19	OTHER	J B SMITH MFG IHW-33608/ACTIVE	6618 NAVIGATION BLVD Houston TX 77011	0.00 --	5
16	OTHER	DIESEL PUMP & INJECTOR IHW-51277/INACTIVE	6632 NAVIGATION BLVD Houston TX 77011	0.02 SE	2
22	OTHER	REEDHYCLOG IHW-31202/ACTIVE	6501 NAVIGATION BLVD Houston TX 77011	0.05 NW	8
13	OTHER	CENTRAL PARK SHEET METAL IHW-71651/INACTIVE	6647 NAVIGATION BLVD HOUSTON TX 77011	0.09 SE	13
14	OTHER	CENTRAL PARK SHEET METAL WORKS IHW-36363/INACTIVE	6647 NAVIGATION BLVD HOUSTON TX	0.09 SE	13

Environmental FirstSearch Sites Summary Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

TOTAL: 48

GEOCODED: 45

NON GEOCODED: 3

SELECTED: 0

ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Map ID
23	OTHER	SEMINOLE TUBULAR PRODUCTS CO IHW-20327/ACTIVE	6247 NAVIGATION ST HOUSTON TX 77261	0.17 NW	18
21	OTHER	OMSCO COMPANY IHW-38904/ACTIVE	6418 EPERSON ST Houston TX	0.17 SW	7
20	OTHER	NATIONAL SUPPLY CO IHW-31374/INACTIVE	6229 NAVIGATION BLVD HOUSTON TX 77011	0.19 NW	17
17	OTHER	ELECTRO COATINGS NAVIGATION PLANT IHW-86805/ACTIVE	6220 NAVIGATION BLVD HOUSTON TX 77011	0.20 NW	14
15	OTHER	CUMMINS RECON TOOL IHW-39537/INACTIVE	6230 NAVIGATION Houston TX 77011	0.22 NW	6
18	OTHER	ICO INC IHW-37480/INACTIVE	630 MCFARLAND HOUSTON TX 77011	0.23 NW	16
24	OTHER	THE DALE COMPANY IHW-81089/INACTIVE	6216 NAVIGATION Houston TX 77011	0.25 NW	9
1	RCRACOR	PARKANS INTERNATIONAL LLC TXD008105959/CA	5521 ARMOUR DR HOUSTON TX 77020	0.97 NW	1
3	RCRAGN	J B SMITH MFG CO INC TXD008065880/SGN	6618 NAVIGATION BLVD HOUSTON TX 77011	0.00 --	5
2	RCRAGN	DIESEL PUMP & INJECT OR SVC TXD042920421/SGN	6632 NAVIGATION BLVD HOUSTON TX 77011	0.02 SE	2
6	RCRAGN	REEDHYCALOG LP TXD008063364/SGN	6501 NAVIGATION BLVD HOUSTON TX 77011	0.05 NW	8
5	RCRAGN	OMSCO INDUSTRIES TXD008098659/SGN	6418 EPERSON ST HOUSTON TX 77011	0.17 SW	7
4	RCRAGN	NEW TECH ROCK BIT TXD987997327/VGN	6230 NAVIGATION HOUSTON TX 77011	0.22 NW	6
7	RCRAGN	THE DALE CO TXD988088159/VGN	6216 NAVIGATION HOUSTON TX 77011	0.25 NW	9
46	RCRAGN	TURBINE CHROME SERVICES INC TXD008085649/SGN	7419 AVENUE O HOUSTON TX 77011	NON GC	
9	STATE	FOSTER PRODUCTS CORPORATION 0989/INVESTIGATION	6107 INDUSTRIAL WAY HOUSTON TX 77011	0.40 NW	4
12	STATE	UNOCCUPIED INDUSTRIAL SITE (FONTENO 0401/INVESTIGATION	6125 INDUSTRIAL WAY HOUSTON TX 77011	0.40 NW	3
10	STATE	METAL PREP 1674/INVESTIGATION	501 NORTH GREENWOOD STREET Houston TX 77011	0.61 NW	11
8	STATE	AMERICANOS USA IOP-0268/COMPLETED	7004 HARRISBURG BOULEVARD HOUSTON TX	0.82 SE	10
11	STATE	PENTRON INCORPORATED 0281/COMPLETED	323 AVENUE J HOUSTON TX	0.83 NW	12

***Environmental FirstSearch
Sites Summary Report***

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

TOTAL: 48

GEOCODED: 45

NON GEOCODED: 3

SELECTED: 0

ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Map ID
27	UST	J B SMITH MFG CO 0049360	6618 NAVIGATION HOUSTON TX 77011	0.02 SE	25
31	UST	REED TOOL COMPANY 0018753	6501 NAVIGATION BLVD HOUSTON TX 77011	0.03 NW	30
30	UST	PLOWDEN SUPPLY CO 0057353	6300 NAVIGATION BLVD HOUSTON TX 77011	0.14 NW	29
29	UST	OMSCO INDUSTRIES INC 0048204	6418 ESPERSON ST HOUSTON TX 77011	0.14.SW	28
26	UST	HUGHES DRILLING EQUIPMENT 0024095	6247 NAVIGATION HOUSTON TX 77011	0.19 NW	24
28	UST	NATIONAL SUPPLY CO DIV OF ARMCO 0017416	6229 NAVIGATION BLVD HOUSTON TX 77011	0.21 NW	27
25	UST	HOUSTON KEG SALES 0044585	6739 NAVIGATION HOUSTON TX 77011	0.21 SE	23

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 43

DIST/DIR: 0.03 NW

MAP ID: 30

NAME: REED TOOL CO FACILITY AREA 1
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: ROBERT JOHNSON

REV: 03/05/04
ID1: 093534
ID2: 0018753
STATUS:
PHONE: 713/747-4000

SITE INFORMATION

REPORTED: 8/16/1989
ENTERED INTO SYSTEM: 9/6/1989
SITE PRIORITY: gw impacted, no apparent threats or impacts to receptors
SITE STATUS: monitoring
PRP: CAMCO INC
PRP ADDRESS: 7030 ARDMORE ST
HOUSTON TX 77054
PRP CONTACT: ROBERT JOHNSON
PRP PHONE: 713/747-4000

LUST INFORMATION

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 090189
INSTALL DATE: 010157
REGISTERED DATE: 050886
CAPACITY: 0004000 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Naphtha
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 43

DIST/DIR: 0.03 NW

MAP ID: 30

NAME: REED TOOL CO FACILITY AREA 1
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: ROBERT JOHNSON

REV: 03/05/04
ID1: 093534
ID2: 0018753
STATUS:
PHONE: 713/747-4000

SPILL/OVERFILL PREVENTION:

SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 8
STATUS: Removed From Ground
STATUS DATE: 030190
INSTALL DATE: 010184
REGISTERED DATE: 050886
CAPACITY: 0008000 Gallons
EXT CONTAINMENT DESIGN:

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION:

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT:
PIPE CONECTORS & VALVES:
PIPE CORROSION PROTECTION:
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: Methanol
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION:
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 7
STATUS: Removed From Ground
STATUS DATE: 090189
INSTALL DATE: 010182
REGISTERED DATE: 050886
CAPACITY: 0008000 Gallons
EXT CONTAINMENT DESIGN:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 43

DIST/DIR: 0.03 NW

MAP ID: 30

NAME: REED TOOL CO FACILITY AREA 1
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: ROBERT JOHNSON

REV: 03/05/04
ID1: 093534
ID2: 0018753
STATUS:
PHONE: 713/747-4000

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
-
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: Empty
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 6
STATUS: Removed From Ground
STATUS DATE: 090189
INSTALL DATE: 010182
REGISTERED DATE: 050886
CAPACITY: 0004000 Gallons
EXT CONTAINMENT DESIGN: -
-

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
-
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 34

DIST/DIR: 0.26 SE

MAP ID: 33

NAME: CHEVRON
ADDRESS: 1215 WAYSIDE
HOUSTON TX
HARRIS

CONTACT: MICHELLE COWHERD

REV: 03/05/04
ID1: 110785
ID2:
STATUS:
PHONE: 713/219-5233

SITE INFORMATION

REPORTED: 3/13/1996
ENTERED INTO SYSTEM: 5/2/1996
SITE PRIORITY: gw impacted, no apparent threats or impacts to receptors
SITE STATUS: Final concurrence issued, case close
PRP: CHEVRON PRODUCTS CO
PRP ADDRESS: PO BOX 4256
HOUSTON TX 77210
PRP CONTACT: MICHELLE COWHERD
PRP PHONE: 713/219-5233

LUST INFORMATION

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 32

DIST/DIR: 0.34 NW

MAP ID: 32

NAME: BAKER PACKERS OIL TOOL CO
ADDRESS: 6023 NAVIGATION
HOUSTON TX 77001
HARRIS
CONTACT: DICK WHITEHEAD

REV: 03/05/04
ID1: 092365
ID2: 0033752
STATUS:
PHONE: 713/923-9351

SITE INFORMATION

REPORTED: 11/29/1988
ENTERED INTO SYSTEM: 12/6/1988
SITE PRIORITY: soil contamination only, requires full site assessment & rap
SITE STATUS: Final concurrence issued, case close
PRP: BAKER OIL TOOLS CO
PRP ADDRESS: 6023 NAVIGATION
HOUSTON TX 77011
PRP CONTACT: DICK WHITEHEAD
PRP PHONE: 713/923-9351

LUST INFORMATION

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 113088
INSTALL DATE: 010182
REGISTERED DATE: 050886
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
-
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: NO PIPING
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: USED OIL
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 32

DIST/DIR: 0.34 NW

MAP ID: 32

NAME: BAKER PACKERS OIL TOOL CO
ADDRESS: 6023 NAVIGATION
HOUSTON TX 77001
HARRIS
CONTACT: DICK WHITEHEAD

REV: 03/05/04
ID1: 092365
ID2: 0033752
STATUS:
PHONE: 713/923-9351

SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 4
STATUS: Removed From Ground
STATUS DATE: 113088
INSTALL DATE: 010172
REGISTERED DATE: 050836
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: -

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: 12
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: Water
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 3
STATUS: Removed From Ground
STATUS DATE: 010893
INSTALL DATE: 010180
REGISTERED DATE: 050886
CAPACITY: 0010000 Gallons
EXT CONTAINMENT DESIGN: -

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 32

DIST/DIR: 0.34 NW

MAP ID: 32

NAME: BAKER PACKERS OIL TOOL CO
ADDRESS: 6023 NAVIGATION
HOUSTON TX 77001
HARRIS
CONTACT: DICK WHITEHEAD

REV: 03/05/04
ID1: 092365
ID2: 0033752
STATUS:
PHONE: 713/923-9351

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 2
STATUS: Removed From Ground
STATUS DATE: 113088
INSTALL DATE: 010180
REGISTERED DATE: 050836
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: -

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:

- More Details Exist For This Site; Max Page Limit Reached -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 42

DIST/DIR: 0.36 NW

MAP ID: 34

NAME: MUSTANG EQUIPMENT
ADDRESS: 6006 NAVIGATION
HOUSTON TX 77012
HARRIS
CONTACT: DWANE BRITTAIN

REV: 03/05/04
ID1: 097720
ID2: 0057197
STATUS:
PHONE: 713/460-2000

SITE INFORMATION

REPORTED: 1/11/1991
ENTERED INTO SYSTEM: 1/11/1991
SITE PRIORITY: soil contamination only, requires full site assessment & rap
SITE STATUS: Final concurrence issued, case close
PRP: MUSTANG EQUIPMENT
PRP ADDRESS: 12800 NORTHWEST FWY
HOUSTON TX 77251
PRP CONTACT: DWANE BRITTAIN
PRP PHONE: 713/460-2000

LUST INFORMATION

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 010891
INSTALL DATE:
REGISTERED DATE: 121990
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: -
CONSTRUCTION MATERIAL: -
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:
INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:
TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Unknown
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 42

DIST/DIR: 0.36 NW

MAP ID: 34

NAME: MUSTANG EQUIPMENT

REV: 03/05/04

ADDRESS: 6006 NAVIGATION

ID1: 097720

HOUSTON TX 77012

ID2: 0057197

HARRIS

STATUS:

CONTACT: DWANE BRITTAIN

PHONE: 713/460-2000

SPILL/OVERFILL PREVENTION:

SPILL/OVERFILL VARIANCE: - -
No Variance

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 40

DIST/DIR: 0.36 SW

MAP ID: 22

NAME: GULF REDUCTION CORP

ADDRESS: 6020 ESPERSON
HOUSTON TX 77011
HARRIS

CONTACT: KEITH SARGENT

REV: 03/05/04

ID1: 107402

ID2: 0001514

STATUS:

PHONE: 713/926-1705

SITE INFORMATION

REPORTED: 11/3/1993
ENTERED INTO SYSTEM: 11/17/1993
SITE PRIORITY: gw impacted, no apparent threats or impacts to receptors
SITE STATUS: monitoring
PRP: GULF REDUCTION CORP
PRP ADDRESS: 6020 ESPERSON ST
HOUSTON TX 77011
PRP CONTACT: KEITH SARGENT
PRP PHONE: 713/926-1705

LUST INFORMATION

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 102793
INSTALL DATE: 010174
REGISTERED DATE: 050886
CAPACITY: 0001500 Gallons
EXT CONTAINMENT DESIGN: -
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: NO PIPING
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: DIESEL
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 40

DIST/DIR: 0.36 SW

MAP ID: 22

NAME: GULF REDUCTION CORP

ADDRESS: 6020 ESPERSON
HOUSTON TX 77011
HARRIS

CONTACT: KEITH SARGENT

REV: 03/05/04

ID1: 107402

ID2: 0001514

STATUS:

PHONE: 713/926-1705

SPILL/OVERFILL PREVENTION:

SPILL/OVERFILL VARIANCE:

No Variance

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 45

DIST/DIR: 0.38 SE

MAP ID: 31

NAME: WAYSIDE TEXACO
ADDRESS: 707 N WAYSIDE
HOUSTON TX 77011
HARRIS
CONTACT: SADRU N DIN

REV: 03/05/04
ID1: 109734
ID2: 0062149
STATUS:
PHONE: 713/926-2987

SITE INFORMATION

REPORTED: 7/27/1995
ENTERED INTO SYSTEM: 8/23/1995
SITE PRIORITY: 2.2 former vapor impact/napl near utility, potential vapor pathway
SITE STATUS: monitoring
PRP: ALMAHRAN CORP
PRP ADDRESS: 1522 PEARLAND TRAIL
HOUSTON TX 77062
PRP CONTACT: SADRU N DIN
PRP PHONE: 713/926-2987

LUST INFORMATION

TANK NUMBER: 4
STATUS: Removed From Ground
STATUS DATE: 110695
INSTALL DATE: 083187
REGISTERED DATE: 010392
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: -
CONSTRUCTION MATERIAL: -
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:
INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:
TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Unknown
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 45

DIST/DIR: 0.38 SE

MAP ID: 31

NAME: WAYSIDE TEXACO
ADDRESS: 707 N WAYSIDE
HOUSTON TX 77011
HARRIS
CONTACT: SADRU N DIN

REV: 03/05/04
ID1: 109734
ID2: 0062149
STATUS:
PHONE: 713/926-2987

SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 110695
INSTALL DATE: 083187
REGISTERED DATE: 010392
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: -

CONSTRUCTION MATERIAL: -
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported

STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: Unknown
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 3
STATUS: Removed From Ground
STATUS DATE: 110695
INSTALL DATE: 083187
REGISTERED DATE: 010392
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: -

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 45

DIST/DIR: 0.38 SE

MAP ID: 31

NAME: WAYSIDE TEXACO
ADDRESS: 707 N WAYSIDE
HOUSTON TX 77011
HARRIS
CONTACT: SADRU N DIN

REV: 03/05/04
ID1: 109734
ID2: 0062149
STATUS:
PHONE: 713/926-2987

CONSTRUCTION MATERIAL:
CORROSION PROTECTION:

- None

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT:
PIPE CONECTORS & VALVES:
PIPE CORROSION PROTECTION:

- None
No Variance

PIPE CORROSION PROT VARIANCE:

SUBSTANCE STORED: Unknown
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 2
STATUS: Removed From Ground
STATUS DATE: 110695
INSTALL DATE: 083187
REGISTERED DATE: 010392
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN:

CONSTRUCTION MATERIAL:
CORROSION PROTECTION:

- None

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 33

DIST/DIR: 0.40 NW

MAP ID: 3

NAME: BLAS KOTE INC
ADDRESS: 6125 INDUSTRIAL WAY
HOUSTON TX 77011
HARRIS
CONTACT: J RICK RENSHAW

REV: 03/05/04
ID1: 111481
ID2: 0019671
STATUS:
PHONE: 713/871-2080

SITE INFORMATION

REPORTED: 8/12/1996
ENTERED INTO SYSTEM: 8/16/1996
SITE PRIORITY: no gw impacted, no apparent threats or impacts to receptors
SITE STATUS: Final concurrence issued, case close
PRP: FAIRFIELD FINANACIAL GROUP
PRP ADDRESS: 8 GREEN WAY PL
HOUSTON TX 77046
PRP CONTACT: J RICK RENSHAW
PRP PHONE: 713/871-2080

LUST INFORMATION

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 080196
INSTALL DATE: 010174
REGISTERED DATE: 050886
CAPACITY: 0002000 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- Cathodic Protection
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 2 EQUIP INSTALL DATE:
INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:
TYPE OF PIPE:
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: -
PIPE CORROSION PROTECTION: -
- Cathodic Protection
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 33

DIST/DIR: 0.40 NW

MAP ID: 3

NAME: BLAS KOTE INC
ADDRESS: 6125 INDUSTRIAL WAY
HOUSTON TX 77011
HARRIS
CONTACT: J RICK RENSHAW

REV: 03/05/04
ID1: 111481
ID2: 0019671
STATUS:
PHONE: 713/871-2080

SPILL/OVERFILL PREVENTION:

SPILL/OVERFILL VARIANCE: - -
No Variance

TANK NUMBER: 2
STATUS: Removed From Ground
STATUS DATE: 080196
INSTALL DATE: 010174
REGISTERED DATE: 050886
CAPACITY: 0002000 Gallons
EXT CONTAINMENT DESIGN: -

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- Cathodic Protection

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE: ;
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- Cathodic Protection
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: DIESEL
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 39

DIST/DIR: 0.40 NW

MAP ID: 4

NAME: GENERAL STEVEDORES INC

REV: 03/05/04

ADDRESS: 6125B INDUSTRIAL WAY

ID1: 110213

HOUSTON TX 77011

ID2: 0067902

HARRIS

STATUS:

CONTACT: MIKE GRAVES

PHONE: 713/923-6678

SITE INFORMATION

REPORTED: 12/26/1995
ENTERED INTO SYSTEM: 2/7/1996
SITE PRIORITY: no gw impacted, no apparent threats or impacts to receptors
SITE STATUS: Final concurrence issued, case close
PRP: GENERAL STEVEDORES INC
PRP ADDRESS: 5807 NAVIGATION BLVD
HOUSTON TX 77011
PRP CONTACT: MIKE GRAVES
PRP PHONE: 713/923-6678

LUST INFORMATION

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 010496
INSTALL DATE: 083187
REGISTERED DATE: 122995
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: Single Wall -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: Single Wall -
PIPE CONECTORS & VALVES: -
PIPE CORROSION PROTECTION: -
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: DIESEL
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

TARGET SITE: NAVIGATION , TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 39

DIST/DIR: 0.40 NW

MAP ID: 4

NAME: GENERAL STEVEDORES INC

ADDRESS: 6125B INDUSTRIAL WAY

HOUSTON TX 77011

HARRIS

CONTACT: MIKE GRAVES

REV: 03/05/04

ID1: 110213

ID2: 0067902

STATUS:

PHONE: 713/923-6678

SPILL/OVERFILL PREVENTION:

SPILL/OVERFILL VARIANCE:

- -
No Variance

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA
HOUSTON TX 77011

JOB: H40112

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 36

DIST/DIR: 0.41 SE

MAP ID: 20

NAME: EXXON 61140
ADDRESS: 6901 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: KRIS GAGNON

REV: 03/05/04
ID1: 091050
ID2: 0026165
STATUS:
PHONE: 713/656-7743

SITE INFORMATION

REPORTED: 10/22/1985
ENTERED INTO SYSTEM: 10/22/1985
SITE PRIORITY: soil contamination only, requires full site assessment & rap
SITE STATUS: Final concurrence issued, case close
PRP: EXXON CO USA
PRP ADDRESS: PO BOX 2180
HOUSTON TX 77252
PRP CONTACT: KRIS GAGNON
PRP PHONE: 713/656-7743

LUST INFORMATION

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 37

DIST/DIR: 0.41 SE

MAP ID: 20

NAME: EXXON 61140
ADDRESS: 6901 NAVIGATION
HOUSTON TX 77011
HARRIS

CONTACT: DALE GOMM

REV: 03/05/04
ID1: 111591
ID2: 0026165
STATUS:
PHONE: 713/819-6879

SITE INFORMATION

REPORTED:
ENTERED INTO SYSTEM: 9/11/1996
SITE PRIORITY: gw impacted, no apparent threats or impacts to receptors
SITE STATUS: Site assessment
PRP: EXXONMOBIL
PRP ADDRESS: PO BOX 4552
HOUSTON TX 77210
PRP CONTACT: DALE GOMM
PRP PHONE: 713/819-6879

LUST INFORMATION

TANK NUMBER: 4
STATUS: In Use
STATUS DATE:
INSTALL DATE: 010185
REGISTERED DATE: 050886
CAPACITY: 0012000 Gallons
EXT CONTAINMENT DESIGN: Single Wall -
-
CONSTRUCTION MATERIAL: Fiberglass Reinforced Plastic (FRP)
CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -
-
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Two-Point System or Coaxial System
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Balance System or Assist System
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE: Pressurizes
PIPE MATERIAL: Fiberglass Reinforced Plastic (FRP)
PIPE DESIGN EXT CONTAINMENT: Single Wall -
PIPE CONECTORS & VALVES: Shear/Impact Valves (Under Dispenser) - -
PIPE CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -
-

PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: - - - Auto Tank Gauging & inv. contr
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: Annual Piping Tightness Test (@ .1 gph) - Auto Leak Line Detector (3.0gph for pressure piping) - -

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 37

DIST/DIR: 0.41 SE

MAP ID: 20

NAME: EXXON 61140
ADDRESS: 6901 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: DALE GOMM

REV: 03/05/04
ID1: 111591
ID2: 0026165
STATUS:
PHONE: 713/819-6879

PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: Auto Flow Restrictor Valve (AFRV) - Factory Built Spill Container/Bucket/Sump - Tight -
Fill Fitting
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 2
STATUS: In Use
STATUS DATE:
INSTALL DATE: 010185
REGISTERED DATE: 050886
CAPACITY: 0010000 Gallons
EXT CONTAINMENT DESIGN: Single Wall -

CONSTRUCTION MATERIAL: Fiberglass Reinforced Plastic (FRP)
CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Two-Point System or Coaxial System
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE: Pressurizes
PIPE MATERIAL: Fiberglass Reinforced Plastic (FRP)
PIPE DESIGN EXT CONTAINMENT: Single Wall -
PIPE CONECTORS & VALVES: Shear/Impact Valves (Under Dispenser) -
PIPE CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -

PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: DIESEL
TANK RLSE DETECTION METHODS: - - - Auto Tank Gauging & inv. contr
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: Annual Piping Tightness Test (@ .1 gph) - Auto Leak Line Detector (3.0gph for pressure piping) -
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: Auto Flow Restrictor Valve (AFRV) - Factory Built Spill Container/Bucket/Sump - Tight -
Fill Fitting
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 3
STATUS: In Use
STATUS DATE:

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 37

DIST/DIR: 0.41 SE

MAP ID: 20

NAME: EXXON 61140
ADDRESS: 6901 NAVIGATION
HOUSTON TX 77011
HARRIS

CONTACT: DALE GOMM

REV: 03/05/04
ID1: 111591
ID2: 0026165
STATUS:
PHONE: 713/819-6879

INSTALL DATE: 010185

REGISTERED DATE: 050886

CAPACITY: 0010000 Gallons

EXT CONTAINMENT DESIGN: Single Wall -

CONSTRUCTION MATERIAL: Fiberglass Reinforced Plastic (FRP)

CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -

CORROSION PROT VARIANCE: No Variance

STG 1 VAPOR RECOVERY EQUIP STATUS: Two-Point System or Coaxial System

STG 1 EQUIP INSTALL DATE:

STG 2 VAPOR RECOVERY EQUIP STATUS: Balance System or Assist System

STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:

INSTALLER NAME:

INSTALLER LICENSE NUMBER:

TYPE OF PIPE: Pressurizes

PIPE MATERIAL: Fiberglass Reinforced Plastic (FRP)

PIPE DESIGN EXT CONTAINMENT: Single Wall -

PIPE CONECTORS & VALVES: Shear/Impact Valves (Under Dispenser) - -

PIPE CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -

PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE

TANK RLSE DETECTION METHODS: - - - Auto Tank Gauging & inv. contr

TANK RLSE DETECTION VARIANCE: No Variance

PIPE RLSE DETECTION METHODS: Annual Piping Tightness Test (@ .1 gph) - Auto Leak Line Detector (3.0gph for pressure piping) - -

PIPE RLSE VARIANCE: No Variance

SPILL/OVERFILL PREVENTION: Auto Flow Restrictor Valve (AFRV) - Factory Built Spill Container/Bucket/Sump - Tight -
Fill Fitting

SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 1

STATUS: In Use

STATUS DATE:

INSTALL DATE: 010185

REGISTERED DATE: 050886

CAPACITY: 0008000 Gallons

EXT CONTAINMENT DESIGN: Single Wall -

CONSTRUCTION MATERIAL: Fiberglass Reinforced Plastic (FRP)

CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -

CORROSION PROT VARIANCE: No Variance

- More Details Exist For This Site; Max Page Limit Reached -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 35

DIST/DIR: 0.42 SE

MAP ID: 19

NAME: CHEVRON 60108012
ADDRESS: 619 WAYSIDE
HOUSTON TX 77011
HARRIS
CONTACT: JEFF DOWNING

REV: 03/05/04
ID1: 094139
ID2: 0029292
STATUS:
PHONE: 713/219-5210

SITE INFORMATION

REPORTED: 12/11/1989
ENTERED INTO SYSTEM: 12/20/1989
SITE PRIORITY: gw impacted, no apparent threats or impacts to receptors
SITE STATUS: Final concurrence issued, case close
PRP: CHEVRON PRODUCTS CO
PRP ADDRESS: PO BOX 4256
HOUSTON TX 77210
PRP CONTACT: JEFF DOWNING
PRP PHONE: 713/219-5210

LUST INFORMATION

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 080101
INSTALL DATE: 010174
REGISTERED DATE: 050886
CAPACITY: 0010000 Gallons
EXT CONTAINMENT DESIGN: Double Wall -
-
CONSTRUCTION MATERIAL: Fiberglass Reinforced Plastic (FRP)
CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -
-
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE: Pressurizes
PIPE MATERIAL: Fiberglass Reinforced Plastic (FRP)
PIPE DESIGN EXT CONTAINMENT: Double Wall -
-
PIPE CONECTORS & VALVES: -
PIPE CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -
-
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: SIR (Stat. Inventory Rconciliation) & Inventory Cntrl - - - Tightness Testing
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: Auto Leak Line Detector (3.0gph for pressure piping) - - - SIR
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 35

DIST/DIR: 0.42 SE

MAP ID: 19

NAME: CHEVRON 60108012

REV: 03/05/04

ADDRESS: 619 WAYSIDE

ID1: 094139

HOUSTON TX 77011

ID2: 0029292

HARRIS

STATUS:

CONTACT: JEFF DOWNING

PHONE: 713/219-5210

SPILL/OVERFILL PREVENTION:

Auto Flow Restrictor Valve (AFRV) - Auto Delivery Shut Off Valve (ADSV) - Factory

Built Spill Container/Bucket/Sump

SPILL/OVERFILL VARIANCE: ---

No Variance

TANK NUMBER:

2

STATUS:

Removed From Ground

STATUS DATE:

080101

INSTALL DATE:

010174

REGISTERED DATE:

050886

CAPACITY:

0010000 Gallons

EXT CONTAINMENT DESIGN:

Double Wall -

CONSTRUCTION MATERIAL:

Fiberglass Reinforced Plastic (FRP)

CORROSION PROTECTION:

FRP Tank or Piping (Noncorrodible) -

CORROSION PROT VARIANCE:

No Variance

STG 1 VAPOR RECOVERY EQUIP STATUS:

Not Reported

STG 1 EQUIP INSTALL DATE:

STG 2 VAPOR RECOVERY EQUIP STATUS:

STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:

INSTALLER NAME:

INSTALLER LICENSE NUMBER:

TYPE OF PIPE:

Pressurizes

PIPE MATERIAL:

Fiberglass Reinforced Plastic (FRP)

PIPE DESIGN EXT CONTAINMENT:

Double Wall -

PIPE CONNECTORS & VALVES:

- -

PIPE CORROSION PROTECTION:

FRP Tank or Piping (Noncorrodible) -

PIPE CORROSION PROT VARIANCE:

No Variance

SUBSTANCE STORED:

GASOLINE

TANK RLSE DETECTION METHODS:

SIR (Stat. Inventory Reconciliation) & Inventory Cntrl - - - Tightness Testing

TANK RLSE DETECTION VARIANCE:

No Variance

PIPE RLSE DETECTION METHODS:

Auto Leak Line Detector (3.0gph for pressure piping) - - - SIR

PIPE RLSE VARIANCE:

No Variance

SPILL/OVERFILL PREVENTION:

Auto Flow Restrictor Valve (AFRV) - Auto Delivery Shut Off Valve (ADSV) - Factory

Built Spill Container/Bucket/Sump

SPILL/OVERFILL VARIANCE:

No Variance

TANK NUMBER:

3

STATUS:

Removed From Ground

STATUS DATE:

080101

INSTALL DATE:

010174

REGISTERED DATE:

050886

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 35

DIST/DIR: 0.42 SE

MAP ID: 19

NAME: CHEVRON 60108012
ADDRESS: 619 WAYSIDE
HOUSTON TX 77011
HARRIS
CONTACT: JEFF DOWNING

REV: 03/05/04
ID1: 094139
ID2: 0029292
STATUS:
PHONE: 713/219-5210

CAPACITY: 0010000 Gallons
EXT CONTAINMENT DESIGN: Double Wall -

CONSTRUCTION MATERIAL: Fiberglass Reinforced Plastic (FRP)
CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE: Pressurizes
PIPE MATERIAL: Fiberglass Reinforced Plastic (FRP)
PIPE DESIGN EXT CONTAINMENT: Double Wall -
PIPE CONECTORS & VALVES: -
PIPE CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: SIR (Stat. Inventory Reconciliation) & Inventory Cntrl - - Tightness Testing
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: Auto Leak Line Detector (3.0gph for pressure piping) - - SIR
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: Auto Flow Restrictor Valve (AFRV) - Auto Delivery Shut Off Valve (ADSV) - Factory
Built Spill Container/Bucket/Sump
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 4
STATUS: In Use
STATUS DATE:
INSTALL DATE: 081501
REGISTERED DATE: 110102
CAPACITY: 0020000 Gallons
EXT CONTAINMENT DESIGN: Single Wall -

CONSTRUCTION MATERIAL: Composite (Steel w/FRP Laminate)
CORROSION PROTECTION: Composite Tank (Steel w/FRP Ext Laminate) -

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Two-Point System or Coaxial System
STG 1 EQUIP INSTALL DATE: 110601
STG 2 VAPOR RECOVERY EQUIP STATUS:

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA
HOUSTON TX 77011

JOB: H40112
CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 38 **DIST/DIR:** 0.42 SE **MAP ID:** 21

NAME: FIRE STATION 20	REV: 03/05/04
ADDRESS: 6902 NAVIGATION	ID1: 108461
HOUSTON TX 77011	ID2: 0033406
HARRIS	STATUS:
CONTACT: TANWIR BADAR	PHONE: 713/837-9474

SITE INFORMATION

REPORTED:	7/12/1994
ENTERED INTO SYSTEM:	8/19/1994
SITE PRIORITY:	gw impacted, no apparent threats or impacts to receptors
SITE STATUS:	monitoring
PRP:	CITY OF HOUSTON
PRP ADDRESS:	PO BOX 1562
	HOUSTON TX 77251
PRP CONTACT:	TANWIR BADAR
PRP PHONE:	713/837-9474

LUST INFORMATION

TANK NUMBER:	I
STATUS:	Removed From Ground
STATUS DATE:	112993
INSTALL DATE:	010172
REGISTERED DATE:	050286
CAPACITY:	0001500 Gallons
EXT CONTAINMENT DESIGN:	-
CONSTRUCTION MATERIAL:	Fiberglass Reinforced Plastic (FRP)
CORROSION PROTECTION:	FRP Tank or Piping (Noncorrodible) -
	-
CORROSION PROT VARIANCE:	No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS:	Not Reported
STG 1 EQUIP INSTALL DATE:	
STG 2 VAPOR RECOVERY EQUIP STATUS:	
STG 2 EQUIP INSTALL DATE:	
INSTALLER COMPANY:	
INSTALLER NAME:	
INSTALLER LICENSE NUMBER:	
TYPE OF PIPE:	
PIPE MATERIAL:	Fiberglass Reinforced Plastic (FRP)
PIPE DESIGN EXT CONTAINMENT:	-
PIPE CONECTORS & VALVES:	- -
PIPE CORROSION PROTECTION:	-
	- None
PIPE CORROSION PROT VARIANCE:	No Variance
SUBSTANCE STORED:	DIESEL
TANK RLSE DETECTION METHODS:	- - - None
TANK RLSE DETECTION VARIANCE:	No Variance
PIPE RLSE DETECTION METHODS:	- - - None
PIPE RLSE VARIANCE:	No Variance

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 38

DIST/DIR: 0.42 SE

MAP ID: 21

NAME: FIRE STATION 20
ADDRESS: 6902 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: TANWIR BADAR

REV: 03/05/04
ID1: 108461
ID2: 0033406
STATUS:
PHONE: 713/837-9474

SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 2
STATUS: Removed From Ground
STATUS DATE: 112993
INSTALL DATE: 010172
REGISTERED DATE: 050286
CAPACITY: 0001500 Gallons
EXT CONTAINMENT DESIGN: -

CONSTRUCTION MATERIAL: Fiberglass Reinforced Plastic (FRP)
CORROSION PROTECTION: FRP Tank or Piping (Noncorrodible) -

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Fiberglass Reinforced Plastic (FRP)
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 41

DIST/DIR: 0.42 SW

MAP ID: 26

NAME: MAGNOLIA PARK SERVICE CENTER
ADDRESS: 104 N GREENWOOD
HOUSTON TX 77011
HARRIS
CONTACT: R C PATYRAK

REV: 03/05/04
ID1: 106655
ID2: 0033345
STATUS:
PHONE: 713/945-7360

SITE INFORMATION

REPORTED: 12/7/1992
ENTERED INTO SYSTEM: 6/16/1993
SITE PRIORITY: gw impacted, no apparent threats or impacts to receptors
SITE STATUS: Final concurrence issued, case close
PRP: HOUSTON LIGHTING & POWER
PRP ADDRESS: PO BOX 1700
HOUSTON TX 77251
PRP CONTACT: R C PATYRAK
PRP PHONE: 713/945-7360

LUST INFORMATION

TANK NUMBER: 2
STATUS: Perm. Filled in Place
STATUS DATE: 020588
INSTALL DATE: 010151
REGISTERED DATE: 050886
CAPACITY: 0010000 Gallons
EXT CONTAINMENT DESIGN: Single Wall -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 2 EQUIP INSTALL DATE:
INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:
TYPE OF PIPE: Pressurizes
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: Single Wall -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 41

DIST/DIR: 0.42 SW

MAP ID: 26

NAME: MAGNOLIA PARK SERVICE CENTER

REV: 03/05/04

ADDRESS: 104 N GREENWOOD

IDI: 106655

HOUSTON TX 77011

ID2: 0033345

HARRIS

STATUS:

CONTACT: R C PATYRAK

PHONE: 713/945-7360

SPILL/OVERFILL PREVENTION:

SPILL/OVERFILL VARIANCE: - -
No Variance

TANK NUMBER:

1

STATUS:

Perm. Filled in Place

STATUS DATE:

053086

INSTALL DATE:

010151

REGISTERED DATE:

050886

CAPACITY:

0010000 Gallons

EXT CONTAINMENT DESIGN:

Single Wall -

CONSTRUCTION MATERIAL:

Steel

CORROSION PROTECTION:

-

- None

CORROSION PROT VARIANCE:

No Variance

STG 1 VAPOR RECOVERY EQUIP STATUS:

Not Reported

STG 1 EQUIP INSTALL DATE:

STG 2 VAPOR RECOVERY EQUIP STATUS:

Not Reported

STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:

INSTALLER NAME:

INSTALLER LICENSE NUMBER:

TYPE OF PIPE:

Pressurizes

PIPE MATERIAL:

Steel

PIPE DESIGN EXT CONTAINMENT:

Single Wall -

PIPE CONECTORS & VALVES:

- -

PIPE CORROSION PROTECTION:

-

- None

PIPE CORROSION PROT VARIANCE:

No Variance

SUBSTANCE STORED:

GASOLINE

TANK RLSE DETECTION METHODS:

- - - None

TANK RLSE DETECTION VARIANCE:

No Variance

PIPE RLSE DETECTION METHODS:

- - - None

PIPE RLSE VARIANCE:

No Variance

SPILL/OVERFILL PREVENTION:

- -

SPILL/OVERFILL VARIANCE:

No Variance

TANK NUMBER:

3

STATUS:

In Use

STATUS DATE:

INSTALL DATE:

010185

REGISTERED DATE:

050886

CAPACITY:

0000500 Gallons

EXT CONTAINMENT DESIGN:

Single Wall -

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 41

DIST/DIR: 0.42 SW

MAP ID: 26

NAME: MAGNOLIA PARK SERVICE CENTER
ADDRESS: 104 N GREENWOOD
HOUSTON TX 77011
HARRIS
CONTACT: R C PATYRAK

REV: 03/05/04
ID1: 106655
ID2: 0033345
STATUS:
PHONE: 713/945-7360

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: Cathodic Protection-Field Installed - Ext Dielectric Coating/Laminate/Tape/Wrap -
Ext Dielectric Coating/Laminate/Tape/Wrap -

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Exempt by TNRCC Rule
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE: Gravity
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: Single Wall -
PIPE CONECTORS & VALVES: -
PIPE CORROSION PROTECTION: Ext Dielectric Coating/Laminate/Tape/Wrap - Cathodic Protection-Field Installed
FRP Tank or Piping (Noncorrodible) - Cathodic Protection
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: USED OIL
TANK RLSE DETECTION METHODS: Groundwater Monitoring - Vapor Monitoring - Weekly Manual Tank Gauging (Tanks <= 1000 gal) - Auto Tank Gauging & inv. contr
TANK RLSE DETECTION VARIANCE: Variance
PIPE RLSE DETECTION METHODS: Auto Leak Line Detector (3.0gph for pressure piping) - Triennial Tightness Test (for suction/gravity piping) - Tightness Testing
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: Auto Flow Restrictor Valve (AFRV) - Auto Delivery Shut Off Valve (ADSV) - Factory Built Spill Container/Bucket/Sump
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 2
STATUS: In Use
STATUS DATE:
INSTALL DATE: 010176
REGISTERED DATE: 050886
CAPACITY: 0010000 Gallons
EXT CONTAINMENT DESIGN: Single Wall -

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: Ext Dielectric Coating/Laminate/Tape/Wrap - Cathodic Protection-Field Installed
Ext Dielectric Coating/Laminate/Tape/Wrap -

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Two-Point System or Coaxial System
STG 1 EQUIP INSTALL DATE: 041291
STG 2 VAPOR RECOVERY EQUIP STATUS:

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 44

DIST/DIR: 0.43 NW

MAP ID: 15

NAME: TRANSENERGY CONSTRUCTION SERVICES
ADDRESS: 6203 INDUSTRIAL WAY
HOUSTON TX 77011
HARRIS
CONTACT: ARTURO MANRIQUE

REV: 03/05/04
ID1: 113244
ID2: 0034383
STATUS:
PHONE: 713/926-3181

SITE INFORMATION

REPORTED: 6/4/1998
ENTERED INTO SYSTEM: 6/10/1998
SITE PRIORITY: assessment incomplete, no apparent receptors impacted
SITE STATUS: Final concurrence issued, case close
PRP: TRANSENERGY GRINDING
PRP ADDRESS: 6203 INDUSTRIAL WAY
HOUSTON TX
PRP CONTACT: ARTURO MANRIQUE
PRP PHONE: 713/926-3181

LUST INFORMATION

TANK NUMBER: NCG-4
STATUS: Removed From Ground
STATUS DATE: 031390
INSTALL DATE:
REGISTERED DATE: 050886
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 44

DIST/DIR: 0.43 NW

MAP ID: 15

NAME: TRANSENERGY CONSTRUCTION SERVICES
ADDRESS: 6203 INDUSTRIAL WAY
HOUSTON TX 77011
HARRIS
CONTACT: ARTURO MANRIQUE

REV: 03/05/04
ID1: 113244
ID2: 0034383
STATUS:
PHONE: 713/926-3181

SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: GC-G-5
STATUS: Removed From Ground
STATUS DATE: 051998
INSTALL DATE: 070167
REGISTERED DATE: 050886
CAPACITY: 0004000 Gallons
EXT CONTAINMENT DESIGN: Single Wall -

CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -

CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: Single Wall -
PIPE CONNECTORS & VALVES: - -
PIPE CORROSION PROTECTION: Ext Dielectric Coating/Laminate/Tape/Wrap -

PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: - - - Inventory Control
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - Tightness Testing
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: YDW-3
STATUS: Removed From Ground
STATUS DATE: 030599
INSTALL DATE: 070163
REGISTERED DATE: 050886
CAPACITY: 0012000 Gallons
EXT CONTAINMENT DESIGN: Single Wall -

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

LEAKING UNDERGROUND STORAGE TANKS

SEARCH ID: 44

DIST/DIR: 0.43 NW

MAP ID: 15

NAME: TRANSENERGY CONSTRUCTION SERVICES

ADDRESS: 6203 INDUSTRIAL WAY

HOUSTON TX 77011

HARRIS

CONTACT: ARTURO MANRIQUE

REV: 03/05/04

ID1: 113244

ID2: 0034383

STATUS:

PHONE: 713/926-3181

CONSTRUCTION MATERIAL: Steel

CORROSION PROTECTION:

CORROSION PROT VARIANCE: No Variance

STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported

STG 1 EQUIP INSTALL DATE:

STG 2 VAPOR RECOVERY EQUIP STATUS:

STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:

INSTALLER NAME:

INSTALLER LICENSE NUMBER:

TYPE OF PIPE:

PIPE MATERIAL: Steel

PIPE DESIGN EXT CONTAINMENT: Single Wall -

PIPE CONECTORS & VALVES: - -

PIPE CORROSION PROTECTION: Ext Dielectric Coating/Laminate/Tape/Wrap -

PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: DIESEL

TANK RLSE DETECTION METHODS: - - - Inventory Control

TANK RLSE DETECTION VARIANCE: No Variance

PIPE RLSE DETECTION METHODS: - - - Tightness Testing

PIPE RLSE VARIANCE: No Variance

SPILL/OVERFILL PREVENTION: - -

SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: YDN-2

STATUS: Removed From Ground

STATUS DATE: 030599

INSTALL DATE: 070179

REGISTERED DATE: 050886

CAPACITY: 0012000 Gallons

EXT CONTAINMENT DESIGN: Single Wall -

CONSTRUCTION MATERIAL: Steel

CORROSION PROTECTION:

CORROSION PROT VARIANCE: No Variance

STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported

STG 1 EQUIP INSTALL DATE:

STG 2 VAPOR RECOVERY EQUIP STATUS:

STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:

- More Details Exist For This Site; Max Page Limit Reached -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 19

DIST/DIR: 0.00 --

MAP ID: 5

NAME: J B SMITH MFG
ADDRESS: 6618 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: WESLEY COWAN SR

REV: 04/04/2004
ID1: IHW-33608
ID2: TXD008065880
STATUS: ACTIVE
PHONE: 713-928-5460

FACILITY INFORMATION:

REGISTRATION NUMBER: 33608
INITIAL NOTIFICATION DATE: 19821130
LAST AMMENDMENT DATE: 20030613
EPA ID: TXD008065880
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 34980 - Manufacturing - Fabricated Pipe And Fittings
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: Yes
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: SQG/Industrial
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS: 6618 Navigation Blvd
MAILING ADDRESS 2:
MAILING ADDRESS 3: Houston TX 77011 - 1342
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6618 Navigation Blvd, Houston, TX

OWNER INFORMATION

COMPANY or INDIVIDUAL S NAME: J B Smith Mfg Co
CONTACT: Wesley Cowan Sr
CONTACT PHONE: 713-928-5460
OWNER MAILING ADDRESS:
OWNER MAILING ADDRESS 2: Houston TX 77261-
OWNER P. O. BOX: PO Box 9310
OWNER TELEPHONE: 713-928-5460
OWNER FAX: Not reported
OWNER EMAIL: Not reported
TYPE OF BUSINESS: Unknown

OPERATOR INFORMATION

COMPANY or INDIVIDUAL S NAME: J B Smith Mfg Co
OPERATOR MAILING ADDRESS:
OPERATOR MAILING ADDRESS 2: Houston TX 77261-
OPERATOR TELEPHONE: 713-928-5460
OPERATOR FAX:
OPERATOR EMAIL:
TYPE OF BUSINESS: Unknown
OPERATOR TAX ID:

WASTE INFORMATION

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 19

DIST/DIR: 0.00 --

MAP ID: 5

NAME: J B SMITH MFG
ADDRESS: 6618 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: WESLEY COWAN SR

REV: 04/04/2004
ID1: IHW-33608
ID2: TXD008065880
STATUS: ACTIVE
PHONE: 713-928-5460

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE: 1000119H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Stabilization - type unknown
GENERATOR S WASTE DESCRIPTION: Purge water from monitoring wells. It contains tetrachloroethylene, cis-1,2, di
PRIMARY SOURCE: G45

TX WASTE CODE: 0501203H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Non-halogenated solvent
GENERATOR S WASTE DESCRIPTION: Spent solvent generated from parts cleaning.
PRIMARY SOURCE: G09

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 19

DIST/DIR: 0.00 --

MAP ID: 5

NAME: J B SMITH MFG
ADDRESS: 6618 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: WESLEY COWAN SR

REV: 04/04/2004
ID1: IHW-33608
ID2: TXD008065880
STATUS: ACTIVE
PHONE: 713-928-5460

TX WASTE CODE: 0002203H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Non-halogenated solvent
GENERATOR S WASTE DESCRIPTION: Spent diesel fuel and cutting oil. Generated from parts cleaning and machin
PRIMARY SOURCE: G09

TX WASTE CODE:
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE: 1003310H
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM: Spent solid filters or adsorbents (inorganic)
GENERATOR S WASTE DESCRIPTION: Absorbant, hydrocarbon contaminated; generated by equipment leakage.
PRIMARY SOURCE: G32

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE: 10043072
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Metal scale, filings, or scrap
GENERATOR S WASTE DESCRIPTION: Scrap metal and metal products from mfg. process.
PRIMARY SOURCE:

TX WASTE CODE: 1226601H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Still bottoms of halogened solvents/organic liquids
GENERATOR S WASTE DESCRIPTION: Hazardous waste sludge from UST - contains toluene Trichloroethane and tetrachlo
PRIMARY SOURCE: G14

TX WASTE CODE: 1225203H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Non-halogenated solvent
GENERATOR S WASTE DESCRIPTION: Paint waste/off spec product; 11/6/96
PRIMARY SOURCE: G11

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 16

DIST/DIR: 0.02 SE

MAP ID: 2

NAME: DIESEL PUMP & INJECTOR

REV: 04/04/2004

ADDRESS: 6632 NAVIGATION BLVD

ID1: IHW-51277

HOUSTON TX 77011

ID2: TXD042920421

HARRIS

STATUS: INACTIVE

CONTACT: JEFF KELLEY

PHONE: 713-921-2318

FACILITY INFORMATION:

REGISTRATION NUMBER: 51277
INITIAL NOTIFICATION DATE: 19850725
LAST AMMENDMENT DATE: 19950502
EPA ID: TXD042920421
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 75380 - Services - General Automotive Repair Shops
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: CESQG/Non-industrial and/or municipal
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS: 6632 Navigation Blvd
MAILING ADDRESS 2:
MAILING ADDRESS 3: Houston TX 77011 -
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6632 Navigation Blvd, Houston, TX

TX WASTE CODE: 2318211H
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM: Paint thinner or petroleum distillates
GENERATOR S WASTE DESCRIPTION: Degreasing parts
PRIMARY SOURCE: G09

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 22

DIST/DIR: 0.05 NW

MAP ID: 8

NAME: REEDHYCALOG
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: MARIO RODRIGUEZ

REV: 04/04/2004
ID1: IHW-31202
ID2: TXD008063364
STATUS: ACTIVE
PHONE: 713-924-5200

FACILITY INFORMATION:

REGISTRATION NUMBER: 31202
INITIAL NOTIFICATION DATE: 19771220
LAST AMMENDMENT DATE: 20030603
EPA ID: TXD008063364
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 35330 - Manufacturing - Oil and Gas Field Machinery
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: SQG/Industrial
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS:
MAILING ADDRESS 2: PO Box 2119
MAILING ADDRESS 3: Houston TX 77252 - 2119
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6501 Navigation Blvd, Houston, TX

OWNER INFORMATION

COMPANY or INDIVIDUAL S NAME: ReedHycalog LP
CONTACT: Mario Rodriguez
CONTACT PHONE: 713-924-5200
OWNER MAILING ADDRESS: 6501 Navigation Blvd
OWNER MAILING ADDRESS 2: Houston TX 77011-1399
OWNER P. O. BOX: Not reported
OWNER TELEPHONE: 832-681-8000
OWNER FAX: 832-681-8056
OWNER EMAIL: Not reported
TYPE OF BUSINESS: Other/Misc

OPERATOR INFORMATION

COMPANY or INDIVIDUAL S NAME: ReedHycalog LP
OPERATOR MAILING ADDRESS: 6501 Navigation Blvd
OPERATOR MAILING ADDRESS 2: Houston TX 77011-1399
OPERATOR TELEPHONE: 832-681-8000
OPERATOR FAX: 832-681-8056
OPERATOR EMAIL:
TYPE OF BUSINESS: Other/Misc
OPERATOR TAX ID: 470898821

WASTE INFORMATION

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 22

DIST/DIR: 0.05 NW

MAP ID: 8

NAME: REEDHYCLOG
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: MARIO RODRIGUEZ

REV: 04/04/2004
ID1: IHW-31202
ID2: TXD008063364
STATUS: ACTIVE
PHONE: 713-924-5200

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM: Non-halogenated solvent
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE: G08

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION: ISOPROPYL ALCOHOL
PRIMARY SOURCE:

TX WASTE CODE: 99973191
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM: Other waste inorganic solids
GENERATOR S WASTE DESCRIPTION: One time waste; Unused product; Sodium Hydroxide (Solid) Waste inactivated
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION: CONTAINERS
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM: Halogenated (e.g., chlorinated) solvent
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE: G08

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 22

DIST/DIR: 0.05 NW

MAP ID: 8

NAME: REEDHYCALOG
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: MARIO RODRIGUEZ

REV: 04/04/2004
ID1: IHW-31202
ID2: TXD008063364
STATUS: ACTIVE
PHONE: 713-924-5200

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 13

DIST/DIR: 0.09 SE

MAP ID: 13

NAME: CENTRAL PARK SHEET METAL
ADDRESS: 6647 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: ENVIRONMENTAL MANAGER

REV: 11/01/2002
ID1: IHW-71651
ID2: TXD008065237
STATUS: INACTIVE
PHONE:

FACILITY INFORMATION:

REGISTRATION NUMBER: 71651
INITIAL NOTIFICATION DATE: Not reported
LAST AMMENDMENT DATE: 20010727
EPA ID: TXD008065237
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 99990 - Nonclassifiable - Nonclassifiable Establishments
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: Not a HW generator/Not reported
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS: 6647 NAVIGATION BLVD
MAILING ADDRESS 2:
MAILING ADDRESS 3: HOUSTON TX 77011 - 1341
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6647 NAVIGATION, HOUSTON, TX

OWNER INFORMATION

COMPANY or INDIVIDUAL S NAME: CENTRAL PARK SHEET METAL
CONTACT: ENVIRONMENTAL MANAGER
CONTACT PHONE:
OWNER MAILING ADDRESS: 6647 NAVIGATION BLVD
OWNER MAILING ADDRESS 2: HOUSTON TX 77011-1341
OWNER P. O. BOX: Not reported
OWNER TELEPHONE: Not reported
OWNER FAX: Not reported
OWNER EMAIL: Not reported
TYPE OF BUSINESS: Unknown

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 14

DIST/DIR: 0.09 SE

MAP ID: 13

NAME: CENTRAL PARK SHEET METAL WORKS

REV: 04/04/2004

ADDRESS: 6647 NAVIGATION BLVD

ID1: IHW-36363

HOUSTON TX 77011

ID2: TXD008065237

HARRIS

STATUS: INACTIVE

CONTACT: ENVIRONMENTAL MANAGER

PHONE:

FACILITY INFORMATION:

REGISTRATION NUMBER: 36363

INITIAL NOTIFICATION DATE: Not reported

LAST AMMENDMENT DATE: 20010727

EPA ID: TXD008065237

TCEQ PERMIT: Not reported

SITE PRIMARY STD. IND. CODE: 99990 - Nonclassifiable - Nonclassifiable Establishments

GENERATOR OF WASTE: Yes

RECEIVERS OF WASTE: No

TRANSPORTERS OF WASTE: No

TRANSFER FACILITY: No

MEXICAN FACILITY (Maquiladora): No

TYPE OF GENERATOR: Not a HW generator/Not reported

INDUSTRIAL WASTE PERMIT NUMBER: Not reported

MUNICIPAL WASTE PERMIT NUMBER: Not reported

MAILING ADDRESS: 6647 Navigation Blvd

MAILING ADDRESS 2:

MAILING ADDRESS 3: Houston TX 77011 -

MAILING COUNTRY: USA

LOCATION DESCRIPTION: 6647 Navigation, Houston, TX

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 23

DIST/DIR: 0.17 NW

MAP ID: 18

NAME: SEMINOLE TUBULAR PRODUCTS CO
ADDRESS: 6247 NAVIGATION ST
HOUSTON TX 77261
HARRIS
CONTACT: DON SCHERER

REV: 04/04/2004
ID1: IHW-20327
ID2: TXD086474855
STATUS: ACTIVE
PHONE: 713-928-6437

FACILITY INFORMATION:

REGISTRATION NUMBER: 20327
INITIAL NOTIFICATION DATE: 19920526
LAST AMMENDMENT DATE: 19990217
EPA ID: TXD086474855
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 34940 - Manufacturing - Valves & Pipe Fittings, NEC
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: SQG/Industrial
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS: 6247 Navigation Blvd.
MAILING ADDRESS 2:
MAILING ADDRESS 3: Houston TX 77011 -
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6247 Navigation St Houston TX 77001

OWNER INFORMATION

COMPANY or INDIVIDUAL S NAME: Seminole Tubular Products Co
CONTACT: Don Scherer
CONTACT PHONE: 713-928-6437
OWNER MAILING ADDRESS: 6247 Navigation Blvd.
OWNER MAILING ADDRESS 2: Houston TX 77011-
OWNER P. O. BOX: Not reported
OWNER TELEPHONE: 713-928-6437
OWNER FAX: Not reported
OWNER EMAIL: Not reported
TYPE OF BUSINESS: Unknown

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 23

DIST/DIR: 0.17 NW

MAP ID: 18

NAME: SEMINOLE TUBULAR PRODUCTS CO
ADDRESS: 6247 NAVIGATION ST
HOUSTON TX 77261
HARRIS
CONTACT: DON SCHERER

REV: 04/04/2004
ID1: IHW-20327
ID2: TXD086474855
STATUS: ACTIVE
PHONE: 713-928-6437

PRIMARY SOURCE:

TX WASTE CODE: 00012051
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Oil-water emulsion or mixture
GENERATOR S WASTE DESCRIPTION: Petroleum product & water/Cleanout & Service of equipment/24 Oct 96
PRIMARY SOURCE:

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 21

DIST/DIR: 0.17 SW

MAP ID: 7

NAME: OMSCO COMPANY
ADDRESS: 6418 EPERSON ST
HOUSTON TX 77261
HARRIS
CONTACT: JAMES STRICKLAND

REV: 04/04/2004
ID1: IHW-38904
ID2: TXD008098659
STATUS: ACTIVE
PHONE: 713-926-7401

FACILITY INFORMATION:

REGISTRATION NUMBER: 38904
INITIAL NOTIFICATION DATE: 19890613
LAST AMMENDMENT DATE: 20010127
EPA ID: TXD008098659
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 35330 - Manufacturing - Oil and Gas Field Machinery
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: Not reported/Not reported
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS: 6418 Eperson St
MAILING ADDRESS 2:
MAILING ADDRESS 3: Houston TX 77261 -
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6418 Eperson St, Houston, TX

OWNER INFORMATION

COMPANY or INDIVIDUAL S NAME: SHAW RESOURCE SERVICES
CONTACT: James Strickland
CONTACT PHONE: 713-926-7401
OWNER MAILING ADDRESS: 6418 Eperson St
OWNER MAILING ADDRESS 2: Houston TX 77261-
OWNER P. O. BOX: Not reported
OWNER TELEPHONE: 713-926-7401
OWNER FAX: Not reported
OWNER EMAIL: Not reported
TYPE OF BUSINESS: Unknown

TX WASTE CODE: 9702105H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Acidic aqueous waste
GENERATOR S WASTE DESCRIPTION: Phosphoric acid/nitric acid water solution. Acid bath used to cure tool parts.
PRIMARY SOURCE: G09

TX WASTE CODE: 0003219H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Other organic liquids
GENERATOR S WASTE DESCRIPTION: wate oil and coolants contaminated with solvents and degreasers. First generated

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 21

DIST/DIR: 0.17 SW

MAP ID: 7

NAME: OMSCO COMPANY
ADDRESS: 6418 EPERSON ST
HOUSTON TX 77261
HARRIS
CONTACT: JAMES STRICKLAND

REV: 04/04/2004
ID1: IHW-38904
ID2: TXD008098659
STATUS: ACTIVE
PHONE: 713-926-7401

PRIMARY SOURCE: G01

TX WASTE CODE: 97033071
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Metal scale, filings, or scrap
GENERATOR S WASTE DESCRIPTION: Magna flux and H2O used in the inspection of pipe.
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE: 00012051
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Oil-water emulsion or mixture
GENERATOR S WASTE DESCRIPTION: Used machine oils/ coolant oil & water/ Quench oil from drill pipe manufacturing
PRIMARY SOURCE:

TX WASTE CODE: 0004219H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Other organic liquids
GENERATOR S WASTE DESCRIPTION: waste pipe coating from pipe machining operation-first generated 01-95

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 21

DIST/DIR: 0.17 SW

MAP ID: 7

NAME: OMSCO COMPANY
ADDRESS: 6418 EPERSON ST
HOUSTON TX 77261
HARRIS
CONTACT: JAMES STRICKLAND

REV: 04/04/2004
ID1: IHW-38904
ID2: TXD008098659
STATUS: ACTIVE
PHONE: 713-926-7401

PRIMARY SOURCE: G09

TX WASTE CODE: 00052061
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Waste oil
GENERATOR S WASTE DESCRIPTION: waste oil from servicing of manufacturing equipment. Waste contains waste motor
PRIMARY SOURCE:

TX WASTE CODE: 0006105H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Acidic aqueous waste
GENERATOR S WASTE DESCRIPTION: waste hydrochlorite acid solution from metal treating operation-waste contains w
PRIMARY SOURCE: G02

TX WASTE CODE: 97043072
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Metal scale, filings, or scrap
GENERATOR S WASTE DESCRIPTION: oil / Clean up / 3/24/97
PRIMARY SOURCE:

TX WASTE CODE: 9705319H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Other waste inorganic solids
GENERATOR S WASTE DESCRIPTION: Bottoms from phosphoric acid-nitric acid water solution/cleaning of the residual
PRIMARY SOURCE: G14

TX WASTE CODE: 9706219I
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Other organic liquids
GENERATOR S WASTE DESCRIPTION: Tool rinsate stream/after lubrication of tool joints with cutting oil, parts are
PRIMARY SOURCE:

TX WASTE CODE: 0002105H
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM: Acidic aqueous waste
GENERATOR S WASTE DESCRIPTION: waste phosphoric acid from metal treating process-waste containing phosphoric ac
PRIMARY SOURCE: G02

TX WASTE CODE:
WASTE CODE STATUS: Active
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 20

DIST/DIR: 0.19 NW

MAP ID: 17

NAME: NATIONAL SUPPLY CO
ADDRESS: 6229 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: NELSON LEE

REV: 04/04/2004
ID1: IHW-31374
ID2: TXT490014222
STATUS: INACTIVE
PHONE: 713-960-5838

FACILITY INFORMATION:

REGISTRATION NUMBER: 31374
INITIAL NOTIFICATION DATE: 19781113
LAST AMMENDMENT DATE: 19981106
EPA ID: TXT490014222
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 35330 - Manufacturing - Oil and Gas Field Machinery
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: Not a HW generator/Not reported
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS:
MAILING ADDRESS 2: PO Box 9163
MAILING ADDRESS 3: Houston TX 77011 -
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6229 Navigation Blvd Houston TX 77011

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 20

DIST/DIR: 0.19 NW

MAP ID: 17

NAME: NATIONAL SUPPLY CO
ADDRESS: 6229 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: NELSON LEE

REV: 04/04/2004
ID1: IHW-31374
ID2: TXT490014222
STATUS: INACTIVE
PHONE: 713-960-5838

PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 17

DIST/DIR: 0.20 NW

MAP ID: 14

NAME: ELECTRO COATINGS NAVIGATION PLANT
ADDRESS: 6220 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: MARK FREER

REV: 04/04/2004
ID1: IHW-86805
ID2: NOT REPORTED
STATUS: ACTIVE
PHONE: 713-923-5935

FACILITY INFORMATION:

REGISTRATION NUMBER: 86805
INITIAL NOTIFICATION DATE: 20010603
LAST AMMENDMENT DATE: 20030321
EPA ID: Not reported
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 34710 - Manufacturing - Plating and Polishing
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: CESQG/Industrial
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS: 216 Baywood St
MAILING ADDRESS 2:
MAILING ADDRESS 3: Houston TX 77011 - 2399
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6220 Navigation Blvd, Houston, TX

OWNER INFORMATION

COMPANY or INDIVIDUAL S NAME: Electro Coatings of Texas Inc
CONTACT: Mark Freer
CONTACT PHONE: 713-923-5935
OWNER MAILING ADDRESS:
OWNER MAILING ADDRESS 2: Houston TX 77223-0352
OWNER P. O. BOX: PO Box 230352
OWNER TELEPHONE: Not reported
OWNER FAX: Not reported
OWNER EMAIL: Not reported
TYPE OF BUSINESS: Unknown

OPERATOR INFORMATION

COMPANY or INDIVIDUAL S NAME: Electro Coatings of Texas Inc
OPERATOR MAILING ADDRESS: 216 Baywood St
OPERATOR MAILING ADDRESS 2: Houston TX 77011-2399
OPERATOR TELEPHONE:
OPERATOR FAX:
OPERATOR EMAIL:
TYPE OF BUSINESS: Unknown

OPERATOR TAX ID:

WASTE INFORMATION

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 17

DIST/DIR: 0.20 NW

MAP ID: 14

NAME: ELECTRO COATINGS NAVIGATION PLANT

REV: 04/04/2004

ADDRESS: 6220 NAVIGATION BLVD

ID1: IHW-86805

HOUSTON TX 77011

ID2: NOT REPORTED

HARRIS

STATUS: ACTIVE

CONTACT: MARK FREER

PHONE: 713-923-5935

TX WASTE CODE:

00015191

WASTE CODE STATUS:

Active

WASTE DESCRIPTION FROM WASTE FORM: Other inorganic sludges

GENERATOR S WASTE DESCRIPTION: Grinding sludge. Generating process is grinding and honing metal parts. 7/3/01

PRIMARY SOURCE:

TX WASTE CODE:

00021191

WASTE CODE STATUS:

Active

WASTE DESCRIPTION FROM WASTE FORM: Stabilization - type unknown

GENERATOR S WASTE DESCRIPTION: Spent coolant. Generating process is grinding and honing of metal parts. 7/3/01

PRIMARY SOURCE:

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 15

DIST/DIR: 0.22 NW

MAP ID: 6

NAME: CUMMINS RECON TOOL
ADDRESS: 6230 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: RUFUS MATTHEWS

REV: 04/04/2004
ID1: IHW-39537
ID2: TXD987997327
STATUS: INACTIVE
PHONE: 713-926-2583

FACILITY INFORMATION:

REGISTRATION NUMBER: 39537
INITIAL NOTIFICATION DATE: 19901116
LAST AMMENDMENT DATE: 19920910
EPA ID: TXD987997327
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 35330 - Manufacturing - Oil and Gas Field Machinery
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: SQG/Not reported
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS: 6230 Navigation
MAILING ADDRESS 2:
MAILING ADDRESS 3: Houston TX 77011 -
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6230 Navigation, Houston, TX

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 18

DIST/DIR: 0.23 NW

MAP ID: 16

NAME: ICO INC
ADDRESS: 630 MCFARLAND
HOUSTON TX 77011
HARRIS
CONTACT: JOHN CARRILLO

REV: 04/04/2004
ID1: IHW-37480
ID2: NOT REPORTED
STATUS: INACTIVE
PHONE: 713-466-9977

FACILITY INFORMATION:

REGISTRATION NUMBER: 37480
INITIAL NOTIFICATION DATE: 19860627
LAST AMMENDMENT DATE: 20010214
EPA ID: Not reported
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 35330 - Manufacturing - Oil and Gas Field Machinery
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: SQG/Not reported
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS:
MAILING ADDRESS 2: PO Box 7631
MAILING ADDRESS 3: Houston TX 77270 - 7631
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 630 McFarland, Houston, TX

OWNER INFORMATION

COMPANY or INDIVIDUAL S NAME: ICO Inc
CONTACT: John Carrillo
CONTACT PHONE: 713-466-9977
OWNER MAILING ADDRESS:
OWNER MAILING ADDRESS 2: Houston TX 77270-7631
OWNER P. O. BOX: PO Box 7631
OWNER TELEPHONE: 713-466-9977
OWNER FAX: Not reported
OWNER EMAIL: Not reported
TYPE OF BUSINESS: Unknown

OPERATOR INFORMATION

COMPANY or INDIVIDUAL S NAME: ICO Inc
OPERATOR MAILING ADDRESS:
OPERATOR MAILING ADDRESS 2: Houston TX 77270-7631
OPERATOR TELEPHONE: 713-466-9977
OPERATOR FAX:
OPERATOR EMAIL:
TYPE OF BUSINESS: Unknown
OPERATOR TAX ID:

WASTE INFORMATION

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 18

DIST/DIR: 0.23 NW

MAP ID: 16

NAME: ICO INC
ADDRESS: 630 MCFARLAND
HOUSTON TX 77011
HARRIS
CONTACT: JOHN CARRILLO

REV: 04/04/2004
ID1: IHW-37480
ID2: NOT REPORTED
STATUS: INACTIVE
PHONE: 713-466-9977

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

TX WASTE CODE:
WASTE CODE STATUS: Inactive
WASTE DESCRIPTION FROM WASTE FORM:
GENERATOR S WASTE DESCRIPTION:
PRIMARY SOURCE:

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

OTHER SITE

SEARCH ID: 24

DIST/DIR: 0.25 NW

MAP ID: 9

NAME: THE DALE COMPANY
ADDRESS: 6216 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: RON RUSSELL

REV: 04/04/2004
ID1: IHW-81089
ID2: TXD988088159
STATUS: INACTIVE
PHONE: 713-928-3437

FACILITY INFORMATION:

REGISTRATION NUMBER: 81089
INITIAL NOTIFICATION DATE: 19930521
LAST AMMENDMENT DATE: 20010214
EPA ID: TXD988088159
TCEQ PERMIT: Not reported
SITE PRIMARY STD. IND. CODE: 33990 - Manufacturing - Primary Metal Products, NEC
GENERATOR OF WASTE: Yes
RECEIVERS OF WASTE: No
TRANSPORTERS OF WASTE: No
TRANSFER FACILITY: No
MEXICAN FACILITY (Maquiladora): No
TYPE OF GENERATOR: CESQG/Industrial
INDUSTRIAL WASTE PERMIT NUMBER: Not reported
MUNICIPAL WASTE PERMIT NUMBER: Not reported
MAILING ADDRESS: 6216 Navigation Blvd
MAILING ADDRESS 2:
MAILING ADDRESS 3: Houston TX 77011 - 1136
MAILING COUNTRY: USA
LOCATION DESCRIPTION: 6216 Navigation, Houston, TX

OWNER INFORMATION

COMPANY or INDIVIDUAL S NAME: The Dale Company
CONTACT: Ron Russell
CONTACT PHONE: 713-928-3437
OWNER MAILING ADDRESS: 6216 Navigation Blvd
OWNER MAILING ADDRESS 2: Houston TX 77011-1136
OWNER P. O. BOX: Not reported
OWNER TELEPHONE: 713-928-3437
OWNER FAX: Not reported
OWNER EMAIL: Not reported
TYPE OF BUSINESS: Unknown

OPERATOR INFORMATION

COMPANY or INDIVIDUAL S NAME: The Dale Company
OPERATOR MAILING ADDRESS: 6216 Navigation Blvd
OPERATOR MAILING ADDRESS 2: Houston TX 77011-1136
OPERATOR TELEPHONE: 713-928-3437
OPERATOR FAX:
OPERATOR EMAIL:
TYPE OF BUSINESS: Unknown
OPERATOR TAX ID:

WASTE INFORMATION

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

HOUSTON TX 77011

CONFIRM

H40112

OTHER SITE

SEARCH ID: 24

DIST/DIR: 0.25 NW

MAP ID: 9

NAME: THE DALE COMPANY

REV: 04/04/2004

ADDRESS: 6216 NAVIGATION

ID1: IHW-81089

HOUSTON TX 77011

ID2: TXD988088159

HARRIS

STATUS: INACTIVE

CONTACT: RON RUSSELL

PHONE: 713-928-3437

TX WASTE CODE:

0501203H

WASTE CODE STATUS:

Inactive

WASTE DESCRIPTION FROM WASTE FORM: Non-halogenated solvent

GENERATOR S WASTE DESCRIPTION: Waste mineral spirits from parts washing process

PRIMARY SOURCE:

G09

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

RCRA COR SITE

SEARCH ID: 1

DIST/DIR: 0.97 NW

MAP ID: 1

NAME: PARKANS INTERNATIONAL LLC
ADDRESS: 5521 ARMOUR DR
HOUSTON TX 77020
HARRIS
CONTACT: KIRK K WEAVER

REV: 7/12/04
ID1: TXD008105959
ID2:
STATUS: CA
PHONE: 713-957-0285

SITE INFORMATION

CONTACT INFORMATION: KIRK K WEAVER
N POST OAK RD STE 525
HOUSTON TX 77024

PHONE: 713-957-0285

CONTACT INFORMATION: JEFF TANGE
PO BOX 15519
HOUSTON TX 77020

PHONE: 7136759141

UNIVERSE INFORMATION:

SNC: N - NO
BOYSNC: N - NO
GPRA PERMIT: +
GPRA POSTCLOSURE: N - NO
GPRA CA: N - NO
GPRA CME: N - NO
PERM PROG: Y - PERMITTING/CLOSURE/POS
PREM WRKLD: N - NO
CLOSURE WRKLD: N - NO
P C WRKLD: N - NO
SUBJCA: Y - SUBJECT TO CORRECTIVE ACTION
SUBJCA TSD 3004: N - NO

SUBJCA NON TSD: N - NO
CA WRKLD: N - NO
GEN STATUS: N - NO

USED OIL INFORMATION

BURNER:	N - NO	PROCESSOR:	N - NO
REFINER:	N - NO	MARKET BURNER:	N - NO
SPEC MARKETER:	N - NO	TRANSFER FAC:	N - NO
TRANSPORTER:			
BURNER:	N - NO	PROCESSOR:	
REFINER:	N - NO	MARKET BURNER:	N - NO
SPEC MARKETER:	N - NO	TRANSFER FAC:	
TRANSPORTER:			

BURNER: U - UNKNOWN

PROCESSOR: U - UNKNOWN

- Continued on next page -

Environmental FirstSearch Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

RCRA COR SITE

SEARCH ID: 1

DIST/DIR: 0.97 NW

MAP ID: 1

NAME: PARKANS INTERNATIONAL LLC
ADDRESS: 5521 ARMOUR DR
HOUSTON TX 77020
HARRIS
CONTACT: KIRK K WEAVER

REV: 7/12/04
ID1: TXD008105959
ID2:
STATUS: CA
PHONE: 713-957-0285

REFINER: U - UNKNOWN
SPEC MARKETER: U - UNKNOWN
NAIC INFORMATION

MARKET BURNER: U - UNKNOWN
TRANSFER FAC: U - U

331492 - SECONDARY SMELTING, REFINING, AND ALLOYING OF NONFERROUS METAL (EXCEPT COPPER AND ALUMINUM)
325188 - ALL OTHER BASIC INORGANIC CHEMICAL MANUFACTURING
325188 - ALL OTHER BASIC INORGANIC CHEMICAL MANUFACTURING
331492 - SECONDARY SMELTING, REFINING, AND ALLOYING OF NONFERROUS METAL (EXCEPT COPPER AND ALUMINUM)
325188 - ALL OTHER BASIC INORGANIC CHEMICAL MANUFACTURING
325188 - ALL OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

ENFORCEMENT INFORMATION:

AGENCY:	S - STATE	DATE:	8/13/1991
TYPE:	120 - WRITTEN INFORMAL		
AGENCY:	S - STATE	DATE:	5/5/1993
TYPE:	110 - VERBAL INFORMAL		
AGENCY:	S - STATE	DATE:	4/23/1992
TYPE:	110 - VERBAL INFORMAL		
AGENCY:	S - STATE	DATE:	1/19/1987
TYPE:	120 - WRITTEN INFORMAL		
AGENCY:	S - STATE	DATE:	4/14/1987
TYPE:	120 - WRITTEN INFORMAL		
AGENCY:	S - STATE	DATE:	10/30/1987
TYPE:	310 - FINAL 3008(A) COMPLIANCE ORDER		
AGENCY:	S - STATE	DATE:	8/2/1989
TYPE:	120 - WRITTEN INFORMAL		
AGENCY:	S - STATE	DATE:	7/30/1992
TYPE:	110 - VERBAL INFORMAL		
AGENCY:	S - STATE	DATE:	6/27/1994
TYPE:	120 - WRITTEN INFORMAL		
AGENCY:	S - STATE	DATE:	4/17/1996
TYPE:	120 - WRITTEN INFORMAL		
AGENCY:	S - STATE	DATE:	8/23/1989
TYPE:	120 - WRITTEN INFORMAL		
AGENCY:	S - STATE	DATE:	4/17/1995

- Continued on next page -

Environmental FirstSearch

Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

HOUSTON TX 77011

H40112

CONFIRM

RCRA COR SITE

SEARCH ID: 1

DIST/DIR: 0.97 NW

MAP ID: 1

NAME: PARKANS INTERNATIONAL LLC
ADDRESS: 5521 ARMOUR DR
 HOUSTON TX 77020
 HARRIS
CONTACT: KIRK K WEAVER

REV: 7/12/04
ID1: TXD008105959
ID2:
STATUS: CA
PHONE: 713-957-0285

TYPE:	110 - VERBAL INFORMAL		
AGENCY:	S - STATE	DATE:	5/28/1993
TYPE:	120 - WRITTEN INFORMAL		
AGENCY:	S - STATE	DATE:	8/31/1987
TYPE:	210 - INITIAL 3008(A) COMPLIANCE ORDER		
AGENCY:	S - STATE	DATE:	5/21/1992
TYPE:	120 - WRITTEN INFORMAL		

VIOLATION INFORMATION:

VIOLATION NUMBER:	0001	RESPONSIBLE:	S - STATE
DETERMINED:	7/6/1989	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	9/27/1989
TYPE:	DOR - TSD OTHER REQUIREMENTS		
VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	7/6/1989	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	9/22/1989
TYPE:	DLB - TSD LAND BAN REQUIREMENTS		
VIOLATION NUMBER:	0003	RESPONSIBLE:	S - STATE
DETERMINED:	7/6/1989	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	8/31/1989
TYPE:	SWR		
VIOLATION NUMBER:	0004	RESPONSIBLE:	S - STATE
DETERMINED:	8/1/1991	DETERMINED BY:	S - STATE
CITATION:	PPVI.B.2	RESOLVED:	9/23/1991
TYPE:	DOR - TSD OTHER REQUIREMENTS		
VIOLATION NUMBER:	0005	RESPONSIBLE:	S - STATE
DETERMINED:	8/1/1991	DETERMINED BY:	S - STATE
CITATION:	PPVI.D1&4	RESOLVED:	9/23/1991
TYPE:	DOR - TSD OTHER REQUIREMENTS		
VIOLATION NUMBER:	0006	RESPONSIBLE:	S - STATE
DETERMINED:	8/1/1991	DETERMINED BY:	S - STATE
CITATION:	PPVII.B.1/264.15D	RESOLVED:	9/23/1991
TYPE:	DOR - TSD OTHER REQUIREMENTS		
VIOLATION NUMBER:	0007	RESPONSIBLE:	S - STATE
DETERMINED:	8/1/1991	DETERMINED BY:	S - STATE
CITATION:	PPVII.B.4/264.73B1&2	RESOLVED:	9/23/1991
TYPE:	DOR - TSD OTHER REQUIREMENTS		

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

RCRA GENERATOR SITE

SEARCH ID: 3

DIST/DIR: 0.00 --

MAP ID: 5

NAME: J B SMITH MFG CO INC
ADDRESS: 6618 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: WESLEY COWAN SR

REV: 7/12/04
ID1: TXD008065880
ID2:
STATUS: SGN
PHONE: 713-928-5460

SITE INFORMATION

CONTACT INFORMATION: ELLIS R BOLLES
6618 NAVIGATION BLVD
HOUSTON TX 77011

PHONE: 7139285460

CONTACT INFORMATION: WESLEY COWAN SR
NAVIGATION BLVD
HOUSTON TX 77011

PHONE: 713-928-5460

UNIVERSE INFORMATION:

SNC: N - NO
BOYSNC: N - NO
GPRA PERMIT: N - NO
GPRA POSTCLOSURE: N - NO
GPRA CA: N - NO
GPRA CME: N - NO
PERM PROG: N - NO

SUBJCA NON TSD: N - NO
CA WRKLD: N - NO
GEN STATUS: SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000 KG/MONTH OF
HAZARDOUS WASTE

PREM WRKLD: N - NO
CLOSURE WRKLD: N - NO
P C WRKLD: N - NO
SUBJCA: N - NO
SUBJCA TSD 3004: N - NO

USED OIL INFORMATION

BURNER: N - NO
REFINER: N - NO
SPEC MARKETER: N - NO
TRANSPORTER:

PROCESSOR:
MARKET BURNER: N - NO
TRANSFER FAC:

BURNER: N - NO
REFINER: N - NO
SPEC MARKETER: N - NO

PROCESSOR: N - NO
MARKET BURNER: N - NO
TRANSFER FAC: N - NO

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

RCRA GENERATOR SITE

SEARCH ID: 3

DIST/DIR: 0.00 --

MAP ID: 5

NAME: J B SMITH MFG CO INC
ADDRESS: 6618 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: WESLEY COWAN SR

REV: 7/12/04
ID1: TXD008065880
ID2:
STATUS: SGN
PHONE: 713-928-5460

TRANSPORTER:
NAIC INFORMATION

332919 - OTHER METAL VALVE AND PIPE FITTING MANUFACTURING
332996 - FABRICATED PIPE AND PIPE FITTING MANUFACTURING

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

The following spent halogenated solvents used in degreasing: Tetrachloroethylene, trichloroethylene, methylene chloride, 1,1,1-trichloroethane, carbon tetrachloride and chlorinated fluorocarbons; all spent solvent mixtures/bl

The following spent non-halogenated solvents: toluene, methyl ethyl ketone, carbon disulfide, isobutanol, pyridine, benzene, 2-ethoxyethanol, and 2-nitropropane; all spent solvent mixtures/blends containing, before use, a to

The following spent non-halogenated solvents: Xylene, acetone, ethyl acetate, ethyl benzene, ethyl ether, methyl isobutyl ketone, n-butyl alcohol, cyclohexanone, and methanol; all spent solvent mixtures/ blends containing, b

Tetrachloroethylene
Ignitable waste
Ethene, trichloro- (OR) Trichloroethylene
Ethene, tetrachloro- (OR) Tetrachloroethylene
Benzene, methyl- (OR) Toluene
Benzene

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

RCRA GENERATOR SITE

SEARCH ID: 2

DIST/DIR: 0.02 SE

MAP ID: 2

NAME: DIESEL PUMP & INJECT OR SVC
ADDRESS: 6632 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: JEFFRY-P KELLEY

REV: 2/9/04
ID1: TXD042920421
ID2:
STATUS: SGN
PHONE: 7139212318

SITE INFORMATION

UNIVERSE TYPE:

SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000 KG/MONTH OF HAZARDOUS WASTE

SIC INFORMATION:

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

RCRA GENERATOR SITE

SEARCH ID: 6

DIST/DIR: 0.05 NW

MAP ID: 8

NAME: REEDHYCALOG LP
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: MARIO RODRIGUEZ

REV: 7/12/04
ID1: TXD008063364
ID2:
STATUS: SGN
PHONE: 713-924-5200

SITE INFORMATION

CONTACT INFORMATION: MARIO RODRIGUEZ
6501 NAVIGATION BLVD
HOUSTON TX 77011

PHONE: 7139245200

CONTACT INFORMATION: MARIO RODRIGUEZ
6501 NAVIGATION BLVD
HOUSTON TX 77011

PHONE: 7139245252

CONTACT INFORMATION: MARIO RODRIGUEZ
PO BOX 2119
HOUSTON TX 77252

PHONE: 713-924-5200

UNIVERSE INFORMATION:

SNC: N - NO
BOYSNC: N - NO
GPRA PERMIT: N - NO
GPRA POSTCLOSURE: N - NO
GPRA CA: N - NO
GPRA CME: N - NO
PERM PROG: N - NO

SUBJCA NON TSD: N - NO
CA WRKLD: N - NO
GEN STATUS: SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000 KG/MONTH OF
HAZARDOUS WASTE

PREM WRKLD: N - NO
CLOSURE WRKLD: N - NO
P C WRKLD: N - NO
SUBJCA: N - NO
SUBJCA TSD 3004: N - NO

USED OIL INFORMATION

BURNER: N - NO

PROCESSOR:

- Continued on next page -

***Environmental FirstSearch
Site Detail Report***

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

RCRA GENERATOR SITE

SEARCH ID: 5

DIST/DIR: 0.17 SW

MAP ID: 7

NAME: OMSCO INDUSTRIES

REV: 2/9/04

ADDRESS: 6418 EPERSON ST
HOUSTON TX 77261
HARRIS

ID1: TXD008098659

ID2:

CONTACT: PATRICIA VINSON

STATUS: SGN

PHONE: 7139267401

SITE INFORMATION

UNIVERSE TYPE:

SQG - SMALL QUANTITY GENERATOR: GENERATES 100 - 1000 KG/MONTH OF HAZARDOUS WASTE

SIC INFORMATION:

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

RCRA GENERATOR SITE

SEARCH ID: 4

DIST/DIR: 0.22 NW

MAP ID: 6

NAME: NEW TECH ROCK BIT
ADDRESS: 6230 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: RODNEY BARNES

REV: 2/9/04
ID1: TXD987997327
ID2:
STATUS: VGN
PHONE: 7139217485

SITE INFORMATION

UNIVERSE TYPE:

CEG - CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS: GENERATES LESS THAN 100 KG/MONTH OF HAZARDOUS WASTE

SIC INFORMATION:

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

***Environmental FirstSearch
Site Detail Report***

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

RCRA GENERATOR SITE

SEARCH ID: 7

DIST/DIR: 0.25 NW

MAP ID: 9

NAME: THE DALE CO
ADDRESS: 6216 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: RON RUSSELL

REV: 2/9/04
ID1: TXD988088159
ID2:
STATUS: VGN
PHONE: 7139283437

SITE INFORMATION:

UNIVERSE TYPE:

CEG - CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS: GENERATES LESS THAN 100 KG/MONTH OF HAZARDOUS WASTE

SIC INFORMATION:

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

Environmental FirstSearch Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

HOUSTON TX 77011

H40112

CONFIRM

RCRA GENERATOR SITE

SEARCH ID: 6

DIST/DIR: 0.05 NW

MAP ID: 8

NAME: REEDHYCALOG LP
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: MARIO RODRIGUEZ

REV: 7/12/04
ID1: TXD008063364
ID2:
STATUS: SGN
PHONE: 713-924-5200

REFINER: N - NO
SPEC MARKETER: N - NO
TRANSPORTER:

MARKET BURNER: N - NO
TRANSFER FAC:

BURNER: N - NO
REFINER: N - NO
SPEC MARKETER: N - NO
TRANSPORTER:

PROCESSOR: N - NO
MARKET BURNER: N - NO
TRANSFER FAC: N - NO

BURNER: U - UNKNOWN
REFINER: U - UNKNOWN
SPEC MARKETER: U - UNKNOWN

PROCESSOR: U - UNKNOWN
MARKET BURNER: U - UNKNOWN
TRANSFER FAC: U - U

NAIC INFORMATION

333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333131 - MINING MACHINERY AND EQUIPMENT MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333993 - PACKAGING MACHINERY MANUFACTURING
33312 - CONSTRUCTION MACHINERY MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
33312 - CONSTRUCTION MACHINERY MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333132 - OIL AND GAS FIELD MACHINERY AND EQUIPMENT MANUFACTURING
333131 - MINING MACHINERY AND EQUIPMENT MANUFACTURING
333993 - PACKAGING MACHINERY MANUFACTURING

ENFORCEMENT INFORMATION:

AGENCY: S - STATE **DATE:** 11/14/1984
TYPE: 120 - WRITTEN INFORMAL

AGENCY: S - STATE **DATE:** 11/14/1984
TYPE: 120 - WRITTEN INFORMAL

AGENCY: S - STATE **DATE:** 12/1/1993
TYPE: 120 - WRITTEN INFORMAL

VIOLATION INFORMATION:

VIOLATION NUMBER: 0001 **RESPONSIBLE:** S - STATE
DETERMINED: 6/14/1984 **DETERMINED BY:** S - STATE

- Continued on next page -

Environmental FirstSearch

Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

RCRA GENERATOR SITE

SEARCH ID: 6

DIST/DIR: 0.05 NW

MAP ID: 8

NAME: REEDHYCALOG LP
ADDRESS: 6501 NAVIGATION BLVD
 HOUSTON TX 77011
 HARRIS
CONTACT: MARIO RODRIGUEZ

REV: 7/12/04
ID1: TXD008063364
ID2:
STATUS: SGN
PHONE: 713-924-5200

CITATION:		RESOLVED:	5/31/1985
TYPE:	—	GOR - GENERATOR OTHER REQUIREMENTS	
VIOLATION NUMBER:	0002	RESPONSIBLE:	S - STATE
DETERMINED:	6/14/1984	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	5/31/1985
TYPE:		GOR - GENERATOR OTHER REQUIREMENTS	
VIOLATION NUMBER:	0003	RESPONSIBLE:	S - STATE
DETERMINED:	6/14/1984	DETERMINED BY:	S - STATE
CITATION:		RESOLVED:	11/2/1993
TYPE:		GOR - GENERATOR OTHER REQUIREMENTS	
VIOLATION NUMBER:	0004	RESPONSIBLE:	S - STATE
DETERMINED:	11/2/1993	DETERMINED BY:	S - STATE
CITATION:	335.62/262.11	RESOLVED:	3/11/1994
TYPE:		GOR - GENERATOR OTHER REQUIREMENTS	
VIOLATION NUMBER:	0005	RESPONSIBLE:	S - STATE
DETERMINED:	11/2/1993	DETERMINED BY:	S - STATE
CITATION:	335.6c	RESOLVED:	3/11/1994
TYPE:	SWR		
VIOLATION NUMBER:	0006	RESPONSIBLE:	S - STATE
DETERMINED:	11/2/1993	DETERMINED BY:	S - STATE
CITATION:	335.13g	RESOLVED:	3/11/1994
TYPE:	SMR		
VIOLATION NUMBER:	0007	RESPONSIBLE:	S - STATE
DETERMINED:	11/2/1993	DETERMINED BY:	S - STATE
CITATION:	335.9a1g	RESOLVED:	3/11/1994
TYPE:	SWR		
VIOLATION NUMBER:	0008	RESPONSIBLE:	S - STATE
DETERMINED:	11/2/1993	DETERMINED BY:	S - STATE
CITATION:	335.10g22	RESOLVED:	3/11/1994
TYPE:	SMR		
VIOLATION NUMBER:	0009	RESPONSIBLE:	S - STATE
DETERMINED:	11/2/1993	DETERMINED BY:	S - STATE
CITATION:	335.69a2/262.34a2	RESOLVED:	3/11/1994
TYPE:		GOR - GENERATOR OTHER REQUIREMENTS	
VIOLATION NUMBER:	0010	RESPONSIBLE:	S - STATE
DETERMINED:	11/2/1993	DETERMINED BY:	S - STATE
CITATION:	335.69a3/262.34a3	RESOLVED:	3/11/1994
TYPE:		GOR - GENERATOR OTHER REQUIREMENTS	
VIOLATION NUMBER:	0011	RESPONSIBLE:	S - STATE

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

STATE SITE

SEARCH ID: 9

DIST/DIR: 0.40 NW

MAP ID: 4

NAME: FOSTER PRODUCTS CORPORATION
ADDRESS: 6107 INDUSTRIAL WAY
HOUSTON TX
HARRIS
CONTACT:

REV: 03/24/2004
ID1: 0989
ID2:
STATUS: INVESTIGATION
PHONE:

VOLUNTARY CLEANUP PROGRAM SITE DETAILS

OTHER SITE IDENTIFIERS

PROGRAM COST ACCT NUMBER: 31889
TCEQ SWR NUMBER: 31677
LPST NUMBER:
EPA TX ID/CERCLIS ID: TXD080853625
EPA REGISTRATION NUMBER:

SITE INFORMATION

VCP APP RECEIVED: 6/9/1999
LEAD TYPE: Owner
PROJECT MANAGER: Wehner
FACILITY TYPE: Industrial Pipe Coating/Tank Insulation
CONTAMINANT CATEGORIES:
MEDIA AFFECTED:
SIZE OF FACILITY: 4acres

AGREEMENT DETAILS

AGREEMENT DATE: 8/18/1999
RULES - RISK REDUCTION OR PST: RRR
RISK REDUCT 1, 2, 3, & PLAN A OR B: 3
CERT ISSUED DATE:
TYPE OF CERT:
TYPE OF REMEDY:

VCP APPLICANT INFORMATION

APP COMPANY: Foster Products Corporation
APP CONTACT: Paul Clauss, III
APP TITLE: Plant Manager
APP ADDRESS: 6107 Industrial Way
APP ADDRESS2: Houston, TX 77011
APP PHONE: 713-926-3125
APP FAX: 713-926-8908

APPLICANT ATTORNEY/CONSULTANT INFORMATION

ATTY/CONS COMPANY: ENSR Corporation
ATTY/CONS CONTACT: John Cuddihee
ATTY/CONS TITLE: Senior Project Manager
ATTY/CONS ADDRESS: 12201 Merit Drive
APP ADDRESS2: Dallas, TX 75251
ATTY/CONS PHONE: 972-341-1466

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

STATE SITE

SEARCH ID: 12

DIST/DIR: 0.40 NW

MAP ID: 3

NAME: UNOCCUPIED INDUSTRIAL SITE (FONTENOT)
ADDRESS: 6125 INDUSTRIAL WAY
HOUSTON TX
HARRIS
CONTACT:

REV: 03/24/2004
ID1: 0401
ID2:
STATUS: INVESTIGATION
PHONE:

VOLUNTARY CLEANUP PROGRAM SITE DETAILS

OTHER SITE IDENTIFIERS

PROGRAM COST ACCT NUMBER: 38311
TCEQ SWR NUMBER:
LPST NUMBER: 111481
EPA TX ID/CERCLIS ID: 0019671
EPA REGISTRATION NUMBER:

SITE INFORMATION

VCP APP RECEIVED: 11/14/1996
LEAD TYPE: Owner
PROJECT MANAGER: Wehner
FACILITY TYPE: Sandblasting and Painting Operations
CONTAMINANT CATEGORIES: VOCs, Metals
MEDIA AFFECTED: Soils/Groundwater
SIZE OF FACILITY: 4.739acres

AGREEMENT DETAILS

AGREEMENT DATE: 2/24/1997
RULES - RISK REDUCTION OR PST: RRR
RISK REDUCT 1, 2, 3, & PLAN A OR B: 2/3
CERT ISSUED DATE:
TYPE OF CERT:
TYPE OF REMEDY:

VCP APPLICANT INFORMATION

APP COMPANY: Fairfield Financial Group, Inc.
APP CONTACT: J. Rick Renshaw, Esq.
APP TITLE: Attorney
APP ADDRESS: 8 Greenway Plaza, Suite 1100
APP ADDRESS2: Houston, TX 77046
APP PHONE: 713-871-2080
APP FAX: 713-871-2087

APPLICANT ATTORNEY/CONSULTANT INFORMATION

ATTY/CONS COMPANY: Gilpin, Paxson & Bersch, L.L.P.
ATTY/CONS CONTACT: Mary Wilson
ATTY/CONS TITLE: Attorney
ATTY/CONS ADDRESS: 1900 West Loop South, Suite 2000
APP ADDRESS2: Houston, TX 77027
ATTY/CONS PHONE: 713-623-8800

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

STATE SITE

SEARCH ID: 10

DIST/DIR: 0.61 NW

MAP ID: 11

NAME: METAL PREP
ADDRESS: 501 NORTH GREENWOOD STREET
HOUSTON TX
Harris

REV: 03/24/2004
ID1: 1674
ID2:
STATUS: INVESTIGATION
PHONE:

CONTACT:

VOLUNTARY CLEANUP PROGRAM SITE DETAILS

OTHER SITE IDENTIFIERS

PROGRAM COST ACCT NUMBER: 33874
TCEQ SWR NUMBER: 38091
LPST NUMBER:
EPA TX ID/CERCLIS ID: TXD065102105
EPA REGISTRATION NUMBER:

SITE INFORMATION

VCP APP RECEIVED: 1/13/2004
LEAD TYPE: Owner
PROJECT MANAGER: Lewis
FACILITY TYPE: Metal Coil Coater
CONTAMINANT CATEGORIES: Metals, PCBs
MEDIA AFFECTED: Soils
SIZE OF FACILITY: 14acres

AGREEMENT DETAILS

AGREEMENT DATE: 1/22/2004
RULES - RISK-REDUCTION OR PST: TRRP
RISK REDUCT 1, 2, 3, & PLAN A OR B: B
CERT ISSUED DATE:
TYPE OF CERT:
TYPE OF REMEDY:

VCP APPLICANT INFORMATION

APP COMPANY: Metal Prep
APP CONTACT: Todd Moore
APP TITLE: Vice President/General Counsel
APP ADDRESS: 10943 North Sam Houston Parkway West
APP ADDRESS2: Houston, TX 77064
APP PHONE: 281-897-7788
APP FAX: 281-447-9646

APPLICANT ATTORNEY/CONSULTANT INFORMATION

ATTY/CONS COMPANY: Richie & Gueringer, PC
ATTY/CONS CONTACT: Sheldon Richie
ATTY/CONS TITLE: Attorney
ATTY/CONS ADDRESS: 100 Congress Avenue, Suite 1750
APP ADDRESS2: Austin, TX 78701
ATTY/CONS PHONE: 512-236-9220

Environmental FirstSearch Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

STATE SITE

SEARCH ID: 8

DIST/DIR: 0.82 SE

MAP ID: 10

NAME: AMERICANOS USA
ADDRESS: 7004 HARRISBURG BOULEVARD
HOUSTON TX
HARRIS
CONTACT:

REV: 03/24/2004
ID1: IOP-0268
ID2:
STATUS: COMPLETED
PHONE:

INNOCENT OWNER/OPERATOR PROGRAM SITE DETAILS

OTHER SITE IDENTIFIERS

VOLUNTARY CLEANUP PROGRAM ID:
TCEQ SWR No:
LPST REGISTRATION No:
EPA TEXAS ID/CERCLIS No:

SITE INFORMATION

DATE IOP APP RECEIVED: 10/1/2001
INTEREST IN SITE: Owner
PROPERTY USE: Bus Terminal
DATE CERTIFICATION ISSUED: 2/6/2002
TYPE OF CONTROL:
PROJECT MANAGER: Layou
CONTAMINANT CATEGORIES: VOCs, TPH, MTBE
MEDIA AFFECTED: Groundwater
SIZE OF FACILITY: acres

IOP APPLICANT INFORMATION

APP COMPANY: Americanos USA
APP CONTACT: Al Penedo
APP TITLE: Vice President
APP ADDRESS: 802 Commerce Street
APP ADDRESS2: Dallas, TX 75202
APP PHONE: 214-849-8616 (Phone)
APP FAX: 214-653-9354 (Fax)

APPLICANT ATTORNEY/CONSULTANT INFORMATION

ATTY/CONS COMPANY: Green Star Environmental
ATTY/CONS CONTACT: Leonard Albright
ATTY/CONS TITLE: Principal
ATTY/CONS ADDRESS: 354 McDonnell Street, Suite 9
ATTY/CONS ADDRESS2: Lewisville, TX 75057
ATTY/CONS PHONE: 214-222-8752 (Phone)
ATTY/CONS FAX: 214-222-8762 (Fax)

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

STATE SITE

SEARCH ID: 11

DIST/DIR: 0.83 NW

MAP ID: 12

NAME: PENTRON INCORPORATED
ADDRESS: 323 AVENUE J
HOUSTON TX
HARRIS

REV: 03/24/2004
ID1: 0281
ID2:
STATUS: COMPLETED
PHONE:

CONTACT:

VOLUNTARY CLEANUP PROGRAM SITE DETAILS

OTHER SITE IDENTIFIERS

PROGRAM COST ACCT NUMBER: 38191
TCEQ SWR NUMBER:
LPST NUMBER:
EPA TX ID/CERCLIS ID:
EPA REGISTRATION NUMBER:

SITE INFORMATION

VCP APP RECEIVED: 6/25/1996
LEAD TYPE: Owner
PROJECT MANAGER: Frew
FACILITY TYPE: Automotive Service Bay Area
CONTAMINANT CATEGORIES: Petroleum Hydrocarbons
MEDIA AFFECTED: Soils/Groundwater
SIZE OF FACILITY: 1.3774acres

AGREEMENT DETAILS

AGREEMENT DATE: 4/15/1997
RULES - RISK REDUCTION OR PST: RRR
RISK REDUCT 1, 2, 3, & PLAN A OR B: 2
CERT ISSUED DATE: 6/3/1998
TYPE OF CERT: Final
TYPE OF REMEDY:

VCP APPLICANT INFORMATION

APP COMPANY: Polar Tank Trailer, Inc.
APP CONTACT: Milt Faries
APP TITLE: Director of Manufacturing
APP ADDRESS: 12810 Country Road 17
APP ADDRESS2: Holdingford, MN 56340
APP PHONE: 320-746-2255
APP FAX: 320-746-2937

APPLICANT ATTORNEY/CONSULTANT INFORMATION

ATTY/CONS COMPANY: Delta Environmental Consultants
ATTY/CONS CONTACT: Sandra S. Brown
ATTY/CONS TITLE: Project Manager
ATTY/CONS ADDRESS: 1400 Broadfield Boulevard, Suite 115
APP ADDRESS2: Houston, TX 77084
ATTY/CONS PHONE: 713-647-6263

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 27

DIST/DIR: 0.02 SE

MAP ID: 25

NAME: J B SMITH MFG CO
ADDRESS: 6618 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: SMITH, JAN P.

REV: 04/02/04
ID1: 0049360
ID2:
STATUS:
PHONE: 7139285711

FACILITY INFORMATION:

NUMBER OF USTS ON SITE: 0002
NUMBER OF ASTS ON SITE: 0000
TNRCC FACILITY ID: 0049360
TNRCC CUSTOMER ID: 25897
FACILITY TYPE:
FACILITY MANAGER: SMITH, JAN P. PRESIDENT
MANAGER PHONE: 7139285711

OWNER INFORMATION

TYPE: Private or Corporation
COMPANY: J B SMITH MFG CO
ADDRESS: 6618 NAVIGATION
HOUSTON TX 77011-
PO BOX:
CONTACT:
CONTACT PHONE: 7139285711
AMENDMENTS: Unknown Migration Data

UST INFORMATION (tank information)

TANK NUMBER: 1
STATUS: Perm. Filled in Place
STATUS DATE: 123173
INSTALL DATE: 010169
REGISTERED DATE: 103189
CAPACITY: 0008000 Gallons
EXT CONTAINMENT DESIGN: -
CONSTRUCTION MATERIAL: -
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:

- Continued on next page -

**Environmental FirstSearch
Site Detail Report**

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 27

DIST/DIR: 0.02 SE

MAP ID: 25

NAME: J B SMITH MFG CO
ADDRESS: 6618 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: SMITH, JAN P.

REV: 04/02/04
ID1: 0049360
ID2:
STATUS:
PHONE: 7139285711

PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Unknown
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 2
STATUS: Perm. Filled in Place
STATUS DATE: 072598
INSTALL DATE: 010168
REGISTERED DATE: 103189
CAPACITY: 0005000 Gallons
EXT CONTAINMENT DESIGN: -

CONSTRUCTION MATERIAL: -
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 31

DIST/DIR: 0.03 NW

MAP ID: 30

NAME: REED TOOL COMPANY
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: MERCER

REV: 04/02/04
ID1: 0018753
ID2:
STATUS:
PHONE: 713-924-5200

FACILITY INFORMATION:

NUMBER OF USTS ON SITE: 0016
NUMBER OF ASTS ON SITE: 0000
TNRCC FACILITY ID: 0018753
TNRCC CUSTOMER ID: 18120
FACILITY TYPE: Industrial / Chemical / OR mfg Plant
FACILITY MANAGER: Mercer
MANAGER PHONE: 713-924-5200

OWNER INFORMATION

TYPE: Corporation
COMPANY: REED TOOL COMPANY
ADDRESS: 7030 ARDMORE St
HOUSTON TX 77054-
PO BOX:
CONTACT: Susan Kalkan
CONTACT PHONE: 713-749-5602
AMENDMENTS: Unknown Migration Data

UST INFORMATION (tank information)

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 090189
INSTALL DATE: 010157
REGISTERED DATE: 050886
CAPACITY: 0004000 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 31

DIST/DIR: 0.03 NW

MAP ID: 30

NAME: REED TOOL COMPANY
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: MERCER

REV: 04/02/04
ID1: 0018753
ID2:
STATUS:
PHONE: 713-924-5200

PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Naphtha
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 8
STATUS: Removed From Ground
STATUS DATE: 030190
INSTALL DATE: 010184
REGISTERED DATE: 050886
CAPACITY: 0008000 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
-
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Methanol
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 31

DIST/DIR: 0.03 NW

MAP ID: 30

NAME: REED TOOL COMPANY
ADDRESS: 6501 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: MERCER

REV: 04/02/04
ID1: 0018753
ID2:
STATUS:
PHONE: 713-924-5200

SPILL/OVERFILL PREVENTION:

SPILL/OVERFILL VARIANCE: - -
No Variance

TANK NUMBER:

7

STATUS:

Removed From Ground

STATUS DATE:

090189

INSTALL DATE:

010182

REGISTERED DATE:

050886

CAPACITY:

0008000 Gallons

EXT CONTAINMENT DESIGN:

-

CONSTRUCTION MATERIAL:

Steel

CORROSION PROTECTION:

-

CORROSION PROT VARIANCE:

No Variance

STG 1 VAPOR RECOVERY EQUIP STATUS:

Not Reported

STG 1 EQUIP INSTALL DATE:

STG 2 VAPOR RECOVERY EQUIP STATUS:

STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:

INSTALLER NAME:

INSTALLER LICENSE NUMBER:

TYPE OF PIPE:

PIPE MATERIAL:

Steel

PIPE DESIGN EXT CONTAINMENT:

-

PIPE CONECTORS & VALVES:

-

PIPE CORROSION PROTECTION:

-

PIPE CORROSION PROT VARIANCE:

- None

No Variance

SUBSTANCE STORED:

Empty

TANK RLSE DETECTION METHODS:

- - - None

TANK RLSE DETECTION VARIANCE:

No Variance

PIPE RLSE DETECTION METHODS:

- - - None

PIPE RLSE VARIANCE:

No Variance

SPILL/OVERFILL PREVENTION:

-

SPILL/OVERFILL VARIANCE:

No Variance

TANK NUMBER:

6

STATUS:

Removed From Ground

STATUS DATE:

090189

INSTALL DATE:

010182

REGISTERED DATE:

050886

CAPACITY:

0004000 Gallons

EXT CONTAINMENT DESIGN:

-

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 30

DIST/DIR: 0.14 NW

MAP ID: 29

NAME: PLOWDEN SUPPLY CO
ADDRESS: 6300 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: DATE ENTERED:

REV: 04/02/04
ID1: 0057353
ID2:
STATUS:
PHONE: 7139283311

FACILITY INFORMATION:

NUMBER OF USTS ON SITE: 0001
NUMBER OF ASTS ON SITE: 0000
TNRCC FACILITY ID: 0057353
TNRCC CUSTOMER ID: 32201
FACILITY TYPE:
FACILITY MANAGER: DATE ENTERED: PRES
MANAGER PHONE: 7139283311

OWNER INFORMATION

TYPE: Private or Corporation
COMPANY: PLOWDEN SUPPLY CO
ADDRESS: 6300 NAVIGATION BLVD
HOUSTON TX 77011-
PO BOX:
CONTACT: G F MURPHY
CONTACT PHONE: 7139283311
AMENDMENTS: No Amendment

UST INFORMATION (tank information)

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 032091
INSTALL DATE:
REGISTERED DATE: 011591
CAPACITY: 0000000 Gallons
EXT CONTAINMENT DESIGN: -
CONSTRUCTION MATERIAL: Fiberglass Reinforced Plastic (FRP)
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Fiberglass Reinforced Plastic (FRP)

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 30

DIST/DIR: 0.14 NW

MAP ID: 29

NAME: PLOWDEN SUPPLY CO
ADDRESS: 6300 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS

REV: 04/02/04
ID1: 0057353
ID2:
STATUS:
PHONE: 7139283311

CONTACT: DATE ENTERED:

PIPE DESIGN EXT CONTAINMENT:	-
PIPE CONECTORS & VALVES:	- -
PIPE CORROSION PROTECTION:	-
	- None
PIPE CORROSION PROT VARIANCE:	No Variance
SUBSTANCE STORED:	GASOLINE
TANK RLSE DETECTION METHODS:	- - - None
TANK RLSE DETECTION VARIANCE:	No Variance
PIPE RLSE DETECTION METHODS:	- - - None
PIPE RLSE VARIANCE:	No Variance
SPILL/OVERFILL PREVENTION:	- -
SPILL/OVERFILL VARIANCE:	No Variance

AST INFORMATION

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 29

DIST/DIR: 0.14 SW

MAP ID: 28

NAME: OMSCO INDUSTRIES INC
ADDRESS: 6418 ESPERSON ST
HOUSTON TX 77011
HARRIS
CONTACT: TETENS, RICHARD

REV: 04/02/04
ID1: 0048204
ID2:
STATUS:
PHONE: 7139267401

FACILITY INFORMATION:

NUMBER OF USTS ON SITE: 0002
NUMBER OF ASTS ON SITE: 0000
TNRCC FACILITY ID: 0048204
TNRCC CUSTOMER ID: 24757
FACILITY TYPE:
FACILITY MANAGER: TETENS, RICHARD VICE PRESIDENT
MANAGER PHONE: 7139267401

OWNER INFORMATION

TYPE: Corporation
COMPANY: OMSCO INDUSTRIES INC
ADDRESS: 6418 ESPERSON ST
HOUSTON TX 77011-
PO BOX:
CONTACT:
CONTACT PHONE: 713-926-7401
AMENDMENTS: Owner Name Changed

UST INFORMATION (tank information)

TANK NUMBER: 2
STATUS: Removed From Ground
STATUS DATE: 061496
INSTALL DATE: 010182
REGISTERED DATE: 041189
CAPACITY: 0004000 Gallons
EXT CONTAINMENT DESIGN: -
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Steel

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 29

DIST/DIR: 0.14 SW

MAP ID: 28

NAME: OMSCO INDUSTRIES INC
ADDRESS: 6418 ESPERSON ST
HOUSTON TX 77011
HARRIS
CONTACT: TETENS, RICHARD

REV: 04/02/04
ID1: 0048204
ID2:
STATUS:
PHONE: 7139267401

PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: GASOLINE
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 061496
INSTALL DATE: 010179
REGISTERED DATE: 041189
CAPACITY: 0000500 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
-
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: DIESEL
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 26

DIST/DIR: 0.19 NW

MAP ID: 24

NAME: HUGHES DRILLING EQUIPMENT
ADDRESS: 6247 NAVIGATION
HOUSTON TX 77001
HARRIS
CONTACT: C.T. BOTHWELL

REV: 04/02/04
ID1: 0024095
ID2:
STATUS:
PHONE: 7132220686

FACILITY INFORMATION:

NUMBER OF USTS ON SITE: 0002
NUMBER OF ASTS ON SITE: 0000
TNRCC FACILITY ID: 0024095
TNRCC CUSTOMER ID: 12078
FACILITY TYPE:
FACILITY MANAGER: C.T. BOTHWELL MGR.
MANAGER PHONE: 7132220686

OWNER INFORMATION

TYPE: Private or Corporation
COMPANY: HUGHES DRILLING EQUIPMENT
ADDRESS: 6247 NAVIGATION
HOUSTON TX 77001-
PO BOX:
CONTACT:
CONTACT PHONE: 7132220686
AMENDMENTS: Owner Billing Address Changed

UST INFORMATION (tank information)

TANK NUMBER: 1
STATUS: Perm. Filled in Place
STATUS DATE: 083187
INSTALL DATE: 010174
REGISTERED DATE: 050886
CAPACITY: 0000500 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 26

DIST/DIR: 0.19 NW

MAP ID: 24

NAME: HUGHES DRILLING EQUIPMENT
ADDRESS: 6247 NAVIGATION
HOUSTON TX 77001
HARRIS
CONTACT: C.T. BOTHWELL

REV: 04/02/04
ID1: 0024095
ID2:
STATUS:
PHONE: 7132220686

PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Empty
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 2
STATUS: Perm. Filled in Place
STATUS DATE: 083187
INSTALL DATE: 010174
REGISTERED DATE: 050886
CAPACITY: 0000500 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Empty
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 28

DIST/DIR: 0.21 NW

MAP ID: 27

NAME: NATIONAL SUPPLY CO DIV OF ARMCO
ADDRESS: 6229 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: C. FREIDRECH

REV: 04/02/04
ID1: 0017416
ID2:
STATUS:
PHONE: 7139246248

FACILITY INFORMATION:

NUMBER OF USTS ON SITE: 0002
NUMBER OF ASTS ON SITE: 0000
TNRCC FACILITY ID: 0017416
TNRCC CUSTOMER ID: 08651
FACILITY TYPE:
FACILITY MANAGER: C. FREIDRECH MGR
MANAGER PHONE: 7139246248

OWNER INFORMATION

TYPE: Corporation
COMPANY: NATIONAL SUPPLY CO DIV OF ARMCO
ADDRESS: 703 CURTIS ST
MIDDLETOWN OH 45043-
PO BOX:
CONTACT:
CONTACT PHONE: 7139844096
AMENDMENTS: Owner Name Changed

UST INFORMATION (tank information)

TANK NUMBER: 1
STATUS: Removed From Ground
STATUS DATE: 071687
INSTALL DATE: 010176
REGISTERED DATE: 080686
CAPACITY: 0003000 Gallons
EXT CONTAINMENT DESIGN: -
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Steel

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 28

DIST/DIR: 0.21 NW

MAP ID: 27

NAME: NATIONAL SUPPLY CO DIV OF ARMCO
ADDRESS: 6229 NAVIGATION BLVD
HOUSTON TX 77011
HARRIS
CONTACT: C. FREIDRECH

REV: 04/02/04
ID1: 0017416
ID2:
STATUS:
PHONE: 7139246248

PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Empty
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 2
STATUS: Removed From Ground
STATUS DATE: 071687
INSTALL DATE: 010176
REGISTERED DATE: 080686
CAPACITY: 0000500 Gallons
EXT CONTAINMENT DESIGN: -
-
CONSTRUCTION MATERIAL: Steel
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL: Steel
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Empty
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION, TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 25

DIST/DIR: 0.21 SE

MAP ID: 23

NAME: HOUSTON KEG SALES
ADDRESS: 6739 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: JOHN CARPENTER

REV: 04/02/04
ID1: 0044585
ID2:
STATUS:
PHONE: 7139264730

FACILITY INFORMATION:

NUMBER OF USTS ON SITE: 0006
NUMBER OF ASTS ON SITE: 0000
TNRCC FACILITY ID: 0044585
TNRCC CUSTOMER ID: 20898
FACILITY TYPE:
FACILITY MANAGER: JOHN CARPENTER OWNER
MANAGER PHONE: 7139264730

OWNER INFORMATION

TYPE: Private or Corporation
COMPANY: HOUSTON KEG SALES
ADDRESS: 213 W SOUTHMORE
PASADENA TX 77502-
PO BOX:
CONTACT:
CONTACT PHONE: 713-472-2401
AMENDMENTS: Owner Contact Changed

UST INFORMATION (tank information)

TANK NUMBER: 1
STATUS: Perm. Filled in Place
STATUS DATE: 083187
INSTALL DATE: 083187
REGISTERED DATE: 102986
CAPACITY: 0002000 Gallons
EXT CONTAINMENT DESIGN: -
CONSTRUCTION MATERIAL: -
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB: H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 25

DIST/DIR: 0.21 SE

MAP ID: 23

NAME: HOUSTON KEG SALES
ADDRESS: 6739 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: JOHN CARPENTER

REV: 04/02/04
ID1: 0044585
ID2:
STATUS:
PHONE: 7139264730

PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance
SUBSTANCE STORED: Unknown
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 3
STATUS: Perm. Filled in Place
STATUS DATE: 083187
INSTALL DATE: 083187
REGISTERED DATE: 102986
CAPACITY: 0002000 Gallons
EXT CONTAINMENT DESIGN: -

CONSTRUCTION MATERIAL: -
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: Unknown
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance

- Continued on next page -

Environmental FirstSearch
Site Detail Report

TARGET SITE: NAVIGATION , TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

REGISTERED UNDERGROUND STORAGE TANKS

SEARCH ID: 25

DIST/DIR: 0.21 SE

MAP ID: 23

NAME: HOUSTON KEG SALES
ADDRESS: 6739 NAVIGATION
HOUSTON TX 77011
HARRIS
CONTACT: JOHN CARPENTER

REV: 04/02/04
ID1: 0044585
ID2:
STATUS:
PHONE: 7139264730

SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: — No Variance

TANK NUMBER: 2
STATUS: Perm. Filled in Place
STATUS DATE: 083187
INSTALL DATE: 083187
REGISTERED DATE: 102986
CAPACITY: 0002000 Gallons
EXT CONTAINMENT DESIGN: -

CONSTRUCTION MATERIAL: -
CORROSION PROTECTION: -
- None
CORROSION PROT VARIANCE: No Variance
STG 1 VAPOR RECOVERY EQUIP STATUS: Not Reported
STG 1 EQUIP INSTALL DATE:
STG 2 VAPOR RECOVERY EQUIP STATUS:
STG 2 EQUIP INSTALL DATE:

INSTALLER COMPANY:
INSTALLER NAME:
INSTALLER LICENSE NUMBER:

TYPE OF PIPE:
PIPE MATERIAL:
PIPE DESIGN EXT CONTAINMENT: -
PIPE CONECTORS & VALVES: - -
PIPE CORROSION PROTECTION: -
- None
PIPE CORROSION PROT VARIANCE: No Variance

SUBSTANCE STORED: Unknown
TANK RLSE DETECTION METHODS: - - - None
TANK RLSE DETECTION VARIANCE: No Variance
PIPE RLSE DETECTION METHODS: - - - None
PIPE RLSE VARIANCE: No Variance
SPILL/OVERFILL PREVENTION: - -
SPILL/OVERFILL VARIANCE: No Variance

TANK NUMBER: 5
STATUS: Perm. Filled in Place
STATUS DATE: 083187
INSTALL DATE: 083187
REGISTERED DATE: 102986
CAPACITY: 0002000 Gallons
EXT CONTAINMENT DESIGN: -

- More Details Exist For This Site; Max Page Limit Reached -

Environmental FirstSearch
Street Name Report for Streets within 1 Mile(s) of Target Property

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

Street Name	Dist/Dir	Street Name	Dist/Dir
69th St	0.67 NE	N 71st St	0.68 SE
Adams St	0.92 NW	N 72nd St	0.85 SE
Altic St	0.68 SW	N Adams St	0.87 NW
American Dr	1.00 NW	N Bryan St	0.92 NW
Armour Dr	0.77 N-	N Capitol St	0.87 SW
Avenue B	0.54 SW	N Delmar St	0.71 NW
Avenue C	0.51 SW	N Edgewood St	0.83 NW
Avenue E	0.40 SW	N Greenwood St	0.35 NW
Avenue F	0.35 SW	N Latham St	0.59 SW
Avenue H	0.25 SW	N Lenox St	0.75 NW
Avenue I	0.20 SW	N Norwood St	0.48 SW
Avenue J	0.15 SW	N Stiles St	0.97 NW
Avenue K	0.10 SW	Navigation Blvd	0.00 --
Avenue L	0.06 SW	Neuhaus St	0.85 NE
Avenue N	0.04 NE	NORTH 65th St	0.31 SW
Avenue O	0.09 NE	NORTH 66th St	0.11 SW
Avenue P	0.15 NE	NORTH 67th St	0.16 SE
Avenue Q	0.20 NE	NORTH 70th St	0.53 SE
Avenue R	0.24 NE	NORTH 71st St	0.68 SE
Avenue S	0.30 NE	NORTH 72nd St	0.85 SE
Avenue T	0.34 NE	NORTH Adams St	0.87 NW
Avenue U	0.40 NE	NORTH Bryan St	0.92 NW
Avenue V	0.45 NE	NORTH Capitol St	0.87 SW
Avenue W	0.49 NE	NORTH Delmar St	0.71 NW
Barziza St	0.68 SW	NORTH Edgewood St	0.83 NW
Baywood	0.65 NW	NORTH Greenwood St	0.35 NW
Brady St	0.37 SW	NORTH Latham St	0.59 SW
Bryan St	0.98 NW	NORTH Lenox St	0.75 NW
Canal St	0.30 SW	NORTH Norwood St	0.48 SW
Capitol St	0.70 SW	NORTH Stiles St	0.97 NW
Caylor St	0.38 SW	Norwood St	0.53 SW
Clifton St	0.58 SW	Oldham St	0.32 SW
Clinton Dr	0.89 NE	Polk Ave	0.90 SW
Cowling St	0.71 SW	Portwood St	0.56 NW
Delmar St	0.73 SW	Rosebud St	1.00 SW
E Hedrick St	0.82 SE	Rusk St	0.79 SW
EAST Hedrick St	0.82 SE	S 65th St	0.61 SW
Edgewood St	0.87 SW	S 66th St	0.61 SW
Emite Ct	0.68 SW	S 67th St	0.62 SW
Engle St	0.78 NW	S 69th St	0.73 SE
Esperson St	0.10 SW	S 70th St	0.80 SE
Garrow St	0.57 SW	S 71st St	0.92 SE
Gazin St	0.79 NE	S Sgt Macario Garcia	0.41 SE
Greenwood St	0.44 SW	S Wayside Dr	0.28 SE
Harrisburg Blvd	0.61 SW	Shadyview St	0.51 SW
Harvey Wilson Dr	0.87 N-	Sherman St	0.45 SW
Houston Harbor Blvd	0.88 NE	SOUTH 65th St	0.61 SW
Hughes St	0.63 SW	SOUTH 66th St	0.61 SW

Environmental FirstSearch
Street Name Report for Streets within 1 Mile(s) of Target Property

TARGET SITE: NAVIGATION, TERMINA

JOB:

H40112

HOUSTON TX 77011

CONFIRM

Street Name	Dist/Dir	Street Name	Dist/Dir
Industrial Way	0.38 NW	SOUTH 67th St	0.62 SW
J W Peavy Dr	0.58 NE	SOUTH 69th St	0.73 SE
Kress St	0.68 NW	SOUTH 70th St	0.80 SE
Latham St	0.63 SW	SOUTH 71st St	0.92 SE
Lathrop St	0.90 NE	SOUTH Sgt Macario Ga	0.41 SE
Lenox St	0.80 SW	SOUTH Wayside Dr	0.28 SE
Linwood St	0.48 SW	Supply Row	0.88 SW
Lockwood Dr	0.99 NW	Terminal St	0.00 --
Mack —	0.05 NW	Texas Ave	0.67 SW
Maltby St	0.52 SE	Turkey St	0.75 NW
Marsden St	0.34 SW	W Hedrick St	0.80 SE
Mc Farland St	0.22 NW	Waycrest	0.56 NE
N 65th St	0.31 SW	WEST Hedrick St	0.80 SE
N 66th St	0.11 SW	Wooding St	0.57 SE
N 67th St	0.16 SE	Zoltowski St	0.81 NE
N 70th St	0.53 SE		

Environmental FirstSearch Federal Databases and Sources

ASTM Databases:

CERCLIS: *Comprehensive Environmental Response Compensation and Liability Information System.* The EPA's database of current and potential Superfund sites currently or previously under investigation. Source: Environmental Protection Agency.

Updated quarterly.

CERCLIS-NFRAP (Archive): *Comprehensive Environmental Response Compensation and Liability Information System Archived Sites.* The Archive designation means that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL). This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Updated quarterly.

ERNS: *Emergency Response Notification System.* The EPA's database of emergency response actions. Source: Environmental Protection Agency. Data since January, 2001, has been received from the National Response Center as the EPA no longer maintains this data.

Updated quarterly.

FINDS: *The Facility Index System.* The EPA's Index of identification numbers associated with a property or facility which the EPA has investigated or has been made aware of in conjunction with various regulatory programs. Each record indicates the EPA office that may have files on the site or facility. Source: Environmental Protection Agency.

Updated semi-annually.

NPL: *National Priority List.* The EPA's list of confirmed or proposed Superfund sites. Source: Environmental Protection Agency.

Updated quarterly.

RCRIS: *Resource Conservation and Recovery Information System.* The EPA's database of registered hazardous waste generators and treatment, storage and disposal facilities. Included are RAATS (RCRA Administrative Action Tracking System) and CMEL (Compliance Monitoring & Enforcement List). Source: Environmental Protection Agency.

RCRA TSD: *Resource Conservation and Recovery Information System Treatment, Storage, and Disposal Facilities.* The EPA's database of RCRIS sites which treat, store, dispose, or incinerate hazardous waste. This information is also reported in the standard RCRIS detailed data.

ASTM Databases (continued):

RCRA COR: Resource Conservation and Recovery Information System Corrective Action Sites. The EPA's database of RCRIS sites with reported corrective action. This information is also reported in the standard RCRIS detailed data.

RCRA GEN: Resource Conservation and Recovery Information System Large and Small Quantity Generators. The EPA's database of RCRIS sites that create more than 100kg of hazardous waste per month or meet other RCRA requirements. Included are RAATS (RCRA Administrative Action Tracking System) and CMEL (Compliance Monitoring & Enforcement List).

RCRA NLR: Resource Conservation and Recovery Information System sites No Longer Regulated. The EPA's database of RCRIS sites that create less than 100kg of hazardous waste per month or do not meet other RCRA requirements.

All RCRA databases are Updated quarterly

Environmental FirstSearch Federal Databases and Sources

Non-ASTM Databases:

HMIRS: Hazardous Materials Incident Response System. This database contains information from the US Department of Transportation regarding materials, packaging, and a description of events for tracked incidents.

Updated quarterly.

NCDB: National Compliance Database. The National Compliance Data Base System (NCDB) tracks regional compliance and enforcement activity and manages the Pesticides and Toxic Substances Compliance and Enforcement program at a national level. The system tracks all compliance monitoring and enforcement activities from the time an inspector conducts and inspection until the time the inspector closes or the case settles the enforcement action. NCDB is the national repository of the 10 regional and Headquarters FIFRA/TSCA Tracking System (FTTS). Data collected in the regional FTTS is transferred to NCDB to support the need for monitoring national performance of regional programs.

Updated quarterly

NPDES: National Pollution Discharge Elimination System. The EPA's database of all permitted facilities receiving and discharging effluents. Source: Environmental Protection Agency.

Updated semi-annually.

NRDB: National Radon Database. The NRDB was created by the EPA to distribute information regarding the EPA/State Residential Radon Surveys and the National Residential Radon Survey. The data is presented by zipcode in Environmental FirstSearch Reports. Source: National Technical Information Service (NTIS)

Updated Periodically

Nuclear: The Nuclear Regulatory Commission's (NRC) list of permitted nuclear facilities.

Updated Periodically

PADS: PCB Activity Database System

The EPA's database PCB handlers (generators, transporters, storers and/or disposers) that are required to notify the EPA, the rules being similar to RCRA. This database indicates the type of handler and registration number. Also included is the PCB Transformer Registration Database.

Updated semi-annually.

Receptors: 1995 TIGER census listing of schools and hospitals that may house individuals deemed sensitive to environmental discharges due to their fragile immune systems.

Updated Periodically

Environmental FirstSearch Texas Databases and Sources

1. **LANDFILLS:** The Texas Natural Resource Conservation Commission listing of all permitted solid waste landfills, transfer stations, and incinerators as maintained by Office of Office of Permitting, Remediation and Registration, Waste Permits Division, Municipal Solid Waste Permits Section.

Updated Yearly

2. **LUST:** Leaking Underground Storage Tanks. The Texas Natural Resource Conservation Commission listing of all leaking underground petroleum storage tanks as maintained by the Office of Office of Permitting, Remediation and Registration, Remediation Division, Petroleum Storage Tank Program.

Updated Quarterly

3. **STATE SITES:** Currently includes sites from three programs of The Texas Natural Resource Conservation Commission's Office of Permitting, Remediation and Registration, Remediation Division. The State Superfund Registry listing is maintained by the Superfund Site Discovery and Assessment Program. Also included are all sites in the Voluntary Cleanup Program (VCP) and the Innocent Owner/Operator Program (IOP).

Updated Quarterly

4. **UST:** The Texas Natural Resource Conservation Commission's Petroleum Storage Tank Registration File as maintained by the Office of Permitting, Remediation and Registration, Remediation Division, Petroleum Storage Tank Program. This database includes above ground storage tanks.

Updated Quarterly

5. **STATE WELLS:** Public Water Supply Sources. The Texas Natural Resource Conservation's database of public drinking water well and surface water intake sites in the state of Texas. The locations for these data were obtained from the Office of Permitting, Remediation and Registration, Water Supply Division as recorded from several sources:

Texas Department of Agriculture (TDA)
Texas Water Development Board (TWDB)
Texas Natural Resource Conservation Commission (TNRCC), or predecessor agencies.
Well Driller
Engineering/Environmental Firm
U.S. Geological Survey (USGS)
Texas Dept. of Health (TDH)
Texas General Land Office
North Central Texas Council of Governments
Owner of the water source
Texas Department of Parks and Wildlife
Railroad Commission of Texas (RRC)
Texas Department of Transportation
Bureau of Economic Geology, The University of Texas at Austin
Unknown
Underground Water Conservation District
Other Sources




Environmental FirstSearch

1 Mile Radius

ASTM: NPL, RCRACOR, STATE

Environmental
FIRSTS

NAVIGATION , TERMINA , HOUSTON TX 77011

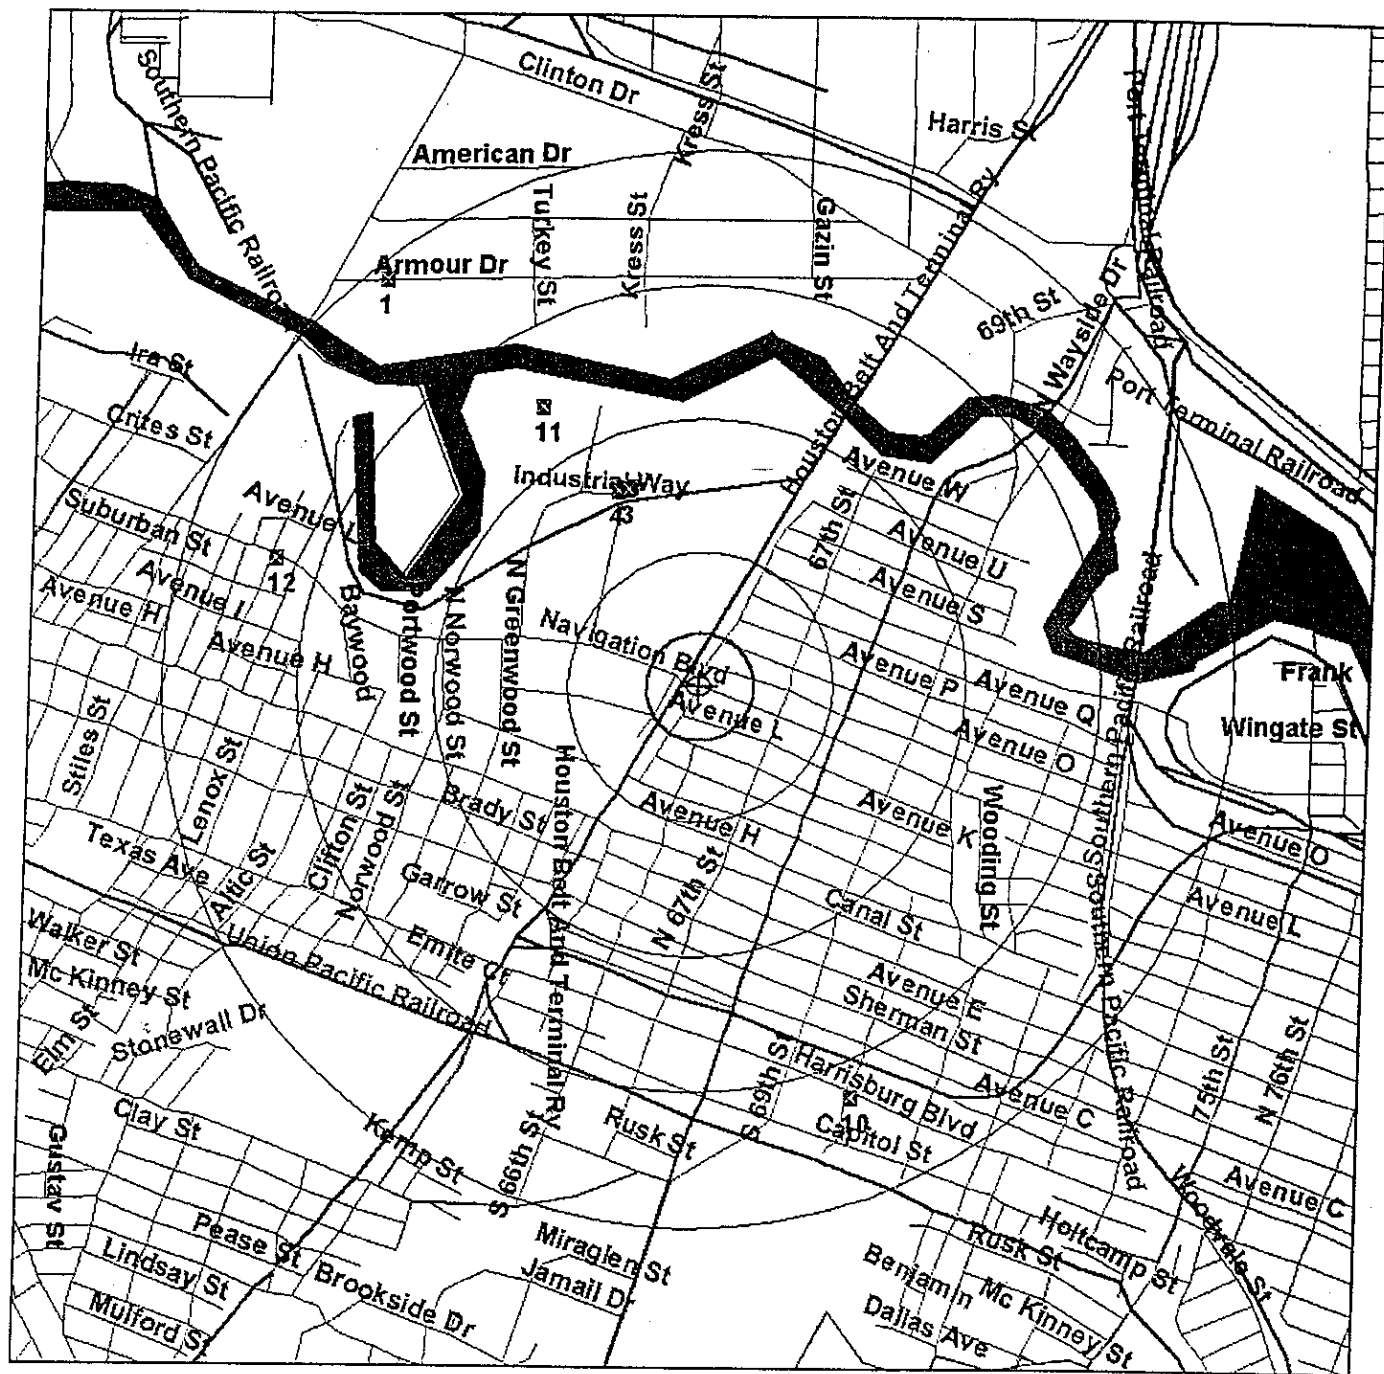

Source: 1999 U.S. Census TIGER Files

- Target Site (Latitude: 29.74661 Longitude: -95.307333)
- Identified Site, Multiple Sites, Receptor
- NPL, Solid Waste Landfill (SWL) or Hazardous Waste
- Railroads
- Black Rings Represent 1/4 Mile Radii; Red Ring Represents 500 ft. Radius



Environmental FirstSearch

.5 Mile Radius

ASTM: CERCLIS, RCRATSD, LUST, SWL

Environmental
FIRSTSEARCH

NAVIGATION , TERMINA , HOUSTON TX 77011



Source: 1999 U.S. Census TIGER Files

Target Site (Latitude: 29.74661 Longitude: -95.307333)

Identified Site, Multiple Sites, Receptor

NPL, Solid Waste Landfill (SWL) or Hazardous Waste

Railroads

Black Rings Represent 1/4 Mile Radii; Red Ring Represents 500 ft. Radius





Environmental FirstSearch

.25 Mile Radius
ASTM: NFRAP, RCRAGEN, UST, OTHER

Environmental
FIRSTSEARCH

NAVIGATION , TERMINA , HOUSTON TX 77011



Source: 1999 U.S. Census TIGER Files

Target Site (Latitude: 29.74661 Longitude: -95.307333)

Identified Site, Multiple Sites, Receptor

NPL, Solid Waste Landfill (SWL) or Hazardous Waste

Railroads

Black Rings Represent 1/4 Mile Radii; Red Ring Represents 500 ft. Radius






Environmental FirstSearch

.15 Mile Radius
ASTM: SPILLS90, ERNS

Environmental
FIRSTS

NAVIGATION , TERMINA , HOUSTON TX 77011

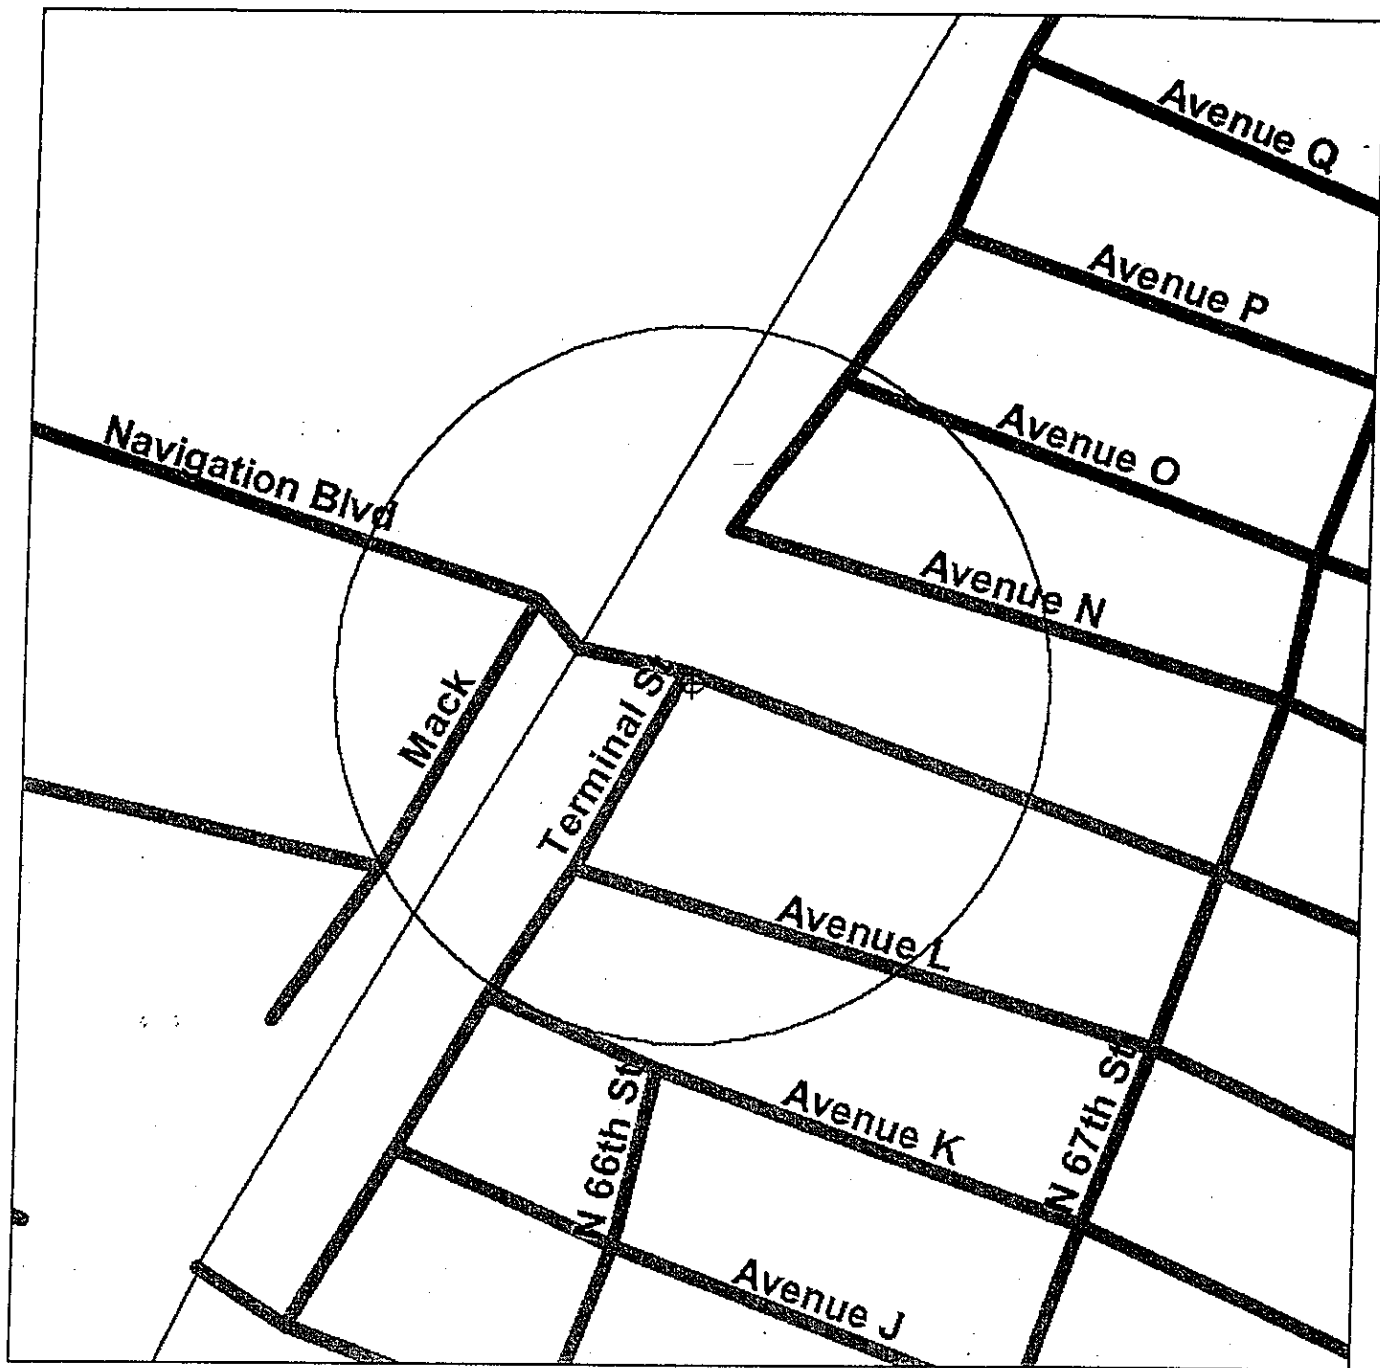

Source: 1999 U.S. Census TIGER Files

Target Site (Latitude: 29.74661 Longitude: -95.307333)

Identified Site, Multiple Sites, Receptor

NPL, Solid Waste Landfill (SWL) or Hazardous Waste

Railroads



Black Rings Represent 1/4 Mile Radii; Red Ring Represents 500 ft. Radius

APPENDIX E ADDITIONAL INFORMATION

HOUSTON FIRE DEPARTMENT

FIRE PREVENTION DIVISION

FACSIMILE TRANSMITTAL SHEET

TO:	JOYCE GRAVES	FROM:	CAROLYN CITIZEN
COMPANY:	QUANTUM	DATE:	SEPTEMBER 20, 2004
FAX NUMBER:	713/9617512	FAX NUMBER:	713/865/7136
PHONE NUMBER:	713/961/9975	PHONE NUMBER:	713/865/7100
RE:	OPEN RECORD REQUEST	TOTAL NO. OF PAGES INCLUDING COVER:	1

☒ URGENT ☐ FOR REVIEW ☐ PLEASE COMMENT ☐ PLEASE REPLY ☐ PLEASE RECYCLE

NOTES/COMMENTS:

WE HAVE RESEARCHED OUR FILE FOR INFORMATION YOU HAVE REQUESTED FROM THE TEXAS OPEN RECORD ACTS, ON LOCATIONS AT 6641, 6633 AND 6607 NAVIGATION.

NO FILES WAS FOUND FOR THESE LOCATIONS. THESE ARE VACANT LOTS AND WE DO NOT INSPECT VACANT PROPERTY.


THANK YOU

2931 WEST 12TH STREET
HOUSTON, TEXAS 77008


①

10,432 SA

PARCEL S71-050
Navigation and Terminal

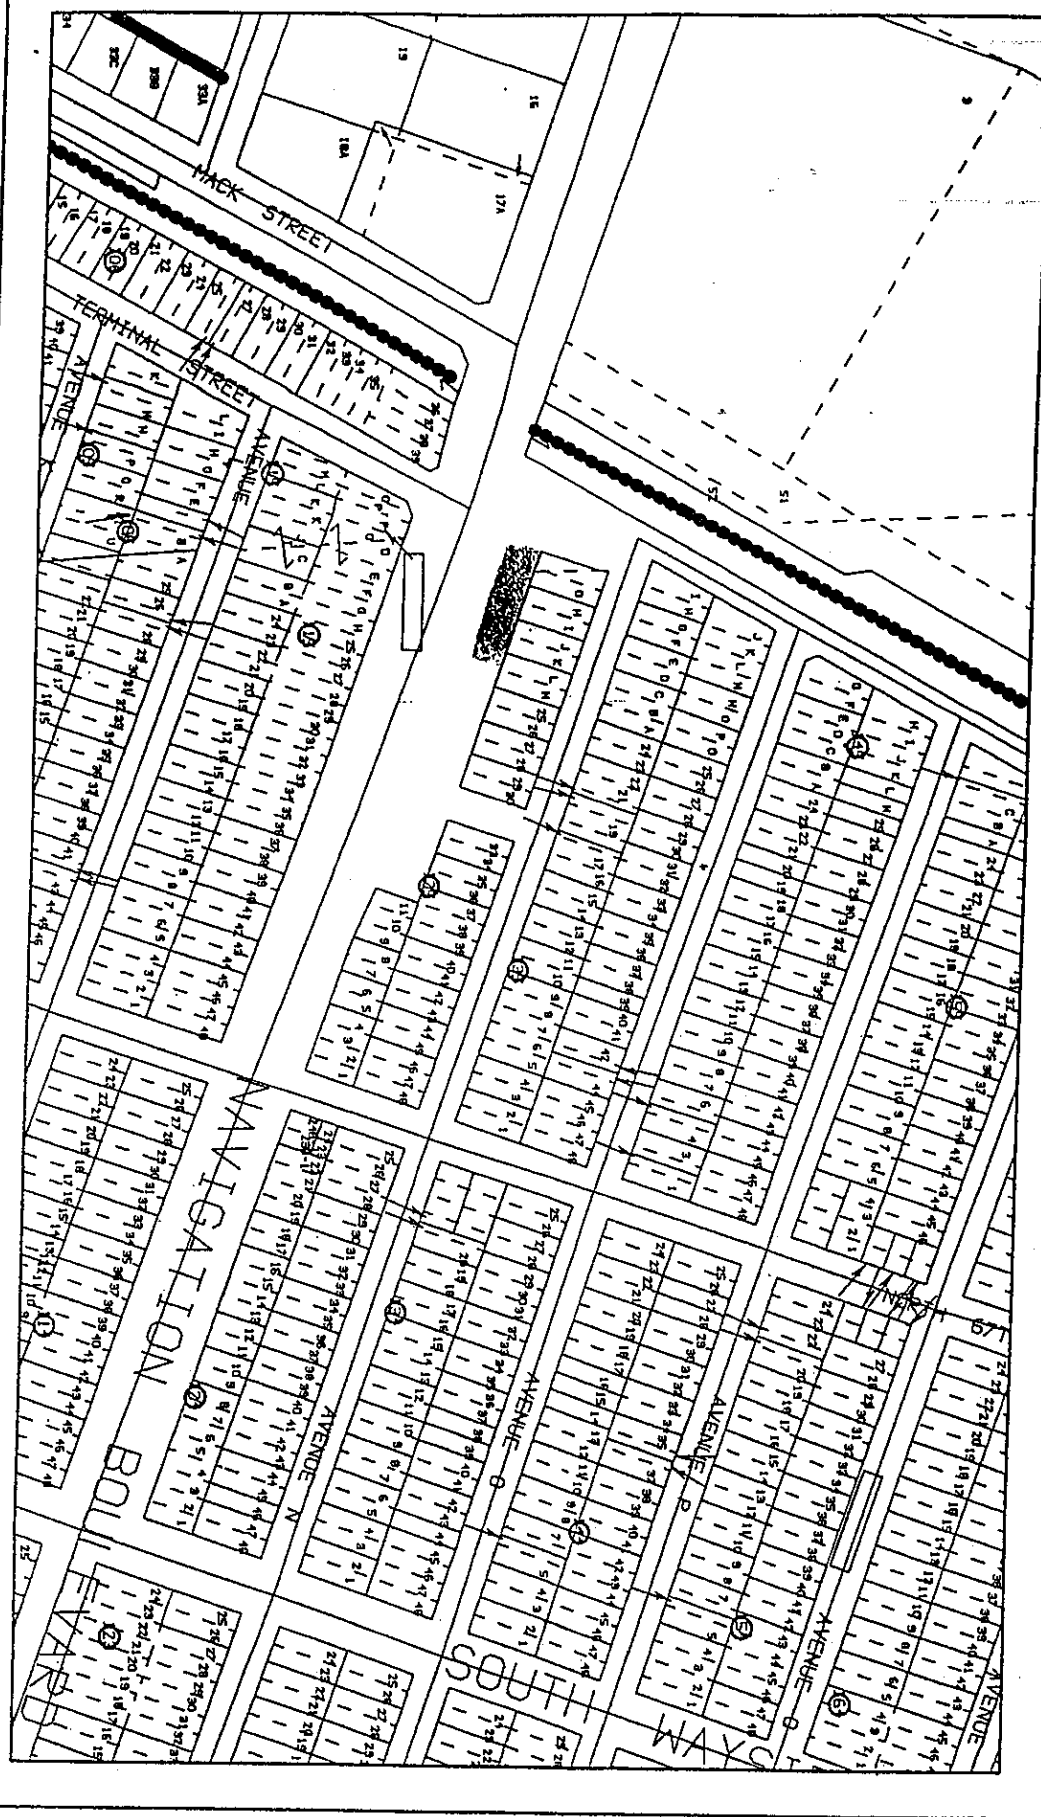

571-050

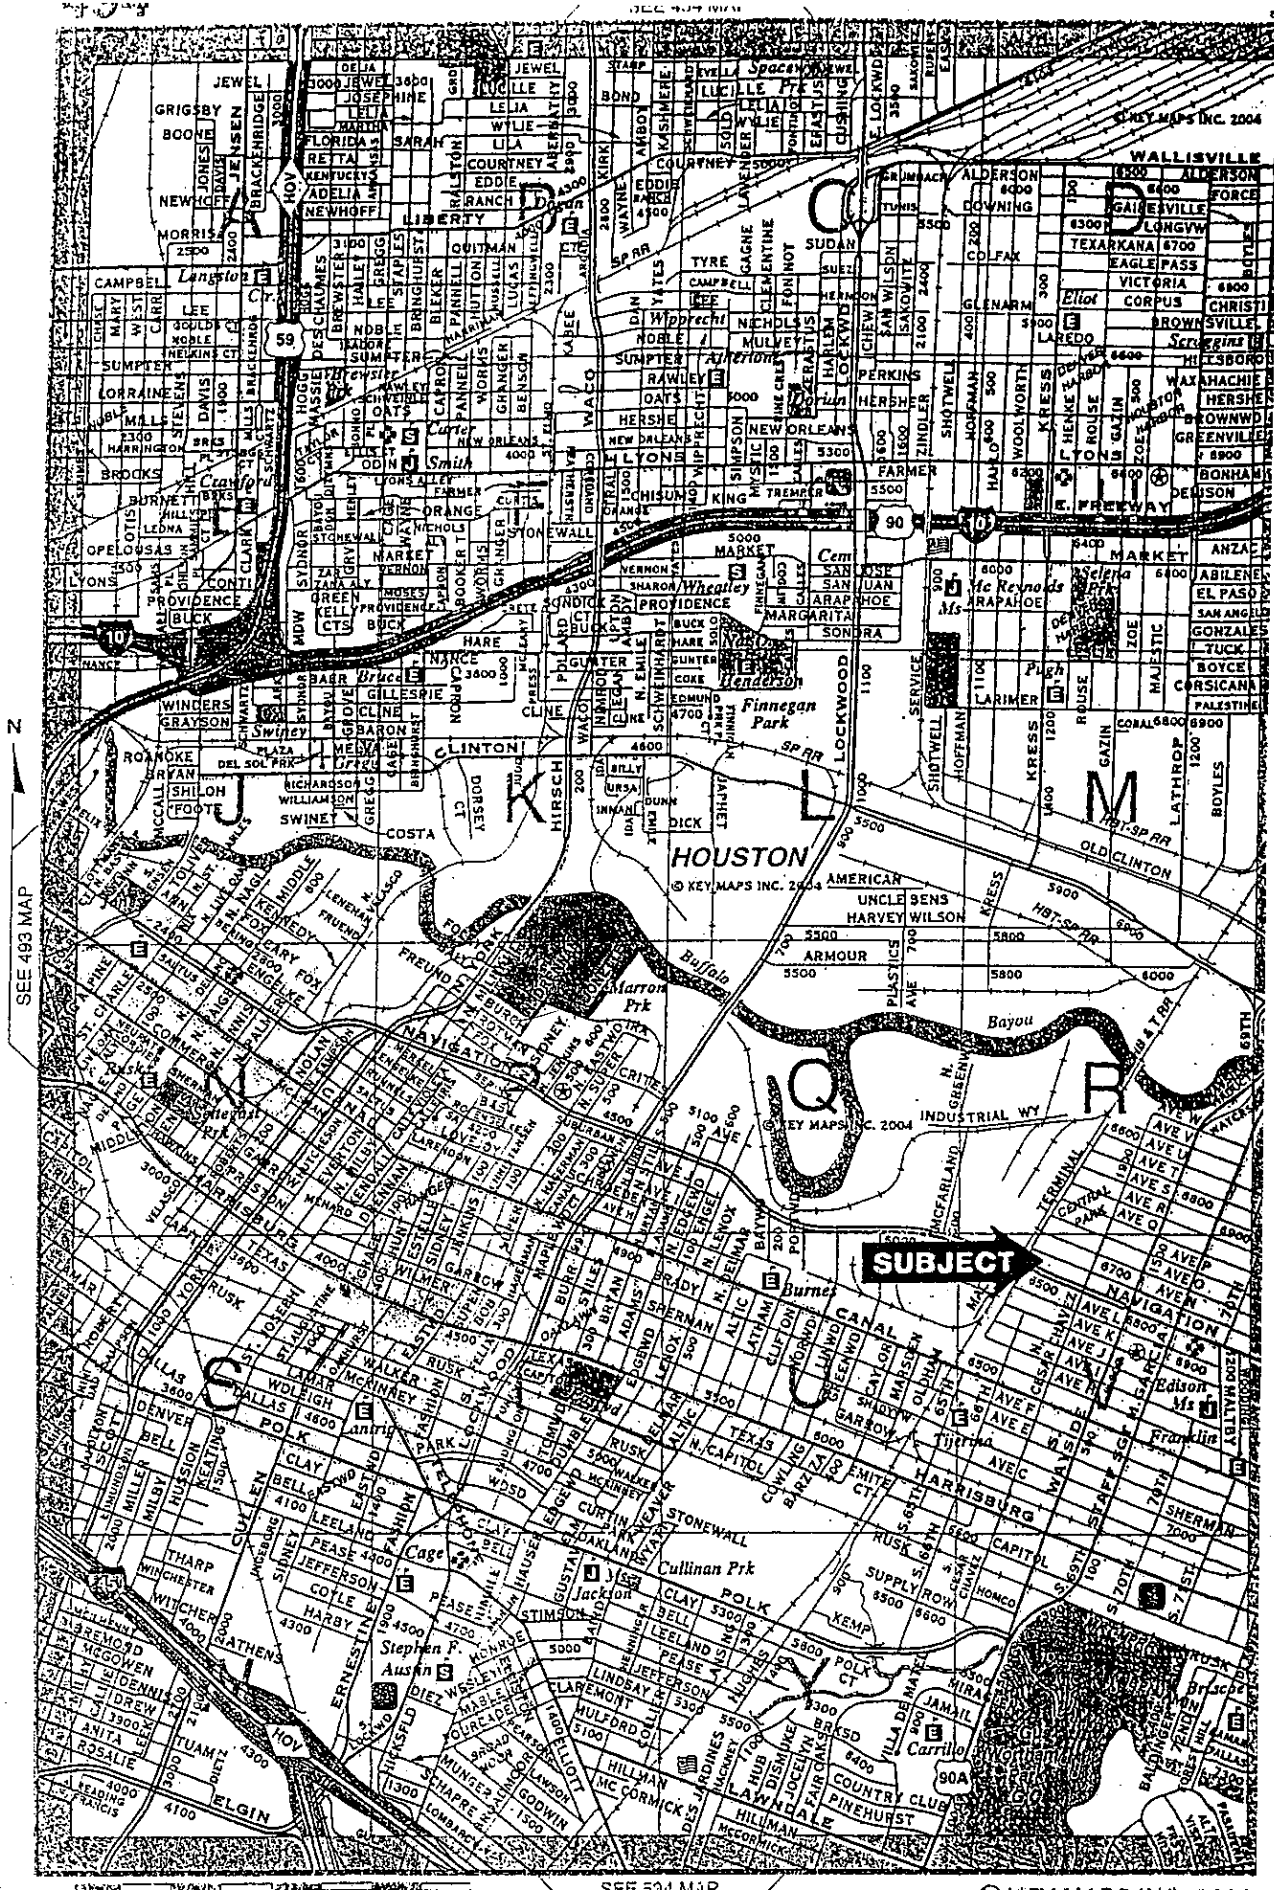

SEE 493 MAP

SEE 534 MAP

© KEY MAPS INC. 2004